



Vehicle History Summary



| | |
|-----------------|-------------------|
| Fleet # | FT03 |
| Registration | XQ44BL |
| Make | Western Star |
| Model | 4864FXB |
| VIN / Chassis # | 5KKJBEBG4JPJY9927 |
| Build Date | 2018 |

| Date | Reading / Units | Type / Repairer Notes | Repairer |
|------------|-----------------|--|--------------------|
| 14/01/2026 | | Headlight R-35115 Travelled to site, 5-12-25 Inspected truck and found headlight missing and surround to hold headlight in. Went and purchased new ones and fitted up to truck. Tested all ok | Willy's Mechanical |
| 17/12/2025 | | DIESEL LEAK R-35002 nspected and found a leaking diesel line to rear engine for ac. Removed and purchased new line. Secured in place and tested all ok. Checked and found need new front shocks and also cab shocks need replacing. Ordered parts. | Willy's Mechanical |
| 17/12/2025 | | Auto Electrical Repairs, FRONT SHOCKS, REAR CAB SHOCKS R-35001 Removed and replaced front shocks. Removed and replaced rear cab shocks. Repaired wiring on left middle tank lights. On same tank found rubber under strap had moved out, refitted. Secured left rear guard as was loose | Willy's Mechanical |
| 17/12/2025 | | AIR BAG, Auto Electrical Repairs, Bonnet Rubbers R-34994 Removed and replaced right rear air bag. Refitted side guard on right side bonnet. Replaced bonnet side rubbers. Refitted docking station and located tablet and made sure charging and working correctly. General check over of truck. | Willy's Mechanical |
| 14/10/2025 | | Auto Electrical Repairs R-34574 Inspected and found no blinker on front left of truck. Followed wiring and found broken wiring. Repaired wiring and tested all ok. Checked rest of lights and found parkers out on left front. Followed wiring again and found more broken wires. Repaired and tested all ok. Found right tail light assembly not working. Found power going in but no lights working. Removed light and found broken wires. Repaired and tested all ok | Willy's Mechanical |
| 13/10/2025 | | Wheel Alignment R-34568 1. Carried out pre alignment check. Drive truck onto wear detection plates and carry out the following checks. Checked wear or damage, all suspension bushes front and rear, U-bolts, Kingpins, Tie rods, Drag Links, Shocks, springs and tyre pressures. 2. Carried out front alignment. Carried out front axle wheel alignment- (Single steer)- Check and adjust toe and caster, check cambers and axle set back. 3. Carried out rear alignment Dual Axle Carried out full alignment on rear axle (dual axle).Check and adjust out of square. Please see report for final adjustment figures. (On request) | JT FOSSEY |
| 08/10/2025 | | AIR LEAK R-34564 Inspected and found air leaking from behind brake controls. Removed from dash and gained access to air relays. Found leak and repaired. Reassembled tested all ok. | Willy's Mechanical |
| 08/09/2025 | | AIR FITTING R-34560 Inspected and found fitting snapped off in fan. Removed piece of fitting from fan and removed end of air fitting. Tried getting one in town, no luck. Had old one silver soldered in fitting and screwed other end back into fan. Tested all ok. Replaced both blinkers in side of bonnet, Replaced both roof marker lights. Remove and replace left hand headlight. Also chase down broken wire for inner headlight not working correctly. Replaced right front blinker assembly | Willy's Mechanical |
| 14/08/2025 | 1,147,809 kms | C - Annual S-20181 | Black Truck and Ag |

| Date | Reading / Units | Type / Repairer Notes | Repairer |
|------------|-----------------|--|------------------------------|
| | | C-ANNUAL Change fuel filters, Check coolant level and concentration, Check all belts - NEEDS 1 X BELT & 1 X TENSIONER, Grease turntable plate, Check clutch adjustment, Check clutch fluid level if applicable, Check all lights - NEEDS 1 X MARKER LIGHT Check batteries water and terminal, Check front hub levels, Check steering play, Report any work needing attention, Return vehicle clean off any grease marks, Fit service sticker, Check units before they are greased, Grease and replace any broken or missing nipples, Check grease level in auto greasers - PUMP UN-SERVICABLE, Blow radiator out if necessary, Check radiator intercooler hoses, Check gearbox and diff oils, replace if necessary, Check lights and wiper operation plus wiper wear Check brake adjustment, adjust brakes as required, Check brake linings and wheel seals, Jack up front wheels check bearing movement, Check king pins, Blow out air cleaners, replace if necessary | |
| 14/08/2025 | 1,147,809 kms | B - 40,000 - 45,000 S-20180 B-SERVICE Carry out B & C Service as per Land transport service schedule | Black Truck and Ag |
| 06/05/2025 | | Air Leak, Coolant Leak, Horton Fan R-33154 See attached Inv | Superior Diesel Maintenance |
| 06/05/2025 | | Coolant Leak, Horton Fan R-33430 New stem fitting for horton fan, installed new seal on fittings for coolant leak. | Superior Diesel Maintenance |
| 28/04/2025 | 1,115,212 kms | Engine R-33126 Diagnose & repair engine over heating. | Superior Diesel Maintenance |
| 17/04/2025 | | Air Conditioner Hose, Air Drier, Seals R-33071 Replaced low side hose from compressor to RTX valve, Replaced drier, seals & valves | MICK COLLYER AUTO ELECTRICAL |
| 29/01/2025 | | Ice Pack R-31985 Disconnected main power to ice pack in battery box. Removed ice pack cover. Removed center clips a rear. Removed power wire or fuel pump. | Glen Artney Truck Repairs |
| 24/01/2025 | | Parking Lights R-31984 Inspected truck for parkers not working on tanks. Found there was a break under the cab. Repaired wiring and tested. Found on both sides top step lights not working, repaired wiring tested all ok. Repaired wiring to blinker on left side. | Willy's Mechanical |
| 17/01/2025 | | B - 40,000 - 45,000 S-19233 B SERVICE & REPAIRS COMPLETED SEE INV – 1901513 | Black Truck and Ag |
| 17/01/2025 | | Exhaust R-32360 L/H side flex tube replaced | Black Truck and Ag |
| 03/01/2025 | | Battery R-32071 Replaced 4 batteries | Willy's Mechanical |
| 28/10/2024 | | Starter Motor R-31405 R&R STARTER MOTOR | Black Truck and Ag |
| 27/09/2024 | | Indicator Wiring R-31126 Power fault at Suzi coil, plug replaced to fix faulty indicator. | MICK COLLYER AUTO ELECTRICAL |
| 20/08/2024 | | Charger, Power Supply, Wiring Harness R-30745 No power at charger, wired charger. | Willy's Mechanical |
| 07/08/2024 | | Indicator Relay R-30340 Replaced indicator relay | Willy's Mechanical |
| 13/07/2024 | 1,042,272 kms | B - 15,000 - 20,000kms S-18414 B service competed See Inv 68 | Marler Mechanical |
| 10/06/2024 | 1,029,498 kms | Radiator R-29903 Replaced Radiator | Marler Mechanical |
| 05/06/2024 | | Grease & Brake Adjust R-29880 Grease and Adjust Brakes | Marler Mechanical |

| Date | Reading / Units | Type / Repairer Notes | Repairer |
|------------|-----------------|--|------------------------------|
| 30/05/2024 | | Flasher Can R-29757 Replaced Flasher Can | MICK COLLYER AUTO ELECTRICAL |
| 30/05/2024 | | Suzi Coils R-29750 Replaced all Suzi Coils | MICK COLLYER AUTO ELECTRICAL |
| 03/05/2024 | 1,018,073 kms | Auto Greaser, Cab Mount, Fuel Tank Lights, Oil and Filters R-29887 Changed oil and oil filter Filled up Auto Greaser Repaired Lights on Fuel Tank Changed Cab Mounts | Marler Mechanical |
| 17/04/2024 | 1,011,952 kms | Airbag R-29361 RnR 2nd Axle RH Airbag | Superior Diesel Maintenance |
| 08/03/2024 | 999,330 kms | Air Intake Pipe, Air Lines, Bonnet Mount R-28915 Installed new Intake Pipe and Clamps Replaced Front Bonnet Mounts Repaired Worn Air Lines | Superior Diesel Maintenance |
| 08/03/2024 | | Fuse R-28914 Replaced Indicator Fuse | MICK COLLYER AUTO ELECTRICAL |
| 26/02/2024 | 994,474 kms | Air Leak, Alternator, Battery, Coolant, Header Tank, Radiator Cap, Steps R-28755 RnR Radiator Cap RnR Header Tank RnR Alternator Changed Battery Fixed Air Leaks Tightened Passenger Side Steps Topped up with Coolant | Lowery Contracting |
| 17/02/2024 | | Battery R-28630 Replaced 4x Batteries | MOBAS |
| 18/01/2024 | | Dosing Unit, Fault Codes, Oil Pressure Switch, Tank Light Wiring R-28273 Repaired Wiring for Dosing Unit Air Supply Solenoid Replaced Oil Pressure Switch Cleared Codes Repaired Tank Light Wiring | Pro Truck Electrical |
| 15/01/2024 | 992,293 kms | Sleeper Air R-28396 Serviced and Tuned up Sleeper Air | Brisbane Workshop |
| 08/01/2024 | 985,520 kms | Fit T-13919 Fit 8x 11R22.5 148/145L BS M866 Pos 5,6,7,8,9,10,11,12 | Bridgestone |
| 08/01/2024 | 985,500 kms | C - 100,000 -150,000 S-17555 C service completed | Brisbane Workshop |
| 03/01/2024 | 985,500 kms | Hanger Bushes, Hinges, King Pins, RX module, Spring Eye Bushes, Steer Brakes, Turntable, Wheel Bearings R-28440 Replaced King Pins Replaced Hanger Bushes and Spring Eye Bushes Replaced Turntable Replaced Banner Hinge Replaced Steer Brakes and Wheel Bearings Replaced RCX Module | Brisbane Workshop |
| 14/11/2023 | 968,855 kms | Indicators R-27556 RnR Left Indicator | Willy's Mechanical |
| 11/10/2023 | 962,225 kms | B - 40,000 - 45,000 S-17193 B service completed | Brisbane Workshop |
| 11/10/2023 | 962,225 kms | AC Belt, Air Filter, Bonnet Pivot, Brake Drums, Brake Linings, Diff, Diff Filter, Diff Oil, Engine Mounts, Fan Belt, Idlers and Tensioners, Radiator Cap, Shock Absorbers, Sump Gasket, Torque Rod, Wiper Blades R-27174 Changed both Diff Oils and Filters Resealed Front Diff Replaced Drive Brake Linings and Brake Drums Replaced Drive Shocks Replaced Rear Torque Rods Replaced idlers Replaced Tensioners Replaced AC Belt Replaced Fan Belt Replaced Sump Gasket Replaced Front and Rear Engine Mounts Replaced Wiper Blades Replaced Air Filters Replaced RH Bonnet Pivot Replaced Radiator Cap | Brisbane Workshop |
| 21/09/2023 | | AdBlue Pump R-26859 Replaced Faulty Adblue Pump | Superior Diesel Maintenance |

| Date | Reading / Units | Type / Repairer Notes | Repairer |
|------------|-----------------|---|--------------------------------|
| 20/09/2023 | | Clearance Light, Indicators, Indicator Wiring, Spotlight Wiring R-26844 Repaired Spotlight Wiring Replaced 2x Clearance Lights Repaired RH Front Indicator Wiring Replaced LH Front Indicator | Willy's Mechanical |
| 07/08/2023 | | Adjust Brakes, Blow Out Air Cleaner, Blow Out Radiator, Clutch Adjustment, Engine Oil, Fuel Filter R-26337 Changed Engine oil and Fuel Filters Adjusted Brakes Adjusted Clutch Filled Auto Greaser Blow out Radiator Blow Out Air Cleaner | Lowery Contracting |
| 28/07/2023 | | Stone Guard R-26238 Fit Stone Guard | AK Fabrication |
| 14/07/2023 | | Phone Cradle, Phone Kit R-26082 RnR Phone Cradle, wired up new Phone cables Set up new Phone Remounted Dash Cam | Willy's Mechanical |
| 07/06/2023 | 916,817 kms | Degrease and wash Engine R-25592 Degrease and wash Engine | Gillies Enterprises |
| 07/06/2023 | | Windscreen Replacement R-25599 Replace LH and RH Windscreens | HARDMAN WINDSCREENS |
| 07/06/2023 | 916,817 kms | B - 40,000 - 45,000 S-16605 B service completed | Gillies Enterprises |
| 25/05/2023 | 910,695 kms | Window, Window Regulator R-25286 Removed old window and window regulator refitted new window regulator and window glass to door | Superior Diesel Solutions |
| 22/05/2023 | 913,178 kms | Headlight R-25233 see attached INV300 | Gillies Enterprises |
| 15/05/2023 | | Adblue, Marker Lights R-25248 R&R adblue harness & reset. R&R marker lights | MICK COLLYER AUTO ELECTRICAL |
| 08/05/2023 | 907,593 kms | Adblue, Governor valve R-24942 Repair air leak on compressor governor valve Repair broken wires on adblue pump & clear codes | Gillies Enterprises |
| 17/04/2023 | 899,561 kms | Fuel Pump R-24891 Connected copper washer to stop leak in fuel pump | Glen Artney Truck Repairs |
| 31/03/2023 | 895,480 kms | B - 40,000 - 45,000 S-16215 B service completed See attached inv 233 | Gillies Enterprises |
| 18/03/2023 | 891,943 kms | Airbag R-24892 Replaced 1 X cab air bag | Butlers Mechanical Port August |
| 16/03/2023 | 869,960 kms | After Treatment R-24673 See attached inv 9707710 | Cummins south pacific |
| 15/03/2023 | | Relay R-24490 R&R faulty relay & flasher relay | Pro Truck Electrical |
| 08/02/2023 | | Fuel Sender R-24249 Removed fuel sender and checked operation, found the fuel sender operational. Inspected and tested the fuel sender wiring to the RX module, found wiring operational Fuel gauge operation | Pro Truck Electrical |
| 20/01/2023 | | Injector Lines R-24060 Injector hose cracked - replaced | Pro Truck Electrical |
| 20/01/2023 | 856,741 kms | C - Annual S-15861 C Service Completed | Brisbane Workshop |
| 20/01/2023 | | Window R-24043 | Pro Truck Electrical |

| Date | Reading / Units | Type / Repairer Notes | Repairer |
|------------|-----------------|---|-----------------------|
| | | Window jammed fixed window and plugged in switch | |
| 12/01/2023 | | Harness connector R-24247 See attached INV 9668158 for repairs | Cummins south pacific |
| 29/12/2022 | | Sleeper Air R-23952 Service sleeper air | Brisbane Workshop |
| 18/12/2022 | | Windows R-23694 Removed drivers door interior card and inspected window. Found window came out of track Raised glass to seal and locked into position with drive motor | Western Truck Group |
| 16/12/2022 | | PRESSURE CHECK T-12274 Pressure check | Bridgestone |
| 15/12/2022 | | Headlight R-23710 supply new retaining ring for headlight. Fit headlight, tested all ok | Pro Truck Electrical |
| 15/12/2022 | | Air Conditioner R-23706 Replaced a/c compressor, pressure switch and connector | Pro Truck Electrical |
| 09/12/2022 | | Check Engine Light R-23531 Diagnose engine light fault. Connect scan tool and found Nox sensor codes. Checked harness from sensor to ECM all ok. Replaced faulty sensor | Pro Truck Electrical |
| 09/12/2022 | | Exhaust, Steering Wheel, Vehicle Safety Check R-23678 "A" Service completed New flex from turbo pipe to exhaust New bonnest indicator & fix wiring New steering wheel | Brisbane Workshop |
| 16/11/2022 | 825,017 kms | Radio R-23112 inspect radio perform test on radio audio output restored preform power cycle and retest | Pro Truck Electrical |
| 14/11/2022 | 821,414 kms | Valves and Jakes R-23102 Perform overhead adjustments on all valves and jakes | Brisbane Workshop |
| 02/11/2022 | 821,107 kms | B - 40,000 - 45,000 S-15476 B service completed | Brisbane Workshop |
| 01/10/2022 | | Ice Pack, Wiper Blades R-23659 Ice pack making fumes put dash cam back up Drivers side4 wiper blade keeps coming out | Brisbane Workshop |
| 08/09/2022 | | Air Conditioner, Condensor R-22803 R&R A/C condenser Vac down and regassed | Pro Truck Electrical |
| 07/09/2022 | 759,447 kms | Fit T-11926 8 X fit 11R22.5 148/145L BS M866 Pos 5, 6, 7, 8, 9, 10, 11, 12 | Bridgestone |
| 06/09/2022 | 790,623 kms | Bunk Cooler, Diff Oil, Gearbox Oil, Mirror R-22764 Replace diff oils and fitter Replace gearbox oil and fitter Replace broken RH spot mirror Find bunk cooler fault, recrimp wire and refit to sensor | Brisbane Workshop |
| 25/08/2022 | | Aerial R-22923 Broken aerial, get parts Run new aerial cable Connect up to phone kit | Pro Truck Electrical |
| 23/08/2022 | | Balance, Fit T-11893 2 X fit 295/80R22.5 152/148M BS R154 Pos 1 & 2 Balance | Bridgestone |
| 22/08/2022 | | Governor valve, Vehicle Safety Check R-22627 A Service completed New Radiator stuy New jaws in turn table Fix indicators RH side Adjust govenor valve | |
| 20/08/2022 | | Gear Stick, Windscreen R-23650 Gear stick broken Drivers side windscreen glass broken - Alpha glass 22/08/2022 | Brisbane Workshop |
| 07/07/2022 | | Wiring R-21667 | Pro Truck Electrical |

| Date | Reading / Units | Type / Repairer Notes | Repairer |
|------------|-----------------|---|-----------------------------|
| | | REPAIRED ACCESSORY LIGHT WIRING | |
| 07/07/2022 | | Tank Light, Wipers R-22157 R&R WIPER MOTOR REPAIR BROKEN WIRE TO TANK LIGHTS | Pro Truck Electrical |
| 04/07/2022 | 755,761 kms | General Repairs, Vehicle Safety Check R-21645 COMPLETED 'A' CHECK GENERAL REPAIRS AS PER SCANNED DOCUMENT ATTACHED | Brisbane Workshop |
| 01/07/2022 | | Electrical R-21681 CHECK TRAILER ELECTRICS - BLINKERS NOT WORKING ON TRAILER | Brisbane Workshop |
| 20/06/2022 | | Fit T-11733 1 X 11R22.5 P/R FIT POS 6 | Bandag Adelaide Independent |
| 14/06/2022 | 745,805 kms | Air Leak, Lights, Steering Column R-21905 AIR LEAK STEERING COLUMN BANGING BOLT IN L/H SPOT LIGHT | Brisbane Workshop |
| 14/06/2022 | 745,805 kms | Airbag, Lights, Steering Column R-21770 NEW LF REAR AIR BAG REPLACE BOLT IN LH TOP SPOT LIGHT INSPECT STEERING COLUMN - BANGING | Brisbane Workshop |
| 26/05/2022 | 736,846 kms | B - 40,000 - 45,000 S-14726 B service completed | Brisbane Workshop |
| 26/05/2022 | 736,846 kms | Suzi Coils R-21346 Replaced air & electrical suzies | Brisbane Workshop |
| 11/05/2022 | 724,662 kms | Wiring R-21272 Repaired wiring to headlight | Pro Truck Electrical |
| 03/04/2022 | 724,660 kms | Grease & Safety Check R-21251 | Brisbane Workshop |
| 29/03/2022 | 716,905 kms | Wiper Blades R-20634 R & R WIPER BLADES | Brisbane Workshop |
| 14/03/2022 | 707,209 kms | Air Leak, Bonnet Mount, Mirror Motors, Radiator mounts R-21958 AIR LEAK PASSENGER SIDE REATTACH MIRROR MOTOR BUTTERFLY HINGES/BONNET MOUNTS RADIATOR MOUNT WELDED | Brisbane Workshop |
| 14/03/2022 | 707,299 kms | General Repairs, Vehicle Safety Check R-20871 COMPLETE SAFETY INSPECTION GENERAL REPAIRS AS PER R5327 | Brisbane Workshop |
| 14/03/2022 | 703,607 kms | Radiator Crossmember R-20896 REPAIRED BROKEN CROSS MEMBER | RGM Maintenance Pty Ltd |
| 13/03/2022 | | Puncture T-11597 REPAIR POS 3 | Bridgestone |
| 13/01/2022 | 678,163 kms | Battery R-20451 R & R 4 X BATTERIES | Brisbane Workshop |
| 21/12/2021 | 672,430 kms | General Repairs R-20364 COMPLETED GENERAL REPAIRS AS PER R3974 | Brisbane Workshop |
| 20/12/2021 | 669,300 kms | Starter Motor R-20365 R&R STARTER MOTOR | Pengelly |
| 10/11/2021 | | Air Conditioner R-20139 REPLACE RELAY | NQ Coolectrix |
| 02/11/2021 | | Electrical R-18914 | NQ Coolectrix |

| Date | Reading / Units | Type / Repairer Notes | Repairer |
|------------|-----------------|--|-----------------------|
| | | R&R faulty wiring for clearance lights | |
| 28/10/2021 | | Electrical R-20140 R & R DRIVING LIGHTS | Pro Truck Electrical |
| 19/10/2021 | | Headlight R-20141 REPAIR WIRING ON L/H HEADLIGHT | Pro Truck Electrical |
| 19/10/2021 | | Indicators, Turntable, Vehicle Safety Check R-19332 R&R Turntable feet bushes Safety check R&R side Indicators on both guards | Brisbane Workshop |
| 07/10/2021 | | Airbag R-19328 R&R LHS air bag | Brisbane Workshop |
| 30/09/2021 | | Mudflaps R-19369 R&R Rear Mud flap weights | Brisbane Workshop |
| 28/09/2021 | 627,807 kms | Balance, Strip & Fit T-10606 295/80R22.5 152/148M BS R154 POS 1 2 | Bridgestone |
| 14/09/2021 | 619,183 kms | B - 40,000 - 45,000 S-13937 B service completed - 1st service after rebuild See attached Inv 9121457 | Cummins south pacific |
| 03/09/2021 | 613,334 kms | Airbag, Mudflaps, Sleeper Air R-19084 R&R RHR air bag drive Service Sleeper Air R&R Bull bar mud flaps fit anti sail brackets | Brisbane Workshop |
| 31/08/2021 | | Door R-19083 R&R RH door handle | Brisbane Workshop |
| 17/08/2021 | 600,305 kms | C - Annual S-13688 C service completed | Brisbane Workshop |
| 16/08/2021 | 603,104 kms | B - 40,000 - 45,000 S-13925 B service completed Refer attached Inv 9088334 | Cummins south pacific |
| 13/08/2021 | 603,097 kms | Coolant Leak R-19080 diagnosed coolant leak, sent to Cummins | Brisbane Workshop |
| 12/08/2021 | 601,440 kms | Horton Fan R-19082 R&R Horton fan | Pro Truck Electrical |
| 08/08/2021 | 645,701 kms | C - Annual S-13931 c service completed | |
| 08/08/2021 | 645,701 kms | Filters R-19081 R&R Air Drier and PWR Steering filters | Brisbane Workshop |
| 21/07/2021 | | Lights R-19077 Fit marker lights to bull bar | Pro Truck Electrical |
| 26/06/2021 | 51,194 kms | Air System, Exhaust, Filter R-19085 Adjust boost hose clamps R&R coolant filter R&R exhaust drip tray | Brisbane Workshop |
| 16/06/2021 | | Battery R-19079 Replace all 4 batteries | Pro Truck Electrical |
| 15/06/2021 | 572,098 kms | Air Leak, Grill R-18153 Repaired air leak to hose to Ad blue box, cut & added joiner Replaced missing bottom bolt LH side of grill | Brisbane Workshop |
| 07/06/2021 | 560,513 kms | Doser Pump R-18225 See attached inv 8976836 | Cummins south pacific |

| Date | Reading / Units | Type / Repairer Notes | Repairer |
|------------|-----------------|--|----------------------------------|
| 02/06/2021 | 560,520 kms | Lights R-19078 Replace headlight | Pro Truck Electrical |
| 29/04/2021 | 546,932 kms | Sleeper Air R-17867 Service sleeper air Blow out air cleaner | Brisbane Workshop |
| 19/04/2021 | 530,034 kms | After Treatment R-18017 Air line from pump blocked See attached Inv 8921585 | Cummins south pacific |
| 06/04/2021 | 533,299 kms | Relay R-17591 Rewire relay & move away from water | Pro Truck Electrical |
| 06/04/2021 | 530,009 kms | Fuse R-17592 R&R fuse for interior light | Pro Truck Electrical |
| 26/03/2021 | 530,034 kms | Air Lines R-17580 Cleared blockage in air pump | Cummins south pacific |
| 09/03/2021 | 520,551 kms | B - 40,000 - 45,000 S-13324 B service completed Refer Invoice 8958061 attached | Cummins south pacific |
| 03/03/2021 | | Air Conditioner R-17204 Repaired A/C harness | Pro Truck Electrical |
| 24/02/2021 | 511,835 kms | PRESSURE CHECK T-10201 | Bridgestone |
| 24/02/2021 | 511,835 kms | Fit T-10201 2 X fit 295/80R22.5 152/148M BS R154 Pos 1, 2 8 X fit 11R22.5 146/143L BS M766 Pos 5, 6, 7, 8, 9, 10, 11, 12 | Bridgestone |
| 09/02/2021 | 502,786 kms | Sleeper Air, Vehicle Safety Check R-17593 Safety inspection Resecure stainless cover to sleeper air cover | Brisbane Workshop |
| 01/02/2021 | 496,769 kms | Wheel Alignment T-10056 | Fortuna Straightline Engineering |
| 29/01/2021 | 466,350 kms | Battery Box, Gear Stick, Hub Caps R-16786 Fitted chrome cap to RH steer hub Turned rubbers in battery box to close properly Added gear stick extension & lengthened air lines | Brisbane Workshop |
| 21/01/2021 | 488,808 kms | Midlife Service R-16955 Engine midlife service Replace turbo & all gaskets & studs Replace compressor & all O rings & gaskets Replace power steering pump gasket Replace water pump & all O rings Replace coolant X 55L Replace fan belt Replace A/C belt Replace all idler bearings & fan tensioner | Brisbane Workshop |
| 19/01/2021 | 488,808 kms | Jake Brake, Valves R-16753 Perform over head adjustment on all valves and jakes. | Brisbane Workshop |
| 19/01/2021 | 488,808 kms | Belts, Sleeper Air R-16956 Service bunk cooler Replace belts | Brisbane Workshop |
| 11/01/2021 | 485,703 kms | Wiper Blades R-16860 Replace wiper blades | Brisbane Workshop |
| 21/12/2020 | 480,066 kms | Shock Absorbers R-16788 R&R 4 X drive shocks | Brisbane Workshop |
| 13/11/2020 | 457,915 kms | Check Over R-16787 General check over | Brisbane Workshop |
| 11/11/2020 | 457,907 kms | B - 40,000 - 45,000 S-12845 B service completed (Refer attached invoice) | Cummins south pacific |
| 07/10/2020 | 438,002 kms | Lights R-16229 | Pro Truck Electrical |

| Date | Reading / Units | Type / Repairer Notes | Repairer |
|------------|-----------------|---|--------------------------|
| | | R&R new Narva beam headlight | |
| 24/09/2020 | 435,780 kms | Aerial R-16230 Replace RH phone aerial bracket | Brisbane Workshop |
| 01/09/2020 | 416,850 kms | Puncture T-9131 1 X puncture repair Pos12 | Bridgestone |
| 12/08/2020 | 409,169 kms | Control Panel, Hose R-15413 R&R faulty control panel Clutch hose #10 faulty, R&R | Pro Truck Electrical |
| 11/08/2020 | 338,223 kms | Lights, Turbo Timer R-15412 Reset turbo timer Adjusted headlights | Pro Truck Electrical |
| 11/08/2020 | | Sleeper Air R-15477 R&R sleeper air key pad panel & air diffuser vent | RTE |
| 11/08/2020 | | Sleeper Air R-15411 Serviced sleeper air Replaced sleeper air filter, fuel & oil | Brisbane Workshop |
| 07/08/2020 | 403,094 kms | B - 40,000 - 45,000 S-12374 B service completed | Cummins south pacific |
| 07/08/2020 | 403,094 kms | Turbo R-15245 Removed & adjusted turbo to 0.055", refitted turbo with new gaskets | |
| 10/07/2020 | | Air Conditioner R-15070 Unblock air conditioner drain | Brisbane Workshop |
| 30/06/2020 | 384,973 kms | C - 100,000 -150,000 S-12212 C service completed | Charlies Truck N Repairs |
| 12/06/2020 | 376,087 kms | Filters, Oil R-14937 Changed diff oils and diff filter. Changed gearbox oil and filter. | Brisbane Workshop |
| 05/05/2020 | 363,828 kms | B - 40,000 - 45,000 S-11990 B Service completed | Cummins south pacific |
| 04/05/2020 | 363,836 kms | Battery Box, Exhaust Stack, Insulators, Suzi Lines, Wiper Blades R-14390 Welded up crack in battery box cover. Replaced both suzi lines. Tightened both exhaust stack elbows. Replaced wiper blades. Replaced both top bonnet insulators. | Brisbane Workshop |
| 30/04/2020 | 363,820 kms | Fit T-8115 2 X fit 295/80R22.5 152/148M BS R156 Pos 1, 2 | Bridgestone |
| 30/04/2020 | 363,820 kms | PRESSURE CHECK T-8116 | Bridgestone |
| 29/04/2020 | 363,820 kms | Tune Up R-14324 Performed overhead adjustment on all vales & jakes. (Tune up.) | Crank IT Mechanical |
| 28/04/2020 | | Inverter R-14364 Removed evaporator ducting. Mount inverter box. Re-run inverter cable and attached to box. Wired in inverter. Ran cable above bunk for switch. Mounted switch. | Pro Truck Electrical |
| 22/04/2020 | 359,989 kms | Sleeper Air R-14311 Serviced cab sleeper motor. | Brisbane Workshop |
| 17/04/2020 | | Air Conditioner R-14410 Replaced switch and plug for A/C. | Pro Truck Electrical |
| 16/04/2020 | | Air Cleaner R-14078 | Charlies Truck N Repairs |

| Date | Reading / Units | Type / Repairer Notes | Repairer |
|------------|-----------------|---|--------------------------|
| | | Air cleaner brackets | |
| 30/03/2020 | | Indicators, Mirror R-14081 | Brisbane Workshop |
| | | Replace blown fuse for trailer indicators. Resecure Mirror back blanking plates. | |
| 06/03/2020 | | Horton Fan R-14628 | Pro Truck Electrical |
| | | TESTED SWITCH AND WIRE, ALL OK FOND FAULT TO BE IN ENGINE ECM ECM WILL NEED A FLASH CODE OR REPLACED UNDER CUMMINS WARRANTY | |
| 25/02/2020 | 327,148 kms | Clamp, Exhaust R-13726 | Brisbane Workshop |
| | | Removed leaking clamp. Fit new gasket and fit new clamp. | |
| 25/02/2020 | 314,867 kms | Clutch R-14173 | Penske |
| | | Inspected clutch components, bled slave cylinder to relieve air from system. Checked operation of clutch with engine running. Found spring and spacer missing / fallen out. Machined flywheel, fit new clutch kit. Adjusted clutch. Final drive repair. | |
| 17/02/2020 | 321,184 kms | Check Engine Light R-13595 | Brisbane Workshop |
| | | Found sensor faulty. Removed and replaced sensor. Cannot clear code with computer advised driver to monitor check engine light as should go out once ECM parameters for sensor have been met. | |
| 11/02/2020 | 317,867 kms | Lights R-14025 | Brisbane Workshop |
| | | FOUND BROKEN WIRE FOR FUSE HOLDER BEHIND L/H HEADLIGHTS. REPAIRED WIRE- NOW OKAY | |
| 04/02/2020 | 314,860 kms | Clutch R-14042 | Brisbane Workshop |
| | | REMOVE AND REPLACE CLUTCH SLAVE CYLINDER AND BLEED CLUTCH TRY AND ADJUST CLUTCH BUT WOULD NOT ADJUST. CHECKED CLUTCH OPERATION AND FOUND WITH CLUTCH PEDAL ALL THE WAY IN AND THE TRUCK IN GEAR IF REV ENGINE. TRUCK WOULD DRIVE- NEEDS NEW CLUTCH | |
| 03/02/2020 | | Clutch Adjustment R-13926 | Charlies Truck N Repairs |
| | | Checked clutch, top up fluid & bleed | |
| 17/01/2020 | 302,320 kms | Sun Visor R-13338 | Brisbane Workshop |
| | | Replaced missing sunvisor bolts | |
| 16/01/2020 | 302,312 kms | B - 40,000 - 45,000 S-11609 | Cummins south pacific |
| | | B service completed | |
| 10/12/2019 | 283,040 kms | Air Fittings, Lights, Weather Shields R-13000 | Brisbane Workshop |
| | | Remove & fit double sided tape to bottom of weather shields to stop rattling, refit weather shields Reseal top rotating light R&R air fittings on air suzie coils | |
| 26/11/2019 | 273,912 kms | Lights R-12938 | Pro Truck Electrical |
| | | Fit new loading lights on mirror | |
| 19/11/2019 | 268,601 kms | Fridge Mount R-12923 | Brisbane Workshop |
| | | R&R fridge mount | |
| 08/11/2019 | 265,186 kms | Balance, Fit T-6988 | Bridgestone |
| | | 2 X fit 295/80R22.5 152/148M BS R156 Pos 1, 2 | |
| 30/10/2019 | 260,499 kms | Fault Codes R-12585 | |
| | | No blockaged in hoses No blockages in pickup Replaced in tank filter & refit pickup No blockage in injector Removed exhaust pipe injector is fitted to,cut out damaged injector boss & weld new one in place and refit pipe Inlet fitting filter blocked, cleaned filter Replaced Adblue tank filler strainer Adblue pump air solenoid sticking, flushed air side of Adblue pump Tested-ok- cleared codes | |
| 18/10/2019 | 254,507 kms | Seat R-12480 | Brisbane Workshop |
| | | R&R passenger seat | |
| 11/10/2019 | 251,062 kms | Lights R-12417 | Pro Truck Electrical |
| | | R&R 4 x headlights with LED lights | |

| Date | Reading / Units | Type / Repairer Notes | Repairer |
|------------|-----------------|--|-----------------------|
| 27/09/2019 | 243,806 kms | Panhard Bar, Shock Absorbers R-12126 R&R cab shocks R&R cab panhard bar | Brisbane Workshop |
| 25/09/2019 | 242,386 kms | Retorque T-6717 4 X retorque Pos 5, 8, 9, 12 | Bridgestone |
| 23/09/2019 | 240,842 kms | Aerial R-12137 R&R UHF aerial mount bracket | Brisbane Workshop |
| 19/09/2019 | 230,000 kms | C - 100,000 -150,000 S-11034 C Service completed | Brisbane Workshop |
| 18/09/2019 | 239,406 kms | PRESSURE CHECK T-6682 | Bridgestone |
| 18/09/2019 | 239,406 kms | Fit T-6681 8 X fit 11R22.5 146/143L 16 BS M766 Pos 5, 6,7, 8, 9, 10, 11, 12 | Bridgestone |
| 18/09/2019 | 239,397 kms | B - 40,000 - 45,000 S-11123 B Service completed | Cummins south pacific |
| 18/09/2019 | 239,397 kms | Doser Filter R-12012 Troubleshoot fault code 3575 - Aftertreatment fault. Carried out doser pump solenoid test x 3 times - in spec Carried out airside flush x 2 times - pump operating within spec. Checked FC after test - code was inactive - cleared & reset. Changed water separator filter on chassis and checked micron rating. Changed doser pump air supply filter. | |
| 18/09/2019 | 239,406 kms | Beacon Light R-12032 1 X wire pulled out, refit wire, still inop Swapped wire to different connector & connect switch-now ok | Brisbane Workshop |
| 02/09/2019 | 229,968 kms | Weather Shields R-12059 R&R double sided tape & refitted weather shield | Brisbane Workshop |
| 26/08/2019 | | Windscreen R-11853 SUPPLY & FIT LH WINDSCREEN | Alpha Glass Aust P/L |
| 12/08/2019 | 215,918 kms | B - 40,000 - 45,000 S-11124 B Service completed | Cummins south pacific |
| 26/07/2019 | 206,134 kms | Lights R-11615 Both sides top spotlights inop. Checked and found no power to lights. Found relay for spotlights, fitted under a/c drain. Water from drain has caused corrosion in relay connector. Remove relay connector and clean and repair wiring connections. Remount relay connector away from a/c drain. Test lights and no ok. | Brisbane Workshop |
| 15/07/2019 | 198,637 kms | Diff R-11504 DRAINED & REPLACED DIFF OIL & FILTER | Brisbane Workshop |
| 09/07/2019 | | Windscreen R-11424 Supply and fit R/H windscreen | Alpha Glass Aust P/L |
| 09/07/2019 | 195,656 kms | Mudguards R-11429 Check RH cab mount and retighten. Tighten RH. Front drive mudguard bracket and fit nre deck plate bolts. | Brisbane Workshop |
| 01/07/2019 | 189,393 kms | Phone R-11391 Phone cradle loose- tighten now ok Phone not charging- now ok | Brisbane Workshop |
| 12/06/2019 | 178,293 kms | B - 60,000kms S-10714 B service completed. | Cummins south pacific |
| 20/05/2019 | 163,516 kms | Exhaust R-10983 REMOVE EXHAUST SHROUD TIGHTEN RHS EXHAUST STACK CLAMP & BRACKETS TIGHTEN BOTH LH & RH EXHAUST FLEX CLAMPS UNDER THE CAB | Brisbane Workshop |
| 20/05/2019 | 163,516 kms | Checker Plate R-10983 | Brisbane Workshop |

| Date | Reading / Units | Type / Repairer Notes | Repairer |
|------------|-----------------|---|----------------------|
| | | REPLACE DECKPLATE BOLT & CHASSIS CLAMP | |
| 18/05/2019 | | Fire Extinguisher R-11008 TEST & TAG-RHS-ABE-FES-1KG-PASS | Pengelly |
| 18/05/2019 | | Fire Extinguisher R-11008 TEST & TAG-RHS-ABE-FES-4.5KG-PASS | Pengelly |
| 15/05/2019 | | Fit T-5863 1 X SCRAP | Bridgestone |
| 15/05/2019 | | Torque T-5864 | Bridgestone |
| 01/05/2019 | 159,729 kms | Rotation T-5838 | Bridgestone |
| 01/05/2019 | 159,729 kms | PRESSURE CHECK T-5848 | Bridgestone |
| 29/04/2019 | 159,728 kms | Weather Shields R-10679 R&R LHS WEATHER SHIELD | Brisbane Workshop |
| 04/04/2019 | 150,605 kms | B - 60,000kms S-10365 B SERVICE COMPLETED | Brisbane Workshop |
| 04/04/2019 | 150,605 kms | Turntable R-10402 ADJUST T/TABLE | Brisbane Workshop |
| 29/03/2019 | | Lights R-10351 REPLACE INTERIOR LIGHT FUSE | Brisbane Workshop |
| 19/03/2019 | | Bracket R-10228 REPLACE 3 WALK PLATE HOLD DOWN BRACKETS | Brisbane Workshop |
| 19/03/2019 | | Windscreen R-10272 SUPPLY & FIT WINDSCREEN | Alpha Glass Aust P/L |
| 01/03/2019 | 131,751 kms | Adblue R-9992 Adblue light on. Checked fault codes and found code 3548 logged. Adblue pump loss of prime. Carried out checks as per Cummins Instie and was able to pump the prime and run. Cleared fault codes. | Brisbane Workshop |
| 26/02/2019 | | Torque T-5257 | Bridgestone |
| 25/02/2019 | 128,769 kms | Fit T-5226 1 X SCRAP | Bridgestone |
| 25/02/2019 | 128,769 kms | PRESSURE CHECK T-5236 | Bridgestone |
| 15/02/2019 | 122,690 kms | B - 60,000kms S-10140 B Service completed | Brisbane Workshop |
| 15/02/2019 | 122,690 kms | Wiper Blades R-9879 Replaced wiper blades | Brisbane Workshop |
| 04/02/2019 | 115,428 kms | Exhaust Flex R-9716 R&R EXHUAUST FLEX | Brisbane Workshop |
| 30/01/2019 | 111,761 kms | Microwave R-9688 REPAIR DAMAGED WIRING ON MICROWAVE & TEST-ALL OK | Brisbane Workshop |
| 04/01/2019 | 96,546 kms | Air Conditioner R-9356 R&R NO. 10 LOW SIDE HOSE & DRIER TESTED - OK | Pro Truck Electrical |
| 31/12/2018 | 94,004 kms | Lights R-9310 | Brisbane Workshop |

| Date | Reading / Units | Type / Repairer Notes | Repairer |
|------------|-----------------|--|---------------------|
| | | MAKE & REPAIR MARKER END PLATES FOR TAIL LIGHT BRACKET | |
| 22/11/2018 | 73,692 kms | Tune Up R-8881 | Crank IT Mechanical |
| | | PERFORM OVERHEAD ADJUSTMENT ON ALL VALVES & JAKES TUNE UP | |
| 21/11/2018 | 73,692 kms | Ice Pack R-8938 | Brisbane Workshop |
| | | SERVICED ICE PACK | |
| 21/11/2018 | 73,692 kms | Height Control Valve R-8938 | Brisbane Workshop |
| | | REPLACED BROKEN CAB HEIGHT CONTROL VALVE RUBBER | |
| 02/11/2018 | 60,665 kms | Brake Hose + Clamps R-8636 | Brisbane Workshop |
| | | Replaced LH steer axle brake hose. | |
| 02/11/2018 | 60,665 kms | Drain Shield R-8636 | Brisbane Workshop |
| | | Fit drain sheild to exhaust both sides. | |
| 02/11/2018 | 60,665 kms | B - 18-22km S-9687 | Brisbane Workshop |
| | | B Service completed | |
| 02/11/2018 | 60,665 kms | Height Control Valve R-8636 | Brisbane Workshop |
| | | Replaced rubber block on cab height control valve | |
| 02/11/2018 | 60,665 kms | Bolts R-8636 | Brisbane Workshop |
| | | Replaced missing bolts in battery cover | |
| 19/09/2018 | 33,700 kms | Lights R-8168 | Brisbane Workshop |
| | | Replaced missing LH beacon light cover and secured both beacon light covers with tape. | |
| 07/09/2018 | 25,967 kms | Mudguards R-7991 | Brisbane Workshop |
| | | REMOVED RH FRONT DRIVE GUARD DRILLED NEW HOLES & FITTED NEW MUD FLAP & ANTI SAIL BRACKET REFITTED GUARD | |
| 07/09/2018 | 25,967 kms | Lights R-7991 | Brisbane Workshop |
| | | DRILLED OUT & RERIVETED BOTH REAR SIDE CLEARANCE LIGHT ASSYS | |
| 25/08/2018 | | Lights R-7870 | Brisbane Workshop |
| | | BREAKDOWN AT DEPOT REPAIR HEAD LIGHTS DAMAGED ALL ADJUSTOR BOLTS & INSERT REPAIR WIRING TO LH HIGH BEAM | |
| 19/07/2018 | | I-1607 | Land Transport |
| 19/07/2018 | | C - Annual S-9200 | Land Transport |
| 29/06/2018 | 91,000 kms | Lights R-7220 | Brisbane Workshop |
| | | FIT LED SPOT LIGHTS TO BULLBAR X 2 | |
| 29/06/2018 | 91,000 kms | Fault Codes R-7220 | Brisbane Workshop |
| | | CHECKED FAULT CODES-ALL OK RESET ECM ENGINE BRAKE & CRUISE CONTROL INTERACTION MIN SET AT 1 MAX SET AT 2 RESET ECM CRUISE LOWER DROP/SET AT 2.0 | |

Signed: _____

Name: _____

Date: _____