

Finished Date/Tim Description

120k service - Aztech

- Replaced air filter.
- Replaced fuel filter.
- Replaced front and rear diff oil.
- Repacked front LH and front RH wheel bearings.

17/10/2023 - Replaced rear LH and rear RH wheel bearings.

Maintenance repairs - Aztech

- Replaced left hand hand brake shoes.
- Replaced rear brake pads.
- Adjusted parking brakes.
- Replaced front sway bar rubbers.
- Replaced pollen filter.
- Replaced rear uni. of front tail shaft.
- Replaced ear uni. of rear tail shaft.
- Replaced engine drive belt.
- Replaced drive belt idler pulley.
- Replaced drive belt tensioner pulley.
- Clean radiator and condenser.

28/09/2023 - Replaced front brake pads.

28/08/2023 Bradstreet Parts - Supply New Seat cover Set.

Aztech Gunnedah

110,000km Service

Replaced:

- Engine oil, oil filter
- Air, fuel, cabin filters

Replaced front and rear diff oil

Checked lights, suspension, steering, and wheel bearings

4/09/2023 Checked all fluids

Aztech Gunnedah

Repairs

Replaced:

- Rear brake pads
- 2x door seals
- 2x battery terminals
- Cabin filter door

4/09/2023 - Rear mud flaps & welded mud guard bracket mountings
TyrePower Gunnedah.

Toyo LT235/85R16 120P OPMT

New Tyre Fitting

New Tyre Balancing

25/08/2023 Disposal - 4WD Tyre

UF71 - Service

Carry out safety check

needs rear shackle bushes and mud guard re welded

Carry out service replaced engine oil oil filter fuel filter air filter

3/05/2023 cabin filter

UF71 - Repairs

Replaced all leaf spring bushes

Welded and repaired rear RH mud guard

3/05/2023

Replaced CV shafts

Rebuilt swivel hubs

Replaced L/H, tie rod end

Adjusted hand brake

19/04/2023 Check over completed

UF71 wheel Alignment

107,157km

- 18/04/2023 Tyrepower Gunnedah
Brake repairs - Aztech
Removed and re-fit front hub
Replaced front and rear brake pads as worn out
Removed and replaced front and rear rotor
- 21/03/2023 Weld LH/RH rear mud guard bracket
- 13/02/2023 Rego & CTP Renewal
Replace 4 tyres - Tyrepower
- 17/03/2023 Toyo 235/85R16 120P OPEN COUNTRY
Repairs - West End Panel Services
- 26/02/2023 L/H Upper door hinge, Lower door hinge, Front door cheke strap
Repairs required as part of 100000km service - Aztech
- Unblock washer jets.
 - Remove and replace rear brake pads
 - Remove and replace left hand front and rear mud guards and brackets.
 - Repair/weld left hand front and rear mud guard brackets x3.
 - Repair/weld right hand rear mud guard bracket/tray mount.
 - Diagnose and repair ABS light and traction control light on:
 - Scanned vehicle for fault codes (left hand rear wheel speed sensor open or short)
 - Test resistance of wheel speed sensor harness for continuity (broken wires found repaired and retest)
- 13/02/2023 - Fault codes cleared

100000km Service - Aztech

100,000km log book service:

- Engine oil and oil filter
- Front and rear wheel bearing grease

Additional service items:

- Air filter
- Cabin filter
- Fuel filter

13/02/2023 - Adjust handbrake

Repairs required as part of 95000km service - Aztech

Replaced air, fuel and cabin filter as U/S

Adjusted hand brake

Removed and replaced rear brake pads as worn out

Repaired RHR mud guard mount

Removed and replaced RH low/ high beam globe as inop.

18/10/2022 Unblocked washer jets

Replace 4 tyres & wheel alignment - Tyrepower

HANKOOK LT235/85R16 120Q Dynapro MT2

17/10/2022 Wheel Alignment - 4WD/ Light Truck

95000km service - Aztech

Fire Extinguisher: FE305

Tag - 10/22

Built - 02/22

18/10/2022 First Aid: FA159

Repairs required as part of 85000km service - Aztech

- Adjust hand brake
- Replaced sway bar "D" bushes
- Replaced sway bar link bushes
- Replaced radius rod bushes x6
- Replaced drive belt
- Replaced drive belt tensioner idler pulleys
- Replaced air filter
- Replaced cabin filter
- Replaced fuel filter
- Unblocked washer jets
- Repaired both front mud flaps
- Replaced RH rear mud flap
- Recover A/C gas
- Removed and re fit evaporator housing

19/08/2022 - Removed evaporator and clean
85000km service - Aztech

Carried out 90,000km service

Fire Extinguisher: FE05

Tag - 05/22

Built - 02/22

First Aid: FA019

Checked - 07/06/22

19/08/2022 Next check - 07/09/22

85000km service - Aztech

Carried out 85,000km service.

Fire Extinguisher: FE305

Exp 02/27

Tag 05/22

14/06/2022 First Aid Kit: FA019

Repairs - Aztech

- Replaced fuel filter as U/S
- Replaced air filter as U/S
- Replaced cabin filter as U/S
- Replaced wiper blades as U/S
- Weld RH rear mud guard bracket as cracked

14/06/2022 - Adjusted hand b rake

Repairs required re. 80000km service - Aztech

- Adjusted hand brake
- Replaced belt and pulleys
- Replaced rear LH wheel bearing as it was rusty

8/06/2022 -Replaced front and rear brake pads as they were worn out

7/06/2022 80000km Service

Replace, balance and fit 4 new tyres- Completed by Tyrepower INV113348

17/03/2022 MAXXIS LT235/85R16 MT772M Razr10PR 120/116Q Max

Clutch Issues - Completed by Aztech INV 52383

Cleaned mud build up around gearbox

- Replace clutch assembly as noisy & slipping
- Removed gearbox, tail shaft, muffler, DPF, wiring harness etc

- Remove clutch & flywheel

- Send fly to be machined

- Refit flywheel + new clutch

7/02/2022 - Reassemble + road test

15/11/2021

- Carried out inspection
- Found drag link bar was bent replaced drag link bar
- Drivers lower brake light not working removed light to check globe blown
- Checked wiring all good replaced globe
- Checked all brake pads all good

22/11/2021 - Adjusted hand brake

Carried out 70,000km service

- Fire Extinguisher serviced by Gunnedah Fire Protection

EXP: 06/21 06/26

TAG: 10/21

STICKER: FE246

3/11/2021 INV-19080

- Checked for cause of A/C inop and low air flow.
- Connect gauges and checked operation, Low in refrigerant.
- Suspect blocked evaporator is cause of low air flow.
- Carried out pressure test and replaced damaged O Ring.
- Removed evaporator for cleaning, Remove/Refit A/C pipes to TX valve, glove box, wiring, evaporator housing.
- Disassemble housing, Cleaned and inspected, Re assembled.
- Pressure cleaned condenser.
- Re charged A/C and checked operation.
- Re checked for leaks.
- Removed and re fit rear callipers and rotors as worn out
- Removed and replaced hand brake shoes
- Adjust hand brake
- Replaced rear brake pads
- Removed and re fit leaf springs
- Removed and replaced shackle bushings lh/rh
- Removed and re fit front tail shaft
- Replaced uni joint front side
- Removed and re fit front transfer housing
- Replaced rear diff oil seal and flange
- Removed and replaced radius arm lh/rh
- Replaced bushings
- Removed and replaced rh drag link
- Replaced engine belt and pulleys
- Replaced number plate light

3/11/2021 - Carried out road test

2/11/2021 2 x Tyres

Carried out road test and checked 4x4 operation. - Noticed noise from RHF and steering locking up intermittently. Disassembled swivel hubs and inspected, found RH cv shaft broken.
Carried out swivel hub rebuilt, replaced all gaskets, bearings, seals, grease, CV shafts, ect. Cleaned all surfaces, repaired damage to housing caused by failed CV joint. Drain and replaced front diff oil as contaminated with grease. Reassembled and torqued wheel nuts. Carried out road test.- ID stickers need replacing. Adjusted park brake, Remove/Refit rear wheels and torqued wheel nuts. Replaced broken wheel nut indicators. Replaced broken mudguard bracket RHR. (Ultrafleet supplied)

16/07/2021 carried out 60,000km service. Replaced air filter as U/S. Replaced pollen filter as U/S. Replaced fuel filter as U/S. Adjust hand brake. Replaced rear mud flaps as missing. Replaced front and rear brake pads. Test &

2/06/2021 replaced LH worklight as inop
4X Tyres replaced

30/03/2021 Maxxis 235/85/R16
50,000km service
Replace engine oil and filter. Replace air filter u/s. Check all levels. Replace wiper blades. Remove rear wheels and adjust handbrake. Road test.

14/01/2021
40,000km service
Carried out 40,000km service.
Replaced engine oil and filter.
Replaced front and rear wheel bearing grease and seals.
Replaced front and rear diff oils.

16/09/2020 Replaced brake fluid.
3x Tyres Replaced

15/09/2020 Maxxis 235/85/R16
Remove all mudguards and brackets from tray.
Fabricate and fit new brackets.
Straighten LH mud guards as bent.
Fit new RH mud guards as missing.(supplied)

29/07/2020 Fit new mud flaps and bolts as missing.