

| W/O No | Asset No | Asset Description                        | Description   | Job Type   | Finished Date/Time | Downtime | Repair Time | Component Code | Department   | Parent Asset     |
|--------|----------|--|---|------------|--------------------|----------|-------------|----------------|--------------|------------------|
| 11576  | MS4      | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Flat Tyre.<br>07.10.2023_MWR_WA - Pump up drive tyres on site. (SM)   | Repairs    | 7/10/2023          | 1.5      | 1.5         |                | GRV          | MSS Other Assets |
| 10848  | MS4      | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Cab Seals leaking, Dust in Cab.<br>29.08.2023_Sean noted, Close out, Dust levels were inspected by Wayne, cab seals are not going to fully seal cab. (SM)<br>17.06.2023_MWR_WA - Use smoke bomb to check cab sealing found very little points of smoke escape. Mainly around Window seal joints and some at door seal corners. Nil at cab floor or firewall/rear of cab or roof. Only small amounts of smoke escapes. (SM)  | Repairs    | 29/08/2023         | 0        | 1           |                | GRV          | MSS Other Assets |
| 11255  | MS4      | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Head Light shroud falling off RH side.<br>MRF7054_MS4_GRV_19.08.2023.<br>21.08.2023_MWR_ES - RE-ATTACHED WIRING FOR CLEARANCE LIGHT & RESCREWED COVER BACK ON. (SM)   | Repairs    | 21/08/2023         | 0.5      | 0.5         |                | GRV          | MSS Other Assets |
| 10849  | MS4      | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Air Con not working.<br>14.08.2023_MWR_WA - Vacuum and ragas A/C, 1.3kg 134A a/c gas installed. Wash and grease turn table (SM)<br>13.08.2023_MWR_WA - Measure and have made correct a/c hose. Fit hose and fitting to compressor/ evaporator. Vacuum system down for overnight leak test and recharge. (SM)<br>27.07.2023_Fittings ordered from NAPA (SM)<br>18.07.2023_MWR_WA - Assemble evaporator housing and reassemble dash. Flush condenser. (SM)<br>17.07.2023_MWR_WA - Fit new compressor/evaporator/tv valve/drier and associated parts. One of the hoses made by hoses 24 is incorrect. Seems the compressor has unusual porting sizes which is not standard fittings. I will do some research today see if I can get correct fitting or OEM hose. (SM)<br>06.07.2023_AC comp in stock (SM)<br>03.07.2023_Evaporator in stock (SM)<br>03.07.2023_Compressor ordered from NAPA & Evaporator ordered from RGM (SM)<br>03.07.2023_MWR_WA - Disconnect and remove evaporator. Remove compressor. Assess parts required for repair, (Need to replace evaporator and compressor. Fabricate 2x new hoses). Reassemble engine wiring and coolant reservoir. Reassemble dash. Set up truck ready to operate if needed. (SM)<br>02.07.2023_MWR_WA - Start to remove TX valve from A/C. (SM)<br>21.06.2023_Parts ordered from RGM (SM)<br>20.06.2023_MWR_ES - VACED AC SYSTEM DOWN, RECHARGED, LOW SIDE STARTED GOING INTO A VACUUM, TX VALVE FREEZING UP AT HOSE CONNECTOR. SUSPECT TX VALVE IS BLOCKED. WAYNE AGREED, TX VALVE TO BE REPLACED, EVAP TO BE REMOVED DURING, WASHED DOWN AND FLUSHED OUT CHECK FOR BLOCKAGE. WAYNE SAID TO GET A THERMOSTAT AS WELL. HE WAS WORRIED HE DAMAGED IT WHEN REMOVING IT TODAY AS THEY CAN BE FRAGILE. (SM)<br>20.06.2023_MWR_WA - Investigate gas leak. With dye/bubble spray and leak detector. Check system in the dark with UV light. No leak found. Dismantle dash assembly & inspect evaporator. Discharge system place into vacuum. Found system not holding vacuum. Charge system with nitrogen test for leaks with bubble spray 400psi. Still no leak found. Reassemble dash connect system to vacuum. ED will finish system recharge. Recovered gas 800gr (SM)<br>19.06.2023_MWR_WA - Set up truck in work shop and check for leaks. Could only find evidence of a small leak at compressor suction hose crimp with UV light. Would not indicate leak with suction leak detector or foam bubbles. (SM)<br>17.06.2023_MWR_WA - Check A/C found low on level basis. Cannot find point of leak. Top up a/c with extra due to hole | Repairs    | 14/08/2023         | 29       | 29          |                | GRV          | MSS Other Assets |
| 10506  | MS4      | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Tyre blew out.<br>26.04.2023_MWR_SC - Drive tyre blew out when bringing MS61 back to yard. R+R Drive tyre. (SM)   | Tyre/Track | 26/04/2023         | 0        | 1           |                | MNM          | MSS Other Assets |
| 10437  | MS4      | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Interior door latch broken.<br>16.04.2023_MWR_SP - Repaired interior door latch. (SM)   | Repairs    | 16/04/2023         | 0        | 1           |                | Workshop Mbh | MSS Other Assets |
| 10239  | MS4      | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Air Con not working.<br>MRF Request No 7383_MS4_GRV_02.03.2023.<br>25.03.2023_MWR_WA - Test ac found low gas no leak present, top up system 500gram 134a gas and test all good, test and replace headlight bulb, repair in cab cup holder mount. (SM)<br>19.03.2023_another MRF submitted for no AC, MRF Request No 2474_MS4_MNM_19.03.2023. (SM)<br>14.03.2023_MWR_SP - Ran aircon, couldn't get it to not work, will continue to monitor. (SM)  | Repairs    | 25/03/2023         | 3.5      | 3.5         |                | GRV          | MSS Other Assets |
| 10238  | MS4      | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Passenger Window not working.<br>MRF Request No 7383_MS4_GRV_02.03.2023,<br>25.03.2023_MWR_SP - Removed u/s door motor and replace with new supplied motor. (SM)<br>17.03.2023_Part ordered from Multispares (SM)<br>15.03.2023_emailled RGM & Multispares for parts quote (SM)<br>14.03.2023_MWR_SP - Removed door skin and window motor found motor is u/s put door back together. (SM)   | Repairs    | 25/03/2023         | 3.5      | 3.5         |                | GRV          | MSS Other Assets |
| 10240  | MS4      | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Grease & Check over.<br>14.03.2023_MWR_SP - Greased truck and inspected. (SM)   | Repairs    | 14/03/2023         | 1.5      | 1.5         |                | GRV          | MSS Other Assets |
| 9950   | MS4      | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Key snapped in Ignition.<br>29.01.2023_MWR_SC - Received call that key has been snapped in ignition barrel and truck cannot be started. Drove to site, disassembled ignition barrel, removed foreign key. Located proper key, reassembled ignition, test start, ok. Left site. Operator had inserted incorrect key (toolbox key) in ignition and attempted to start and snapped key. (SM)   | Repairs    | 29/01/2023         | 1.5      | 1.5         |                | GRV          | MSS Other Assets |
| 9867   | MS4      | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | COI Defect repairs, Adjust Brakes(3rd Axle imbalance) and the Front Spring Eye Bushes in the 2nd axle.<br>13.01.2023_MWR_SC - Disconnected from MS12, jacked up, removed bolts by OXY as were rusted in, removed bushes by OXY, drove to Xeed for new bolts. Cleaned up spring eyes, used porta-power to install new bushes, installed new bolts, test drove, ok. (SM)<br>11.01.2022_Parts in stock. (SM)<br>22.12.2022_Bushes ordered from RGM, to be shipped 3/01/2023 12:00 AM (SM)<br>21.12.2022_Applied for defect repair date extension. (SM)   | Repairs    | 13/01/2023         | 4.5      | 4.5         |                | Workshop Mbh | MSS Other Assets |

|      |     |  |   |          |            |      |      |  |  |              |                  |
|------|-----|--|---|----------|------------|------|------|--|--|--------------|------------------|
| 9835 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | COI due 21/12/22.<br>03.01.2023_COI Defect Cleared & COI attached. (SM)<br>21.12.2022_Applied for defect repair date extension. (SM)<br>21.12.2022_COI carried out and 2x self clearance defects to rectify. Brake adjustment & 2nd axle spring front eye bushes. (SM)<br>21.12.2022_MWR_SC - Degrease, clean all grease off turntable, wash truck, check over. Drive to Hornery's wait for COI, drive back to workshop and report COI findings. (SM)<br>21.10.2022_COI Booked at Hornery's for the 21/12 at 2:45PM (SM)  | QLD Tpt  | 3/01/2023  | 2.5  | 2.5  |  |  | Workshop Mbh | MSS Other Assets |
| 9837 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Hazard Light not turning off.<br>21.12.2022_MWR_SC - Test hazards, hazards cancel when indicators are used, not faulting, passed at COI. (SM)   | Repairs  | 21/12/2022 | 0.25 | 0.25 |  |  | MNM          | MSS Other Assets |
| 9836 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Two Way Radio channels not working.<br>21.12.2022_MWR_SC - Test UHF, could not fault, channel range from 1-40 all work. (SM)  | Repairs  | 21/12/2022 | 0    | 0    |  |  | MNM          | MSS Other Assets |
| 9664 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Low Engine Oil Pressure.<br>02.12.2022_MWR_RC - Remove sump pan clean and inspect replace gasket replace pan. Remove oil pickup tube inspect for cracking and change o-ring. Degrease and wash engine and hitch. Tested and achieved 25PSI at idle and 55PSI at WOT (SM)<br>01.12.2022_MWR_RC - Fault find low oil pressure removed oil filter housing, disassembled all shuttle valves inside it, clean all ports and lightly lashed oil pump bypass valve to remove scoring, reassembled all removed components and tested oil pressure. (SM)<br>30.11.2022_Gaskets ordered on HASTINGS ORD 5009371434. (SM)<br>29.11.2022_MWR_SC - Inspected engine for low oil pressure, installed pressure test port on side of block, (could only achieve 75deg for testing) 15 PSI at idle(10 PSI minimum recommended), at 1800 RPM could only achieve 35 PSI (40 PSI minimum recommended) Test drove with live gauge, both jake brake settings working. Drained and replaced engine oil, replaced filters, test again, same result. Parts required for further inspection.<br>Recommendations-<br>Inspect/clean oil bypass valves<br>Inspect oil pickup tube/gasket for cracks/wear<br>Inspect components beneath rocker covers eg jake heads for fatigued o-rings<br>Inspect lower engine components eg bearings/oil pump for wear/scouring.<br>28.11.2022_MWR_WA - Disconnect and set up in work shop. Investigate low oil pressure. (SM) | Repairs  | 2/12/2022  | 48   | 16.5 |  |  | Workshop Mbh | MSS Other Assets |
| 9439 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Doors hard to open.<br>02.12.2022_MWR_SC - Remove door skins, replace and adjust both door handles, refit door skins and secure broken panelling. (SM)<br>01.11.2022_L & R outer handles ordered from Multispares. (SM)<br>25.10.2022_MWR_SC - Drivers door would not open from outside, inspected, found external door handle components have worn heavily, had to modify the door handle to be able to be used, passenger door is also having dramas opening due to this issue. Could we please order RH + LH door handles. (SM)  | Repairs  | 2/12/2022  | 4    | 4    |  |  | Workshop Mbh | MSS Other Assets |
| 9693 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Service due at 530000km.<br>01.12.2022_MWR_RC - Complete service as per service sheets (SM)   | Service  | 1/12/2022  | 4.5  | 4.5  |  |  | Workshop Mbh | MSS Other Assets |
| 9690 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Low Crank Speed.<br>01.12.2022_MWR_SC - Have noticed lately that MS4 is hard to start, low crank speed if any. Load tested all batteries, very healthy, inspected terminals, found 2 that were not connected, cleaned up and refitted, inspected isolator wiring, bad earths and have been sparking on isolator terminals due to incorrect terminal/lug size.<br>Rewired main earths, replaced isolator, test, starts very well. (SM)   | Repairs  | 1/12/2022  | 3.5  | 3.5  |  |  | Workshop Mbh | MSS Other Assets |
| 9440 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Seat air not working.<br>30.11.2022_MWR_SC - Removed existing repair job. Drove to MHF, picked up components, fitted to seat base, test function, ok. (SM)<br>07.11.2022_Truck arrived in Toowoomba unannounced. Arrange Martyrs Mechanical to look at the Seat issue and repair as best as possible on short notice. (SM)<br>25.10.2022_MWR_SC - Reported that seat is not inflating, pulled apart seat frame, found seat air valve has broken fitting, requires replacement/new part, but seat is showing signs of age and could possibly do with replacement. (SM)   | Repairs  | 30/11/2022 | 2.5  | 2.5  |  |  | Foxleigh     | MSS Other Assets |
| 9377 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | GRV Brake Test due.<br>19.10.2022_MWR_SC - Perform brake test, complete, scan and submit paperwork. (SM)  | External | 19/10/2022 | 1    | 1    |  |  | GRV          | MSS Other Assets |
| 9361 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Repair bent sign.<br>11.10.2022_MWR_SC - Front oversize sign has been bent and torn off mount, straighten up sign, drill holes and remount. (SM)  | Repairs  | 11/10/2022 | 2    | 2    |  |  | Foxleigh     | MSS Other Assets |
| 9269 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Dash Panels loose.<br>01.10.2022_MWR_WA - Make and fit bracket to secure dash panel (SM)  | Repairs  | 1/10/2022  | 0    | 1.5  |  |  | GRV          | MSS Other Assets |
| 9261 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Dash Panels loose.<br>01.10.2022_MWR_WA - Make and fit bracket to secure dash panel (SM)  | Repairs  | 1/10/2022  | 1.5  | 1.5  |  |  | GRV          | MSS Other Assets |
| 9260 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Check over for Foxleigh Mobilisation.<br>01.10.2022_MWR_WA - Carry out inspection of truck. Check wheel bearings and brake adjustment. Steering and suspension. Grease truck. Replace battery isolator.<br>Repair front over size sign mounting. Make and fit bracket to secure dash panel (MRF 6891). Adjust R/H door latching rod & Tighten R/H door mirror (SM)  | Repairs  | 1/10/2022  | 3    | 3    |  |  | Foxleigh     | MSS Other Assets |

|      |     |  |  |          |            |     |     |  |              |                  |
|------|-----|--|--|----------|------------|-----|-----|--|--------------|------------------|
| 9054 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Relocate Truck/Dolly:<br>31.08.2022_MWR_WA - Truck was parked out front of yard. Disconnect and relocate dolly. Reconnect trailer and park up inside yard. (SM)  | General  | 31/08/2022 | 0   | 1.5 |  | GRV          | MSS Other Assets |
| 8885 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Switch panel in dash loose.<br>05.08.2022_MWR_WA - Dismantle dash assembly. Rectify instrument push pad mounting. Reassemble dash (SM)   | Repairs  | 5/08/2022  | 0   | 2   |  | GRV          | MSS Other Assets |
| 8764 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | GRV Brake Test:<br>15.07.2222_MWR_SCR_Perform GRV brake test, complete, scan and submit paperwork, hook back up to trailer. 0.5 Hrs  | External | 15/07/2022 | 1   | 1   |  | GRV          | MSS Other Assets |
| 8763 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | MNM Brake Test:<br>15.07.20222_MWR_SCR_Disconnect trailer, perform MNM brake test, complete, scan and submit paperwork. 1 Hr   | External | 15/07/2022 | 1.5 | 1.5 |  |              | MSS Other Assets |
| 8511 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | GRV Brake Test:<br>03.06.2022_MWR_SC - Perform brake test, complete, scan and submit paperwork (SM)  | External | 3/06/2022  | 0   | 1   |  | GRV          | MSS Other Assets |
| 8509 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Check Over & Air Leak;<br>02.06.2022_MWR_RC - Check over all fluids and and grease points, adjust brakes. Find air leak from behind dash panels, leak coming from air vent actuator only leaking when on face and feet, cab recirculation still works good on a/c. Not an urgent repair. (SM)  | Repairs  | 2/06/2022  | 0   | 2   |  | Workshop Mbh | MSS Other Assets |
| 8388 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Hook up Dolly;<br>04.05.2022_MWR_SC - Aaron Thompson rang and asked if dolly combination could be hooked up for transport of 4773 onsite. Split MS4-MS12, moved items in yard to hook up dolly, hooked up combination, test, ok. (SM)  | General  | 4/05/2022  | 0   | 0   |  | GRV          | MSS Other Assets |
| 8294 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | MNM Brake Test;<br>10.04.2022_MWR_SC - Perform MNM brake test, complete, scan and submit paperwork. (SM)   | External | 10/04/2022 | 0   | 1   |  | MNM          | MSS Other Assets |
| 8293 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | LH Side lights in/op;<br>09.04.2022_MWR_SC - Fault find power to lights for prime mover and trailer, found broken fuse for LH side lights. Repair wiring going from circuit breaker to Anderson plug for float battery. (SM)   | Repairs  | 9/04/2022  | 0   | 1.5 |  | Workshop Mbh | MSS Other Assets |
| 8155 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | GRV Brake test due,<br>13.03.2022_MWR_SC - Perform GRV brake test, scan and submit paperwork. (SM)   | External | 13/03/2022 | 0   | 1   |  | GRV          | MSS Other Assets |
| 8133 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Needs 2 new Air Bags needed:<br>13.03.2022_MWR_RC - Replace pos 4 air spring, test, completed (SM)<br>11.03.2022_MWR_RC - Fit pos 3 air bag - not yet complete needs pos 4 c/o also (SM)<br>10.03.2022 - Ordered from Truckline (SM)<br>09.03.2022_MWR_RC - Upon inspection found pos 3 airbag leaking due to wear and age, removed bag to locate p/n and cap off air lines not yet complete waiting parts. (SM)   | Repairs  | 12/03/2022 | 0   | 4   |  | Workshop Mbh | MSS Other Assets |
| 7977 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Replace Call Sign Stickers:<br>15.03.2022 - Sean advise the stickers have been fitted, close out (SM)<br>07.02.2022 - Wayne has collected, stickers in stock (SM)<br>02/02/2022 - Stickers ordered from Create a Sign (SM)   | Repairs  | 14/02/2022 | 0   | 0.1 |  | Workshop Mbh | MSS Other Assets |
| 7943 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Hi Vis Tape requires replacing:<br>30.01.2022_MWR_RC - Detach truck from float and change old deteriorated front and side high vis stickers for new ones. Completed (SM)   | Repairs  | 30/01/2022 | 0   | 4.5 |  | Workshop Mbh | MSS Other Assets |
| 7445 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | COI due 21/12/2021:<br>12.01.2022_MWR_SC - Split truck from trailer, drove to hornery's for COI. COI performed, only failure was split in sidewall of tyre. 1Hr R+R Tyre, Completed paperwork. 1 Hr (SM)<br>09.01.2022_MWR_WA - Adjust brakes. Replace headlight bulb. Wash under truck. MRF 5006 WA 1hr (SM)<br>07.01.2022_MWR_WA - Remove and replace pos 7 and 10 tyres with run outs from store. Internal plug repair run out tyres before fitting. (SM)<br>25/10/2021 - COI Booked for 12/01/2022 at 12:45pm (SM)<br>22.10.2021_MWR_SC - Began inspecting Truck, will need new torque rod bushes X 4, new rear chevrons X 2, new gear stick isolator. Will put list together when inspection complete. Repaired broken bumper bar mounts and front oversize sign mounting. (SM) | QLD Tpt  | 12/01/2022 | 0   | 7.5 |  | Workshop Mbh | MSS Other Assets |
| 7815 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Replace AC Fan Resistor:<br>09.01.2022_MWR_WA - Replace fan resister. (SM)<br>16.12.2021 - Wayne confirmed part received. (SM)<br>15.12.2021 - Shipping from Multispares today via ECM (SM)  | Service  | 9/01/2022  | 0   | 1   |  | Workshop Mbh | MSS Other Assets |
| 7783 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Overheating:<br>09.01.2022_MWR_WA - Replace Fan Belts & tensioner (SM)<br>16.12.2021 - Wayne confirmed part received. (SM)<br>15.12.2021 - Shipping from Multispares today via ECM (SM)<br>16.12.2021_MWR_WA - Check engine cooling system found needing to replace fan belts and tensioner. (SM)  | Repairs  | 9/01/2022  | 0   | 3   |  | Workshop Mbh | MSS Other Assets |
| 7814 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Replace Gear Stick Insulator:<br>08.01.2022_MWR_WA - Remove gear stick and replace insulator. Reassemble. (SM)<br>16.12.2021 - Wayne confirmed part received. (SM)<br>15.12.2021 - Shipping from Multispares today via ECM (SM)  | Service  | 8/01/2022  | 0   | 2.5 |  | Workshop Mbh | MSS Other Assets |
| 7812 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Replace 4x rear Track Rod Bushes:<br>08.01.2022_MWR_WA - Remove rear diff track rod. Found new bushes incorrect size for rod. NOTE this rod bushes are still in usable condition. MRF 5357 WA-1hr (SM)<br>07.01.2022_MWR_WA - Replace front track rod bushes (SM)<br>16.12.2021 - Wayne confirmed part received. (SM)<br>15.12.2021 - Shipping from Multispares today via ECM (SM)   | Service  | 8/01/2022  | 0   | 3   |  | Workshop Mbh | MSS Other Assets |

|      |     |  |  |            |            |   |     |  |              |                  |
|------|-----|--|--|------------|------------|---|-----|--|--------------|------------------|
| 7757 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | 500HR Service:<br>08.12.2021_MWR_SC/WA - Carry out 500hr service and fault checks/repairs. Repair R/H door not opening from inside. Check clean battery and isolator connections. Grease and adjust brakes. (SM)   | Service    | 8/12/2021  | 0 | 7   |  | Workshop Mbh | MSS Other Assets |
| 7701 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | GRV Site Intro by 01/12/2021:<br>02.12.2021_MWR_SC - Perform GRV annual inspection and paperwork. Scan and place in the GRV tray. 1.5 Hrs (SM)   | Compliance | 2/12/2021  | 0 | 0.5 |  | GRV          | MSS Other Assets |
| 7700 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | MNM Site Intro by 01/12/2021:<br>02.12.2021_MWR_SC - Perform MNM annual inspection and paperwork. Scan and place in the MNM tray. 1.5 Hrs (SM)   | Compliance | 2/12/2021  | 0 | 1.5 |  | MNM          | MSS Other Assets |
| 7541 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Replace Missing Wheel Nut Indicator:<br>04.11.2021_MWR_SC - Replaced 4 old and 1 missing wheel nut indicators. (SM)  | Corrective | 5/11/2021  | 0 | 0.5 |  | Workshop Mbh | MSS Other Assets |
| 7444 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Clutch:<br>22.10.2021_MWR_SC - Test drove, clutch is ok, needs slight adjustment, adjusted clutch. 1 Hr (SM)<br>18.10.2021 - Wayne thinks it's on its way out - will adjust with Sean and monitor. Will put in handover to Sean. (KD)  | Repairs    | 22/10/2021 | 0 | 1   |  |              | MSS Other Assets |
| 7334 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | GRV Brake Test Due 26/09:<br>02.10.2021_MWR_CD - Complete brake test for GRV, complete paperwork. (SM)   | External   | 2/10/2021  | 0 | 0.5 |  | GRV          | MSS Other Assets |
| 7333 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | (DONE) MNM Brake Test Due 26/09:<br>11.10.2021 - Share advise stickers received. (SM)<br>07.10.2021 - Nikki - MS4 Brake Test submitted 4/10/21 (SM)<br>02.10.2021_MWR_CD - Complete brake test for MNM, complete paperwork. (SM))  | External   | 2/10/2021  | 0 | 1   |  | MNM          | MSS Other Assets |
| 7229 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | LH Headlight not working:<br>09.09.2021_MWR_SC - Inspected headlights, both working, LH park light was actually out, repaired wiring to LH park light, test. Ok. (SM)<br>14.07.2021 - Sean - on list for this swing. (KD)  | Repairs    | 9/09/2021  | 0 | 1   |  | MNM          | MSS Other Assets |
| 7156 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | New Turn Signal Switch required:<br>27.08.2021_MWR_SC - Disassembled steering column, replaced indicator stalk, reassembled column, tested, ok. (SM)<br>20.08.2021 - WA confirmed part in stock. (SM)<br>18.08.2021 - Switch ordered from RGM, ex Mackay. (SM)<br>18.08.2021_MWR_WA - Inspected truck, found RH indicator not working correctly, disassembled, need to order new part, sent email request. 2Hrs (SM) | Repairs    | 27/08/2021 | 0 | 3   |  | Workshop Mbh | MSS Other Assets |
| 7157 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | LH Door won't open:<br>18.08.2021_MWR_SC - LH door would not open from the outside, disassembled, found broken material jamming up the opening mechanism. Removed material, lubed up latch, test, ok. 1.5Hrs (SM)  | Repairs    | 18/08/2021 | 0 | 1.5 |  | Workshop Mbh | MSS Other Assets |
| 6951 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | GRV Brake Test due 14/07:<br>10.07.2021_MWR_CD - Complete 3 monthly brake test for GRV. (SM)   | External   | 10/07/2021 | 0 | 0.5 |  | GRV          | MSS Other Assets |
| 6950 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | MNM Brake Test due 14/07:<br>10.07.2021_MWR_CD - Complete 3 monthly brake test for MNM. (SM)   | External   | 10/07/2021 | 0 | 1   |  | MNM          | MSS Other Assets |
| 6873 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Headlight issue:<br>22.06.2021_MWR_SC - Inspected MS4, LH headlights not operational, RH headlight has a hole from a rock in it. Diagnosed, found broken wire in loom for LHS, repaired wiring, test, ok. Replaced RHS with headlight that came out of MS45 from previous job. (SM)  | Repairs    | 22/06/2021 | 0 | 2.5 |  | Workshop Mbh | MSS Other Assets |
| 6717 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | (Done) Tyre Audit - complete an MWR with the the tyre size, quantities (steer/drive, specifying tyres fitted and any spares stored on the vehicle) and brand / model:<br>25.05.2021_MWR_SC - Tyre Audit. P1+P2- Aeolus ASL06 11R22.5. P3+P4 I+O- Treadline TL268D 11R22.5. P5+P6 O- Treadline TL268D 11R22.5. P5 I- Mirage MG638 11R22.5. P6 I- Aeolus ADC53 11R22.5. (SM)   | Tyre/Track | 25/05/2021 | 0 | 0.5 |  |              | MSS Other Assets |
| 6659 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Oversize Signs need fixing:<br>19.05.2021_MWR_ES - Removed old oversize signs, had issue getting quick release clips off, had to remove the side bumper to gain access to clip. cut of rusted clip, refitted bumper & fitted new signs. cleaned work area. (SM)<br>19.05.2021 - Sean - being fixed today. (KD)   | Repairs    | 19/05/2021 | 0 | 2   |  | MNM          | MSS Other Assets |
| 6641 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Passenger side inner door handle broken:<br>19.05.2021_MWR_ES - Started removing door trim. Fragile door, old plastic has a lots of cracks in it. Swapped out door handle & reinstalled. tested & adjusted. (SM)<br>15.05.2021 - WA confirmed part in stock. (SM)<br>09.05.2021 - Ordered Handle from RGM. (SM)  | Repairs    | 19/05/2021 | 0 | 3   |  | Workshop Mbh | MSS Other Assets |
| 6614 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Replace pos 6 Inner Tyre:<br>09.05.2021_MWR_ES - While loading float, ms4 pos 6 inner tyre was found flat. removed & installed a new tyre on the rim & reinstalled. (SM)   | Tyre/Track | 9/05/2021  | 0 | 1.5 |  | Workshop Mbh | MSS Other Assets |
| 6609 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | No cap on washer bottle.<br>08.05.2021_MWR_ES - Fit new seat covers. (MS)<br>06.05.2021 - Followed up on backorder, ETA 11/05. (SM)<br>21.04.2021 - Part ordered from RGM, ex Melbourne. (SM)  | Repairs    | 8/05/2021  | 0 | 0.5 |  | MNM          | MSS Other Assets |
| 6608 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Replace Seat cover:<br>08.05.2021_MWR_ES - Fit new seat covers. (MS)<br>06.05.2021 - Followed up on backorder, ETA 11/05. (SM)<br>21.04.2021 - Part ordered from RGM, ex Melbourne. (SM)   | Repairs    | 8/05/2021  | 0 | 1   |  | Workshop Mbh | MSS Other Assets |

|      |     |  |   |            |            |   |     |  |              |                  |
|------|-----|--|---|------------|------------|---|-----|--|--------------|------------------|
| 6566 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Steer Tyre on Driver side needs replacing, Chunks of rubber missing from middle of the tyre.<br>01.05.2021_MWR_CD - Remove 295 80r steer tyres, fit x2 new 11r22.5 steer tyres, torque wheel nuts to required 450FTLB. (SM)   | Tyre/Track | 1/05/2021  | 0 | 2   |  | MNM          | MSS Other Assets |
| 6497 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | MNM Brake Test.<br>20.04.2021_MWR_CD - Complete break test complete all paper. (SM)   | External   | 20/04/2021 | 0 | 1   |  | MNM          | MSS Other Assets |
| 6408 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Won't start.<br>13.04.2021_MWR_ES/SC - Replaced starter motor, had to perform rewiring as wiring was very average condition. Replaced starter isolator lockout. (SM)<br>12/04/2021 - Sean emailed "parts arrived" (SM)<br>12/04/2021 - Starter ordered from NAPA. (SM)<br>11/04.2021_MWR_SC - Truck would not start when loading float, found starter motor is unstable, got it running, and will diagnose when it comes back into yard. Truck came back from MNM, starter isolator was seized, replaced, still not starting, inspected starter motor, internal contacts are failing, requires assistance of hammer to start. New starter motor and Isolator bracket researched and requested by quote in NAPA. (SM)  | Repairs    | 14/04/2021 | 0 | 9   |  | Workshop Mbh | MSS Other Assets |
| 6463 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | 500HR Service.<br>13.04.2021_MWR_SC/ES - Performed 500HR (B) service as per service sheet, repaired airleaks & loose guard. (SM)  | PM         | 13/04/2021 | 0 | 6.5 |  | Workshop Mbh | MSS Other Assets |
| 6449 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Brake Test Sticker saying 3rd month.<br>12.04.2021 - Sean confirmed via email Sticker updated, no time (SM)   | Repairs    | 12/04/2021 | 0 | 0.1 |  | MNM          | MSS Other Assets |
| 6441 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Jump Start Receptacle Inspection by 23/04/2021.<br>10.04.2021_MWR_ES - Completed jump start inspect. found incorrectly wired. fixed wiring, found ando plug damaged replaced. (SM)  | Corrective | 10/04/2021 | 0 | 1   |  | MNM          | MSS Other Assets |
| 6340 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Repair Oversize Sign.<br>29.03.2021_MWR_ES - Repaired oversize signs, secured using rivets. (SM)  | Repairs    | 29/03/2021 | 0 | 0.5 |  | Workshop Mbh | MSS Other Assets |
| 6339 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | LH Headlight out.<br>29.03.2021_MWR_SC - Repaired plug on LH Headlight loom, re-secured headlight bucket. (SM)  | Repairs    | 29/03/2021 | 0 | 0.5 |  | MNM          | MSS Other Assets |
| 6265 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | During prestart, faults found with lights.<br>16.03.2021_MWR_ES - Replaced LH Headlight bulb, replaced RH headlight connector, test, ok. (SM)   | Repairs    | 16/03/2021 | 0 | 1   |  | Workshop Mbh | MSS Other Assets |
| 6117 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Remove Verizon Tracker.<br>27.02.2021_MWR_ES - Pull apart Dash & remove Tracker, reinstall dash (SM)  | Verizon    | 27/02/2021 | 0 | 1   |  |              | MSS Other Assets |
| 6290 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | GRV Site Intro.<br>17.02.2021_MWR_CD - Complete site intro for MNM and GRV (SM)   | Compliance | 17/02/2021 | 0 | 0.5 |  | GRV          | MSS Other Assets |
| 6289 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | MNM Site Intro.<br>17.02.2021_MWR_CD - Complete site intro for MNM and GRV (SM)   | Compliance | 17/02/2021 | 0 | 1   |  | MNM          | MSS Other Assets |
| 6063 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | GRV BRAKE TEST.<br>17.02.2021_MWR_CD - Complete 3monthly brake test for MNM and GRV complete all paperwork. (SM)  | External   | 17/02/2021 | 0 | 0.5 |  | GRV          | MSS Other Assets |
| 6062 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | MNM BRAKE TEST.<br>17.02.2021_MWR_CD - Complete 3monthly brake test for MNM and GRV complete all paperwork. (SM)  | External   | 17/02/2021 | 0 | 1   |  | MNM          | MSS Other Assets |
| 5954 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | QLD Transport Inspection - COI booked 3 February 2021 @8.15am - Due 11.12.2020.<br>09.02.2021 - Clay signed off on Defect notice, emailed to compliance division and requested COI be issued. COI attached. (KD)<br>04.02.2021_MWR_CD - Find that both aftermarket park light had been wired in incorrectly. Find correct harness, earth and power supply, splice into harness & test lights. Find that double ear clamp no RHS front booster service light leaking under pressure. Re crimp clamp and test for leaks. Grease turn table and jaws. (SM)<br>03.02.2021 - COI defect sign off attached (SM)<br>03.02.2021_MWR_CD - Take truck to Hornerys for annual COI, wait for COI to be completed and return to workshop (SM)<br>02.02.2021_MWR_SC - Completed inspection on truck. Replaced headlight bulb and clearance light bulb, secured headlight assembly. Found worn torque rod ends on rear diff, tie rod ends and kingpins have slight movement but should be passed, depending on inspector (SM)<br>01.02.2021_MWR_SC - Unhitched from trailer, washed truck. Inspected truck, adjusted brakes and greased, repaired reverse light circuit. Will continue inspection tomorrow, had to assist ED with other job. (SM)<br><br>27.01.2021 - asked Ed to give it a look over to see if we need any parts. Will block it out on Tuesday, emailed site to confirm. (KD)<br>26.01.2021 - Asked Clay to give it a look over this afternoon when it is back in the yard. (KD)<br>10.01.2021 - Phoned QLD transport, if inspection booked within 2 months of original expiry date and no payment details are required for registration, no need for EOT. (KD) | QLD Tpt    | 3/02/2021  | 0 | 9   |  | Workshop Mbh | MSS Other Assets |
| 5810 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | MNM Brake Test - due 21/12:<br>19.12.2020_MWR_SC - Perform GRV 3 Monthly brake test, complete and submit paperwork. 0.5 Hrs (SM)<br>04.12.2020 - Have workorder.<br>30.11.2020 - Nikki has requested W/O (SM)   | External   | 19/12/2020 | 0 | 0.5 |  | MNM          | MSS Other Assets |
| 5809 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | GRV Brake Test - due 21/12:<br>19.12.2020_MWR_SC - Perform GRV 3 Monthly brake test, complete and submit paperwork. 0.5 Hrs (SM)  | External   | 19/12/2020 | 0 | 0.5 |  | GRV          | MSS Other Assets |
| 5663 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | 125hr / 3 Month Service:<br>29.11.2020_MWR_CD - Grease truck and adjust brakes, general check over, @14014hrs/507458km, 2hrs. (SM)  | Service    | 29/11/2020 | 0 | 2   |  | Workshop Mbh | MSS Other Assets |

|      |     |  |   |            |            |   |     |  |              |                  |
|------|-----|--|---|------------|------------|---|-----|--|--------------|------------------|
| 5639 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Refit LH Headlight Cover:<br>23.11.2020_MWR_SC - Travelled to one end of site following the tracker which the truck ended up being at the oth end of site. Rescrewed on headlight cover as it fell off while on site. (SM)  | Repairs    | 23/11/2020 | 0 | 1   |  | MNM          | MSS Other Assets |
| 5597 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | RH side mirror loose<br>17.11.2020_MWR_CD - Tighten RHD mirror brackets 0.5hr (SM)  | Repairs    | 17/11/2020 | 0 | 0.5 |  | Workshop Mbh | MSS Other Assets |
| 5596 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Slow Leak from Position 6 Tyre<br>17.11.2020_MWR_CD - Remove pos 6 outer tyre and take to MDT for repair, pick up tyre and refit onto truck and tension to 450ftlbs 1.5hrs (SM)   | Tyre/Track | 17/11/2020 | 0 | 1.5 |  | Workshop Mbh | MSS Other Assets |
| 5507 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | 01.11.2020_MWR_CD - Complete machine check over and fluid level checks, top up washer bottle. grease machine and check brake adjustment.  | PM         | 2/11/2020  | 0 | 2   |  | Workshop Mbh | MSS Other Assets |
| 5297 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | GRV and MNM brake test due 30/09/2020:<br>21.09.2020_MWR_Perform brake test, complete and submit paperwork.<br>21.09.2020 - Sean advised he will get this done over the next couple of days (MW)<br>08.09.2020 - MNM work order now added to MEX and Nikki sent to Workshop (MW)<br>25.08.2020: Nikki advised: she will request the work order for this early next week so that we aren't requesting them to early (MW)   | External   | 21/09/2020 | 0 | 1   |  | Workshop Mbh | MSS Other Assets |
| 5153 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Fit reverse camera:<br>02.09.2020_MWR_Tidied up wiring and reinstalled dash pannels. tested all good.<br>01.09.2020_MWR_Started install of reverse cam & monitor, dash pannels & wiring tidy is needed to finish the job<br>27.08.2020 - Sean advised will probably do it this weekend (MW)<br>25.08.2020 - Sean confirmed part has arrived into the Workshop so this work can now be scheduled (MW)<br>20.08.2020 - PO sent to Truckline, parts should arrive into Mackay Monday 24/08 (MW)  | PM         | 2/09/2020  | 0 | 4   |  | Workshop Mbh | MSS Other Assets |
| 5123 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | RHS window won't go up:<br>01.09.2020_MWR_Installed new window switches, tested okay<br>16.08.2020_MWR_Replaced 175AH Anderson cable end (broken somehow). 0.5 Hr. Swapped power window switches, to enable window operation (see order note below) 0.5 Hr. Found electrical short in headlight wiring, repaired and cleaned connection. 0.5 Hr   | Repairs    | 1/09/2020  | 0 | 2   |  | GRV          | MSS Other Assets |
| 5124 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Loose battery terminal:<br>16.08.2020_MWR_Cleaned and tighten battery terminals. 0.5 Hr   | Repairs    | 16/08/2020 | 0 | 0.5 |  | GRV          | MSS Other Assets |
| 5057 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Secondary fan (Norton fan) not working and is overheating:<br>07.08.2020_MWR_undo radiator supports allowing radiator to move forward, undo fan and horton mounting bolts. remove fan hub. strip and and rebuild fan hub, bench test before fitting back to truck. refit to truck and refit all other components.<br>03.08.2020_MWR_Horten fan not engaging. removed fan to inspect, clutch is worn out and is slipping . needs to be rebuilt. reinstalled fan & covers   | Repairs    | 7/08/2020  | 0 | 6.5 |  | MNM          | MSS Other Assets |
| 5056 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Issue getting air up (in truck), gauges showed good and trailer had air but truck bags wouldn't inflate and had no air at splitter switch. A clunk was heard from direction of passengers footwell and air returned to normal (bags went up):<br>03.08.2020_MWR_Tested air system, no leaks, pressure built up as per normal. (operator issue)<br>30.07.2020 - Sean - Eddie can check while in yard, is in at the moment. (KD)  | Repairs    | 3/08/2020  | 0 | 0.5 |  | GRV          | MSS Other Assets |
| 5055 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Rear right drive tyres seem a bit doey, might pay to check pressures:<br>03.08.2020_MWR_adjusted tyre pressures to 90 PSI, no leaks detected<br>30.07.2020 - Sean - Eddie can check while in yard, is in at the moment. (KD)  | Tyre/Track | 3/08/2020  | 0 | 0.5 |  | GRV          | MSS Other Assets |
| 4910 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | GRV and MNM brake test due 02/07/2020:<br>03.07.2020_MWR_Complete brake test, scan and submit paperwork.<br>02.07.2020 - Sean advised: he will complete this week (MW)<br>29.06.2020 - Emailed work order to workshop for printing. (KD)<br>24.06.2020 - MNM work order added to MEX (MW)   | External   | 3/07/2020  | 0 | 1   |  | Workshop Mbh | MSS Other Assets |
| 4796 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Left front blinker lense broken:<br>26.06.2020_MWR_Replaced front bulbbar indicators with LED. Jump started the truck.<br>25.06.2020 - Added to Ed's schedule for the next few days. (KD)<br>24.06.2020 - Sean confirmed parts have now arrived so can schedule the work to be completed (MW)<br>24.06.2020 - order placed with NAPA and should be delivered to workshop today (MW)<br>22.06.2020 - Sean advised he will look at another option as manufacturer of truck and the part advised they do not make this anymore (MW)<br>19.06.2020 - Nathan at Truckline advised the supplier should come back to him before lunch time today (MW)<br>15.06.2020 - have sent Truckline and as the indicator supplied is for the side of the mudguard.. not the front bumperbar like we asked for (MW)<br>12.06.2020 - Sean advised parts have arrived into the Workshop (MW)<br>08.06.2020 - parts ordered with Truckline and should arrive into the Workshop Wednesday 10/06 (MW)<br>08.06.2020 - approved quote. (KD)<br>05.06.2020 - sent quote to Kate and Workshop for approval of part \$32.21 (MW)<br>04.06.2020 - requested quote from Truckline (MW)<br>06.03.2020 - emailed on yard list of jobs to do for Sean / ED. Asked Mel tp update re parts status. (KD)<br>27.05.2020 - Will be purchased first week in June. (KD)<br>21.05.2020 - Sean advised he will look at the parts we need to fix this on NAPA (MW).<br>20.05.2020 - Clay - needs attention, keeps getting ripped out. Clay advised this means will order new one (KD)<br>07.05.2020 - Emailed Sean and asked that he advise if needs to be fixed. | Damage     | 26/06/2020 | 0 | 1.5 |  | Workshop Mbh | MSS Other Assets |

|      |     |  |   |            |            |   |     |  |              |                  |
|------|-----|--|---|------------|------------|---|-----|--|--------------|------------------|
| 4758 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Truck and cab require detail/clean to look professional - Cab is absolutely disgusting and needs a clean:<br>06.06.2020_MWR_Full cab & truck wash. Full clean on inside of the cab & outside. including engine degrease   | Wash       | 6/06/2020  | 0 | 2   |  | Workshop Mbh | MSS Other Assets |
| 4757 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Worn drive belt & noisy pulleys; Coolant leak; Loose power steering cooler:<br>06.06.2020_MWR_Worn drive belt & noisy pulleys - Removed both belts & idler pulleys, picked up parts from Exceed. fitted new bearings & installed pulleys. Replaced drive belt & installed a/c belt & started engine to check fitment. Coolant leak. Plugged both heater core pipes from engine to cab, removed both pipes & capped heater core. Loose power steering cooler - Found while cleaning engine that power steering cooler was loose. Installed missing bolt & nut.   | Repairs    | 6/06/2020  | 0 | 5   |  | Workshop Mbh | MSS Other Assets |
| 4750 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | RHS door striker needs looking at:<br>05.06.2020_MWR_Adjusted door striker on RHS door. 0.5 Hrs Cleaned rubbish out of the cab. 0.5 Hrs   | Repairs    | 5/06/2020  | 0 | 1   |  | Workshop Mbh | MSS Other Assets |
| 4749 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Bolt missing on oil filler tube:<br>05.06.2020_MWR_Replaced bolt on oil filler tube.  | Repairs    | 5/06/2020  | 0 | 0.5 |  | Workshop Mbh | MSS Other Assets |
| 4748 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Engine has a coolant leak:<br>05.06.2020_MWR_Repaired coolant leak on engine  | Repairs    | 5/06/2020  | 0 | 1.5 |  | Workshop Mbh | MSS Other Assets |
| 4747 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | RHS Mudguard bracket has broken the mount:<br>05.06.2020_MWR_Repaired bumper bar bracket  | Repairs    | 5/06/2020  | 0 | 1.5 |  | Workshop Mbh | MSS Other Assets |
| 4746 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Loose side view mirror:<br>05.06.2020_MWR_Fabricated RHS Mirror bracket that had been broken<br>05.06.2020_2ND MRF received: RHS Mirror has been hit and broken the mount<br>06.03.2020_emailled on yard list of jobs to do for Sean / ED. (KD)   | Damage     | 5/06/2020  | 0 | 2   |  | MNM          | MSS Other Assets |
| 4745 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | POSS 5 inner tyre flat, off bead has been for quite some time:<br>05.06.2020_MWR_Upon using MS4 for the MS16 brake test, I noticed a number of faults, reported and began repairs. 1 Hr Removed and replaced POSS inner drive tyre with a run out tyre. 1.5 Hrs   | Tyre/Track | 5/06/2020  | 0 | 2.5 |  | Workshop Mbh | MSS Other Assets |
| 4696 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | GRV brake test due 15/5:<br>25.05.2020_MWR_Perform 3 Monthly brake test, scan and submit paperwork.   | External   | 25/05/2020 | 0 | 1.5 |  | Workshop Mbh | MSS Other Assets |
| 4654 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Battery issues - not starting:<br>20.05.2020_Clay said already load tested batteries on the same day he jumpstarted it, tested fine, can close out request. (KD)<br>15.05.2020_MWR_Locate machine on site, jump start truck. Will need to load test batteries when back at workshop<br>Advised gilly to complete MRF  | Repairs    | 15/05/2020 | 0 | 0.5 |  | MNM          | MSS Other Assets |
| 4552 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Flat battery - requires jump start: keys have been left in ignition and isolator not turned off:<br>25.04.2020_MWR_Keys have been left in ignition with isolator left on. Battery's are Dead flat. Jumpstarted truck off ute, ran for 0.5 Hrs, tested battery's, ok.  | Repairs    | 25/04/2020 | 0 | 0.5 |  | Workshop Mbh | MSS Other Assets |
| 4456 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Diff oils need to be done as this was not completed at the service:<br>06.04.2020_MWR_Disconnect truck from ms12, bring into workshop .5 Replace both differential oils .5 Hook back up to ms12 .5<br>01.04.2020 - parts ordered with Crokers Fuel will be delivered 02/04 by ECM (MW)<br>19.03.2020 - sent quote to Kate for approval of Caltex oil \$101.66 (MW)  | Repairs    | 6/04/2020  | 0 | 1.5 |  | Workshop Mbh | MSS Other Assets |
| 4266 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | QLD Transport inspection - 4 March 2020 8.45am: need to rectify the following items by the 20/03/2020 (COI attached)<br>- Brakes: excess brake imbalance on axle 3 - make operate equal and effective (DONE)<br>- Tow coupling: excess movement in the turntable saddle bushes (DONE)<br>- Lights/Electrical: park lights inoperative/ABS warning light displayed on the dash/right rear brake light inoperative (DONE)<br>- Suspension: excess side movement in the rear of the front spring shackles (DONE)<br>- Modifications: have turntable and ROPS fitment certified and a modification plate fitted (P2/H4) (DONE)<br>- Body: make left front door latch correctly (sticker loose) (DONE)<br>- Driveline: screw cap has come away on the tail shaft slip joint (DONE)<br>06.04.2020_MWR_Drive to Moranbah post office to pick up mod plates. Prep surface, mount mod plates to truck<br>06.04.2020_MWR_Remove both tail lights from rear bar .5 Drill and mount new combination lights to rear bar .5 Wire in both lights test ok 1.0<br>04.02.2020 - added to Clay's weekend schedule. (KD)<br>02.04.2020 - COI issued, attached.<br>01.04.2020_MWR_Fitted spring hanger spacers, test movement, ok. 2 Hrs Just waiting for tail lights to close out 1090.<br>02.04.2020 - part added to WO (MW) Sean signed defect notice, submitted to compliance Mackay. (KD)<br>01.04.2020 - parts ordered with NAPA Mackay: light (MW)<br>31.03.2020_MWR_Removed turntable, replaced turntable feet bushes. Install turntable, torque bolts.<br>27.03.2020_Mel arranged for ROPS Australia to complete works as per attached invoice<br>16.03.2020_MWR_Greased turntable and hooked up to MS12 for tomorrow's float move.<br>15.03.2020_MWR_Adjusted, tested and Greased brakes. 0.5 Hrs Inspected shackles, will need parts. 0.5 Hrs. Inspected turntable saddle bushes, will need parts, researched JOST parts. 1 Hr Removed auto on light system, as park lights could not be activated, now park lights can be activated, but there are no bulbs forward facing, will need to order parts. 3 Hrs As stated in previous MWR, turntable can be blue plated, but not ROPS without engineer cert. Driveline inspected - repaired cap. 1 Hr<br>14.03.2020_MWR_Inspected tail lights, lights worn / damaged inside, will need to replace units.<br>13.03.2020_MWR_Inspected for mod plate, discussed with modification plate provider, P2 (turntable is doable)<br>13.03.2020_MWR_Will need a certificate of the manufacture and installation from the ROPS engineer (ROPS Australia might be a | Inspect    | 6/04/2020  | 0 | 20  |  | Workshop Mbh | MSS Other Assets |
| 4427 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | MNM site introduction:<br>02.02.2020_MWR_Perform MNM intro for MSS, complete brake test, paperwork and submit.  | Site Comp  | 2/04/2020  | 0 | 3   |  | Workshop Mbh | MSS Other Assets |

|      |     |  |  |            |            |   |      |  |              |                  |
|------|-----|--|--|------------|------------|---|------|--|--------------|------------------|
| 4394 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Constant air leak from rear ABS Service relay valve:<br>01.04.2020_MWR_Removed abs valve and worn / old hosing, went to MHF to replace air hoses. Fitted new valve and hoses, test, ok   | Repairs    | 1/04/2020  | 0 | 5    |  | Workshop Mbh | MSS Other Assets |
| 4340 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Wiper blades need changing:<br>16.03.2020_MWR_Replaced wiper blades. 0.5 Hrs   | Repairs    | 16/03/2020 | 0 | 0.5  |  | Workshop Mbh | MSS Other Assets |
| 4339 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Repair the light circuit:<br>16.03.2020_MWR_Picked up parts from Repco store 1 Hr. Fitted forward facing park lights. Rewired light system, test, ok. 3 Hrs  | Repairs    | 16/03/2020 | 0 | 4    |  | Workshop Mbh | MSS Other Assets |
| 4332 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | 500,000KM service due:<br>15.03.2020_MWR_Completed service apart from diff oils.<br>14.03.2020_MWR_Changed oils and filters, adjusted brakes and clutch  | Service    | 15/03/2020 | 0 | 5    |  | Workshop Mbh | MSS Other Assets |
| 4286 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Passenger door lock has failed:<br>13.03.2020_MWR_Install door striker, (had to remove panelling to fish nut out) adjust door latching<br>09.03.2020 - emailed Brett and Blake to find out movements of truck so we can schedule in. Emailed Sean to get estimate of repair time - 1hr, added to work order. (KD)<br>09.03.2020 - Sean emailed requesting that a new door striker. (KD)  | Repairs    | 13/03/2020 | 0 | 1    |  | Workshop Mbh | MSS Other Assets |
| 4252 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Door striker bolt passenger side door:<br>02.03.2020 - emailed Clay to ask if we need to replace the passenger side striker bolt cause he used it to repair the drivers side door. (KD). Clay responded it is AOK<br>28.02.2020_MWR_Find that drivers door wont open from the inside, Remove door card, repair damaged internal door lever mount bracket, Swap door striker bolt with left hand side Test ok. Refit drivers side door card   | Repairs    | 2/03/2020  | 0 | 3.5  |  | Workshop Mbh | MSS Other Assets |
| 4212 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | RHS wind deflector damage (photo's attached):<br>02.03.2020_Refit cabin wind defector<br>20.02.2020_MWR_Removed side wind deflector, flattened out, will need more work, but truck is ok without deflector.  | Damage     | 2/03/2020  | 0 | 1.5  |  | Workshop Mbh | MSS Other Assets |
| 4204 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | No triangles:<br>20.02.2020_Sean found a set of triangles in the workshop and put them in the truck. Can close off as no action required.  | Corrective | 20/02/2020 | 0 | 0    |  | Workshop Mbh | MSS Other Assets |
| 4090 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | GRV compliance inspection:<br>20.02.2020_MWR_Performed brake test and completed compliance inspection photos and paperwork. Supplied and fitted wheel chocks, mounting brackets and wheel nut indicators<br>30.01.2020_MWR_Began compliance inspection, had to fabricate brackets for battery security. Will require when chocks and wheel nut indicators for compliance. Brake test and paperwork will be performed once these items have been fitted.  | Corrective | 20/02/2020 | 0 | 5    |  | Workshop Mbh | MSS Other Assets |
| 4089 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Hose became disconnected and wrapped around tail shaft:<br>30.01.2020_MWR_Rewired parts of ECM wiring loom, ABS wiring loom, E-Stop wiring, and trailer plug wiring. Fabricated mounts for hose tails, mounted Pogo stick. Tested for security, good. Completed nylon brake hose repair. Job Complete. 8 Hours<br>29.01.2020_MWR_Drove to MS4 on highway, continued repairs so that tow truck is not required, organised operator to move to workshop. 4 Hrs Purchased additional items for repairs from MHF and Exceed. 1.5 Hrs Continued repairs in workshop, larger job that anticipated as changes to system to ensure that this will not happen again.<br>28.01.2020_MWR_Received call from Scott Dugan that vehicle is blocking traffic. Attend breakdown, organised traffic control rather than onlookers. found airlines and electrics completely U/S due to entanglement around taillift. Had to remove all boosters from drive axles to push truck off road using an LV. Vehicle in safe location to work on, went to MHF for air line repair parts. | Damage     | 30/01/2020 | 0 | 22.5 |  | Workshop Mbh | MSS Other Assets |
| 4023 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Engine oil needs topping up<br>07.01.2020 - 2nd MRF received: engine took 2 litres of oil:<br>14.01.2020_MWR_Low oil, Topped up oil.   | PM         | 14/01/2020 | 0 | 0.5  |  | GRV          | MSS Other Assets |
| 4011 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Tachometer stuck at 2000rpm:<br>14.01.2020_MWR_Tacho not working, disassembled dash, found plug unplugged, plugged in, tested, working fine. Most likely came loose from rough roads.<br>12.01.2020 - Sean - hard to work on it at the moment cause it's in and out of the yard. Emailed Blake to ask when we can have it. It will be available from Thursday until the following Tuesday 21.01. (KD)<br>07.01.2020 - 2nd MRF received: tacho still U/S  | Repairs    | 14/01/2020 | 0 | 1    |  | GRV          | MSS Other Assets |
| 4021 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Plug for trailer lights broke:<br>13.01.2020_MWR_Plug is broken from lead hyperextending during a turn. Remove and replace plug. Test.   | Damage     | 13/01/2020 | 0 | 0.5  |  | MNM          | MSS Other Assets |
| 3822 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Oversize sign on front requires refitting with bolts, screws coming out:<br>17.11.2019_MWR_Remounted oversize sign on front bar, using screws and rivets. Completed  | Repairs    | 17/11/2019 | 0 | 1    |  | Workshop Mbh | MSS Other Assets |
| 3821 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Chip in windscreen:<br>17.11.2019_MWR_Windscreen chips are not affecting vision. Completed.  | Repairs    | 17/11/2019 | 0 | 0    |  | Workshop Mbh | MSS Other Assets |
| 3820 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Fit spotlights or lightbar:<br>17.11.2019_MWR_Fabricated bracket for lightbar mounting, fitted lightbar, modified supplied wiring loom. Test, ok. Replaced beacon lights on roof. Completed  | Repairs    | 17/11/2019 | 0 | 0    |  | Workshop Mbh | MSS Other Assets |
| 3806 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Remove aluminium box and fit something smaller properly - currently held with ratchet straps (NOT REQUIRED, JUST SHORT Distance truck:<br>17.11.2019_MWR_toolbox has already been removed, placed jack and bars in space in cab. Completed.<br>30.10.2019 - Sean - put jack under passenger seat. No need to replace it because a lot of rubbish in there and can fit stuff on trailer. To replace it would have to fabricate. (KD)  | Repairs    | 17/11/2019 | 0 | 0    |  | Workshop Mbh | MSS Other Assets |

|      |     |  |   |            |            |   |     |  |              |                  |
|------|-----|--|---|------------|------------|---|-----|--|--------------|------------------|
| 3819 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | 490,000KM service due:<br>16.11.2019_MWR_Performed service on truck, grease changed eng oil and filters, Inspected, truck in good condition. Washed adjusted and degreased turn table. Replaced fuel hoses on return lines. MHF CQ8296 Replaced Park light bulb.  | Service    | 16/11/2019 | 0 | 5   |  | Workshop Mbh | MSS Other Assets |
| 3739 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Shutting down issue:<br>31.10.2019_MWR_drive to carborough downs site, find electrical fault causing truck to randomly shut down, Repair fault. Return to workshop  | Repairs    | 31/10/2019 | 0 | 2   |  | Carborough   | MSS Other Assets |
| 3591 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | No number plate light working and fit new batteries:<br>11.10.2019_MWR_remove walk plate and batter box cover, remove batteries, organise with Mel for replacement batteries. Pick up 2 n70 batteries from Moranbah discount tyres, order other 2, pick up ordered batteries, fit all batteries and refit walk plate<br>10.10.2019_MWR_repair wiring for number plate light, finish making bracket for fire extinguisher mount, mount extinguisher to rops frame. Chase wiring short causing fuse for L/H head lights to blow, repair wiring issue test 24.09.2019 - Sean - Need time to get it done. Schedule for 1 hour. (KD) | Repairs    | 11/10/2019 | 0 | 9   |  | Workshop Mbh | MSS Other Assets |
| 3594 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | No fire extinguisher:<br>07.10.2019_MWR_fabricate fire extinguisher mount for rear of cab, charge batteries<br>24.09.2019 - Sean - has bracket and just need time to fit it. 1 hour.<br>19.09.2019 - fire extinguisher now in stock if needed (MW)<br>14.08.2019 - Clay - should have a 9kg, not sure where it is - sent email to GRV supervisor to check.  | Site Comp  | 7/10/2019  | 0 | 2   |  | Workshop Mbh | MSS Other Assets |
| 3593 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | No First aid kit:<br>24.09.2019 - Sean added FA41 and SB32.   | Site Comp  | 24/09/2019 | 0 | 0   |  |              | MSS Other Assets |
| 3504 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | 23.08.2019_MWR_do up list of work to pass site inspection, secure left hand head light surround P/S headlight surround loose  | Repairs    | 23/08/2019 | 0 | 1   |  | GRV          | MSS Other Assets |
| 3499 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | 20.08.2019_MWR_find rubbed wire behind R/H high beam causing constant blown fuses, repair wire<br>Wiring issue  | Repairs    | 20/08/2019 | 0 | 2   |  | Workshop Mbh | MSS Other Assets |
| 3472 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Roof flashing light out on RHS:<br>10.08.2019_MWR_Replaced RH Beacon and rewired- not a matching set, looks flyblown. Have requested 2 new ones to replace. Replaced Anderson Plug. Temporarily secured LH Headlamp surround, has been hit by something. Requested new part. Inspected numberplate light - U/S, requested new light. Tightened up D/S Mudguard.   | Site Comp  | 10/08/2019 | 0 | 3.5 |  |              | MSS Other Assets |
| 3456 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | 02.08.2019_MWR_TPSC_TPSC_Cleaned turntable, greased, adjusted and Hooked up to MS12;Legs on trailer have possibly been dragged/damaged on last use.   | PM         | 2/08/2019  | 0 | 1   |  | Workshop Mbh | MSS Other Assets |
| 3401 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | 13.07.2019_MWR_went to move vehicle, could not start, found loose fitting on isolator causing it to burn out. R + R isolator, jump start truck, test charge - OK<br>Truck won't start   | Repairs    | 13/07/2019 | 0 | 1   |  | Workshop Mbh | MSS Other Assets |
| 3143 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | 15.04.2019_Adam says checked 2 way when at MNM and couldn't fault it. Have only received one MRF and it was from Ben and he has been submitting a lot of MRFs. Will wait to see if other operators have issues.<br>06.04.2019_MRF_OPBH_2 way faulty - no range, distortion in sounds when transmitting.   | Corrective | 15/04/2019 | 0 | 0   |  | MNM          | MSS Other Assets |
| 3131 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | 30.03.2019_MWR_TPSC_250hr Service   | Service    | 30/03/2019 | 0 | 0   |  | Workshop Mbh | MSS Other Assets |
| 3077 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Replace Drivers Seatbelt as per Defect Notice.  | Repairs    | 19/03/2019 | 0 | 0   |  | Workshop Mbh | MSS Other Assets |
| 3028 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | NO MWR<br>30.01.2019_Inspect and repair vehicle for COI (Certificate of inspection - Qld Transport - 06 Feb 2019); Replace broken grease nipples, Grease truck, wash and degrease truck, repair lighting, indicator wiring, fabricate brackets for bumper and mudguard.   | Unknown    | 12/02/2019 | 0 | 0   |  | Workshop Mbh | MSS Other Assets |
| 2990 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | 01.12.2018_500hr service_wrap hot wrap around exhaust, try to stop heat around driver's side floor, adjust brakes, full grease; check all lights ; clean inside and out.  | Service    | 1/12/2018  | 0 | 0   |  | Workshop Mbh | MSS Other Assets |
| 2994 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | 25.10.2018_MWR_Broken mudguard bolt holding bracket on - unhook trailer, remove broken bolt fit new bolt, adjust guard with airbag ride height; grease drive line; general check over underneath; give truck a wash, hook back up to float.   | Repairs    | 25/10/2018 | 0 | 3   |  | Workshop Mbh | MSS Other Assets |
| 2992 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | 20.10.2018_MWR_Grease and checkover_Full checkover; top up fluids, Grease; adjust brakes  | PM         | 20/10/2018 | 0 | 2   |  | Workshop Mbh | MSS Other Assets |
| 2756 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | 12.07.2018_MWR_Partial Service_Carried out 20,000km ('B' Service) (only oil filters changed, not fuel and air filters) Full checkover and Grease  | Service    | 2/08/2018  | 0 | 0   |  |              | MSS Other Assets |
| 2650 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | 11.07.2018_MRF_Install Pogo stick. Repair Cracked Toolbox. Replace Flashing lights. Inspect for oil usage. Service as required.<br>(this work order duplicated to reflect partial service - WO2756) Carried out 20,000km ('B' Service) Full checkover and Grease and oil filters only changed   | Repairs    | 24/07/2018 | 0 | 0   |  |              | MSS Other Assets |
| 2839 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Installed Pogo Stick<br>Removed valve covers, Set valve cleanances & Jake brake cleanaces<br>Re-Fit all components.   | PM         | 24/07/2018 | 0 | 0   |  |              | MSS Other Assets |
| 2314 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | 14.03.18 - Glen attended Toowoomba workshop and fixed fault   |            | 14/03/2018 | 0 | 0   |  |              | MSS Other Assets |
| 2292 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Downs onsite Hydraulics - replaced fuel line on engine  |            | 20/02/2018 | 0 | 0   |  | Workshop Mbh | MSS Other Assets |
| 2991 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | 14.02.2018_Service 250 hr_drain and replace oil, oil filters and fuel filters (other work recorded in seperate Work order)  | Service    | 15/02/2018 | 0 | 0   |  | Workshop Mbh | MSS Other Assets |

|      |     |  |   |            |            |   |      |            |              |  |                  |
|------|-----|--|---|------------|------------|---|------|------------|--------------|--|------------------|
| 2220 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | AH:02.02.18 Changed Gear Box Oil; Full checkover and Grease; replaced from shocks; checked coolant leak - requires coolant rail to be resealed (CM note on MWR that parts are in stock)<br>14/2/2018_MWR_Found seized turbo, replaced turbo, feed and drain tubes and all necessary gaskets, O'rings; replaced section of exhaust flex and replaced both mufflers; resealed water rail and thermostat. Replaced engine oil filters, oil filters and fuel filters. | PM         | 15/02/2018 | 0 | 0    |            |              |  | MSS Other Assets |
| 2758 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | 14.02.2018 - ADS undertook partial service (No MWR record, Fuel filter invoice attached)  |            | 14/02/2018 | 0 | 0    |            | Workshop Mbh |  | MSS Other Assets |
| 2265 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | SC: 12.01.2018 removed each steer tyre from truck in turn. Removed rubber off rim and replaced with new Bridgestone R150 295/80R 22.5 tyres and then refitted. Nuts to be checked after 50 kms  |            | 23/01/2018 | 0 | 0    |            | Workshop Mbh |  | MSS Other Assets |
| 2223 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | CM 07.12.2017: Replace Gearbox Sender Plug; Fit 4 new Tyres; Grease Drive Line  | Unknown    | 8/12/2017  | 0 | 0    |            | Workshop Mbh |  | MSS Other Assets |
| 2235 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | 5.12.17: TA: Moved Turntable back as too far forward. Remove turntable and marked out holes to move table back. Sliced holes and placed table into position and placed bolts and tightened.   | Repairs    | 5/12/2017  | 0 | 3.5  |            | Workshop Mbh |  | MSS Other Assets |
| 2232 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | 02.12.17: CM fitted toolbox to truck (invoice attached)   |            | 2/12/2017  | 0 | 0    |            | Workshop Mbh |  | MSS Other Assets |
| 2205 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | TA 17.11.17: replaced Sump gasket on engine: parts from Hastings Deering.   |            | 17/11/2017 | 0 | 0    |            | Workshop Mbh |  | MSS Other Assets |
| 2204 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | 14.11.17: CM; Service - 1000 hours<br>Replaced Engine/oil filters; replace coolant and filter; 2 x water hoses replaced; transmission oil and filter; air cleaner inner and outer.  | Service    | 14/11/2017 | 0 | 0    |            | Workshop Mbh |  | MSS Other Assets |
| 2236 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | TA:09.11.17: Greased underneath front suspension, brake adjusters and cam line. Checked for Coolant leak  | Repairs    | 9/11/2017  | 0 | 1    |            | Workshop Mbh |  | MSS Other Assets |
| 2202 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | CM:06.11.17 REPLACE TURNTABLE AND PLATE WITH NEW ONE - says multispares part used but can't find the invoice  | Repairs    | 7/11/2017  | 0 | 0    |            |              |  | MSS Other Assets |
| 2203 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | CM: 06.11.17: Fixed Broken headlight shroud; blown RHS low MWR says spares ordered from Ashdown Ingram  | Repairs    | 6/11/2017  | 0 | 0.1  |            |              |  | MSS Other Assets |
| 2122 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Due for 250 hour service  |            | 7/07/2017  | 0 | 0    |            | Workshop Mbh |  | MSS Other Assets |
| 2128 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | SUBM Reports 23.06.2017: 11 wheel nut indicators missing off truck  | Unknown    | 26/06/2017 | 0 | 0    |            | Workshop Mbh |  | MSS Other Assets |
| 2101 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | 24.06.2017_JC_Repair R/H/F spot light<br>Adjusting turntable jaws. Didn't take up to much. Looking at rebuilding  |            | 25/06/2017 | 0 | 0    |            | Workshop Mbh |  | MSS Other Assets |
| 2044 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | 04.05.2017-08.05.2017_JC_Remove busted fire extinguisher mount plate. Remount new 9kg (E56) Extinguisher to side of chassis.<br>08.05.2017_JC_Re-adjust ride height on truck  |            | 25/06/2017 | 0 | 0    |            | Workshop Mbh |  | MSS Other Assets |
| 2072 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | 26.05.2017_JC_Strip out light assembly and repair earth.<br>Repair mirror movement. Adjust arm out further so mirror can swing<br>Replace blown fuses for BMA 2way  |            | 25/06/2017 | 0 | 0    | Electrical | Workshop Mbh |  | MSS Other Assets |
| 2050 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | 12.05.2017-13.05.2017_JC_Find leak at pump and repair<br>Replace broken lights<br>Fit BMA radio to truck<br>Repair broken wire above tyres for clearance lights on trailer/ float<br>Replaced both mudflaps on rear of truck  | Repairs    | 25/06/2017 | 0 | 0    | Body       | Workshop Mbh |  | MSS Other Assets |
| 2120 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Reported by SUPH: Investigate water leak on water jacket of head  | Unknown    | 24/06/2017 | 0 | 0    | Motor      | Workshop Mbh |  | MSS Other Assets |
| 2111 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | SUPH Reports 24.06.2017: Drivers door seal not sealing properly   | Unknown    | 24/06/2017 | 0 | 0    |            | Workshop Mbh |  | MSS Other Assets |
| 1961 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | 13.04.2017_JC_Repair broken mudguard<br>16.04.2017_JC_Finish mounting mudguard, lights and mudflap<br>16.04.2017_JC_Fit bracket on rear lights  | Repairs    | 16/04/2017 | 0 | 0    | Tyres      | Workshop Mbh |  | MSS Other Assets |
| 1735 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | 20.01.2017_JC_Start fitting parts ordered (dash control). Repair revolving lights. Replace all air tank straps. Service engine and filters. Change diff filters, gearbox, filter and air dryer filter. Fit new cab filter and change air con and alternator belts   |            | 15/04/2017 | 0 | 12.5 | Motor      |              |  | MSS Other Assets |
| 1968 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | Operator reports: Trailer plugs not working with trailer  | Repairs    | 3/04/2017  | 0 | 0    | Electrical | Workshop Mbh |  | MSS Other Assets |
| 1875 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | 16.02.2017_JC_Bring truck to yard and work on cab revolving lights. Needs new lights. Repair R/H revolving light and remove broken L/H light. Take magnetic base strobe light from my toolbox and adapt it to rear of float   | Repairs    | 16/02/2017 | 0 | 5.5  | Electrical | Workshop Mbh |  | MSS Other Assets |
| 1727 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | 09.01.2017_JC_Put yellow stripes on cab and bonnet. Get some parts from old green Mack (e'stops, isolators) and fit to truck. Fit jump start plug. Order filters for service. Check truck over, check all oils, grease and adjust brakes  | Corrective | 10/01/2017 | 0 | 0    |            | Workshop Mbh |  | MSS Other Assets |
| 1707 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T | 06.01.2017_JC_Find leaking hose on L/H/R brake booster on truck. Go to wreck truck to find hose to fit. Assemble hose and test  | Repairs    | 6/01/2017  | 0 | 0    | Hose       | Workshop Mbh |  | MSS Other Assets |
| 3592 | MS4 | MS4 - FREIGHTLINER FLX CENTURY CLASS S/T |   | Damage     |            | 0 | 0    |            | Workshop Mbh |  | MSS Other Assets |