

SHOPNAME	UNIT#	REPCCLASS	MAKE	MODEL	YEAR	UNITTYPE	LICENSE	ODOMETER	COMPLETED	COMMENTS	TYPE	DESCRIPTION
Brisbane Workshop	124	R&M	WSTST	4800	2005	PM	976SQY	307894	05/07/2021 05:26:00 AM	CARRIED OUT SERVICE 1 AS PER SCHEDULE.	Labor	PM Level 1, PM, PERFORMED
Brisbane Workshop	124	R&M	WSTST	4800	2005	PM	976SQY	307894	05/07/2021 05:26:00 AM	CARRIED OUT SERVICE 1 AS PER SCHEDULE.	Services	ENVIRO LEVY
Brisbane Workshop	124	R&M	WSTST	4800	2005	PM	976SQY	307894	05/07/2021 05:26:00 AM	REMOVED & ORDERED LIGHTS ON REAR OF CAB. SECURED WIRES.	Labor	Lighting System
Brisbane Workshop	124	R&M	WSTST	4800	2005	PM	976SQY	1	07/07/2021 08:04:00 AM	REMOVED A/C BELT FOUND 3 BROKEN BOLTS ON A/C COMPRESSION / ALTERNATOR BRACKET REMOVED ALTERNATOR AND DISCONNECTED BATTERIES REMOVED BRACKET AND BROKEN BELTS FOUND 3 BELTS AROUND WORKSHOP FITTED SPACER ON BRACKET BECAUSE STILL LOOSE AFTER TIGHTENED BELTS TIGHTENED ALL BRACKET BELTS AND ALTERNATOR REPLACED A/C BELT AND UNCONNECTED BATTERIES MEANWHILE WORK ON BRACKET FOUND AFTERMOTOR WIRING (POSITIVE AND NEGITIVE ) ALMOST RUBBING THROUGH EACH OTHER	Labor	Air Conditioning, Heating & Ventilating System
Brisbane Workshop	124	R&M	WSTST	4800	2005	PM	976SQY	1	07/07/2021 08:04:00 AM	REMOVED A/C BELT FOUND 3 BROKEN BOLTS ON A/C COMPRESSION / ALTERNATOR BRACKET REMOVED ALTERNATOR AND DISCONNECTED BATTERIES REMOVED BRACKET AND BROKEN BELTS FOUND 3 BELTS AROUND WORKSHOP FITTED SPACER ON BRACKET BECAUSE STILL LOOSE AFTER TIGHTENED BELTS TIGHTENED ALL BRACKET BELTS AND ALTERNATOR REPLACED A/C BELT AND UNCONNECTED BATTERIES MEANWHILE WORK ON BRACKET FOUND AFTERMOTOR WIRING (POSITIVE AND NEGITIVE ) ALMOST RUBBING THROUGH EACH OTHER	Part	Belt
Brisbane Workshop	124	R&M	WSTST	4800	2005	PM	976SQY	308910	12/07/2021 07:19:00 AM	REMOVED BRACKET MOUNTING - FITTED NEW	Labor	Cab
Brisbane Workshop	124	R&M	WSTST	4800	2005	PM	976SQY	1	19/07/2021 01:12:00 PM	REPLACED AXLE GASKET ON DR L/H	Labor	Wheels, Rims, Hubs & Bearings
Brisbane Workshop	124	R&M	WSTST	4800	2005	PM	976SQY	1	19/07/2021 01:12:00 PM	REPLACED AXLE GASKET ON DR L/H	Labor	Wheels, Rims, Hubs & Bearings
Brisbane Workshop	124	R&M	WSTST	4800	2005	PM	976SQY	1	19/07/2021 01:12:00 PM	REPLACED AXLE GASKET ON DR L/H	Services	1 X 330.311 - AXLE GASKET
Brisbane Workshop	124	R&M	WSTST	4800	2005	PM	976SQY	313829	17/08/2021 04:41:00 PM	CHECKED AS REQ'D FOUND W/PUMP PULLEY WORN GROOVES TOWARDS OUTSIDE +PUSHING A/C BELT OFF REMOVED PULLY FROM PARTS ENGINE BLOCK CLEANED +INSPECTED - BETTER RIDGE LINES REMOVED PULLY FROM 124 + FITTED BETTER PULLEY RPL FAN BELT STARTED + CHECKED ALIGNMENT OKAY	Labor	Cooling System

Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	313829	17/08/2021 04:41:00 PM	CHECKED AS REQ'D FOUND W/PUMP PULLEY WORN GROOVES TOWARDS OUTSIDE +PUSHING A/C BELT OFF REMOVED PULLY FROM PARTS ENGINE BLOCK CLEANED +INSPECTED - BETTER RIDGE LINES REMOVED PULLY FROM 124 + FITTED BETTER PULLEY RPL FAN BELT STARTED + CHECKED ALIGNMENT OKAY	Services	1 X 8PK1445 - AC BELT
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	313829	17/08/2021 04:41:00 PM	CHECKED AS REQ'D FOUND W/PUMP PULLEY WORN GROOVES TOWARDS OUTSIDE +PUSHING A/C BELT OFF REMOVED PULLY FROM PARTS ENGINE BLOCK CLEANED +INSPECTED - BETTER RIDGE LINES REMOVED PULLY FROM 124 + FITTED BETTER PULLEY RPL FAN BELT STARTED + CHECKED ALIGNMENT OKAY	Services	1 X 23523377 - W/PUMP PULLEY FMT STOCK
Brisbane Workshop	124	BREAKDOWN	WSTST 4800	2005 PM	976SQY	314256	19/08/2021 10:35:00 AM	RODE TO BREAKDOWN B/RIDGE REPALCED DAMAGED SUZI LEADS REPLACED FITTINGS TESTED OKAY DROVE BACK TO DEPOT	Labor	Electrical Accessories
Brisbane Workshop	124	BREAKDOWN	WSTST 4800	2005 PM	976SQY	314256	19/08/2021 10:35:00 AM	RODE TO BREAKDOWN B/RIDGE REPALCED DAMAGED SUZI LEADS REPLACED FITTINGS TESTED OKAY DROVE BACK TO DEPOT	Services	1 X CD93-23 - FEMALE FITTING
Brisbane Workshop	124	BREAKDOWN	WSTST 4800	2005 PM	976SQY	314256	19/08/2021 10:35:00 AM	RODE TO BREAKDOWN B/RIDGE REPALCED DAMAGED SUZI LEADS REPLACED FITTINGS TESTED OKAY DROVE BACK TO DEPOT	Services	1 X CD93-87 - MALE FITTING
Brisbane Workshop	124	BREAKDOWN	WSTST 4800	2005 PM	976SQY	314256	19/08/2021 10:35:00 AM	RODE TO BREAKDOWN B/RIDGE REPALCED DAMAGED SUZI LEADS REPLACED FITTINGS TESTED OKAY DROVE BACK TO DEPOT	Services	1 X 100-50B - SUZI LIGHT LEAD
Brisbane Workshop	124	BREAKDOWN	WSTST 4800	2005 PM	976SQY	314256	19/08/2021 10:35:00 AM	RODE TO BREAKDOWN B/RIDGE REPALCED DAMAGED SUZI LEADS REPLACED FITTINGS TESTED OKAY DROVE BACK TO DEPOT	Services	1 X 200-203 - RED/BLUE SUZIS
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	317248	06/09/2021 11:00:00 AM	CARRIED OUT PM 3 AS PER SCHEDULE	Labor	PM Level 3, PM, PERFORMED
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	317248	06/09/2021 11:00:00 AM	CARRIED OUT PM 3 AS PER SCHEDULE	Labor	PM Level 3, PM, PERFORMED
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	317248	06/09/2021 11:00:00 AM	CARRIED OUT PM 3 AS PER SCHEDULE	Labor	PM Level 3, PM, PERFORMED
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	317248	06/09/2021 11:00:00 AM	CARRIED OUT PM 3 AS PER SCHEDULE	Part	Oil - Engine
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	317248	06/09/2021 11:00:00 AM	CARRIED OUT PM 3 AS PER SCHEDULE	Part	VALVOLINE COOLANT
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	317248	06/09/2021 11:00:00 AM	CARRIED OUT PM 3 AS PER SCHEDULE	Services	ENVIRO LEVY
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	317248	06/09/2021 11:00:00 AM	CARRIED OUT PM 3 AS PER SCHEDULE	Services	1 x X903239 FILTER KIT - DETROIT SERIES 60 NON EGR
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	317248	06/09/2021 11:00:00 AM	CARRIED OUT PM 3 AS PER SCHEDULE	Services	1 x P550637 LUBE FILTER CARTRIDGE
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	317248	06/09/2021 11:00:00 AM	CARRIED OUT PM 3 AS PER SCHEDULE	Services	1 X FUEL FILTER

Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	317248	06/09/2021 11:00:00 AM	CARRIED OUT PM 3 AS PER SCHEDULE	Services	1 X AIRDRYER FILTER
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	317248	06/09/2021 11:00:00 AM	06/09/21 FR33500 - HEADER TANK CRACKED - THERMOSTAT LEAKING - RADIATOR MOUNT U/S - RADIATOR LEAKING AT BOTTOM DIAGNOSIS REMOVED HEADER TANK - REPAIRED REFITTED AND REPLACED TANK CAP REMOVED PLATE @ LOWER RADIATOR MACHINE FLAT MADE GASKET AND REFITTED WITH NEW BOLTS REMOVED FITTINGS FROM REAR OF WATER PUMP REPLACED REDUCER FITTING INSTAL TAP AS REQ'D REMOVED AIR INTAKE ETC REMOVED THERMOSTAT HOUSING REPLACED COOLANT HOSES AS REQD FILLED COOLING SYSTEM PRESSURE TESTED AND CHECKED FOR LEAKS ALL OKAY	Labor	Fault Reports
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	317248	06/09/2021 11:00:00 AM	06/09/21 FR33500 - HEADER TANK CRACKED - THERMOSTAT LEAKING - RADIATOR MOUNT U/S - RADIATOR LEAKING AT BOTTOM DIAGNOSIS REMOVED HEADER TANK - REPAIRED REFITTED AND REPLACED TANK CAP REMOVED PLATE @ LOWER RADIATOR MACHINE FLAT MADE GASKET AND REFITTED WITH NEW BOLTS REMOVED FITTINGS FROM REAR OF WATER PUMP REPLACED REDUCER FITTING INSTAL TAP AS REQ'D REMOVED AIR INTAKE ETC REMOVED THERMOSTAT HOUSING REPLACED COOLANT HOSES AS REQD FILLED COOLING SYSTEM PRESSURE TESTED AND CHECKED FOR LEAKS ALL OKAY	Labor	Fault Reports
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	317248	06/09/2021 11:00:00 AM	REPLACED GEARBOX OIL.	Labor	Gearbox Oil Replace, PM, PERFORMED
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	317248	06/09/2021 11:00:00 AM	REPLACED GEARBOX OIL.	Labor	Gearbox Oil Replace, PM, PERFORMED
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	317248	06/09/2021 11:00:00 AM	REPLACED GEARBOX OIL.	Labor	Gearbox Oil Replace, PM, PERFORMED
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	317248	06/09/2021 11:00:00 AM	REPLACED GEARBOX OIL.	Part	Oil - Manual Transmission
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	317248	06/09/2021 11:00:00 AM	REPLACED GEARBOX OIL.	Part	1 - 25mm SILICONE COOLANT HOSE
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	317248	06/09/2021 11:00:00 AM	REPLACED GEARBOX OIL.	Part	SILICONE COOLANT HOSE 38MM (1-1/2)
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	317248	06/09/2021 11:00:00 AM	REPLACED GEARBOX OIL.	Services	RADIATOR CAP
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	317248	06/09/2021 11:00:00 AM	REPLACED GEARBOX OIL.	Services	19MM HJOSE
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	317248	06/09/2021 11:00:00 AM	REPLACED DIFF OILS.	Labor	Diff Oil Replace, PM, PERFORMED
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	317248	06/09/2021 11:00:00 AM	REPLACED DIFF OILS.	Labor	Diff Oil Replace, PM, PERFORMED

Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	317248	06/09/2021 11:00:00 AM	REPLACED DIFF OILS.	Labor	Diff Oil Replace, PM, PERFORMED
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	317248	06/09/2021 11:00:00 AM	REPLACED DIFF OILS.	Part	Oil - Multi-Purpose, Transmission & Rear Axle
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	317248	06/09/2021 11:00:00 AM	TOPPED UP FRONT HUB OIL	Labor	Wheels, Rims, Hubs & Bearings
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	317248	06/09/2021 11:00:00 AM	TOPPED UP FRONT HUB OIL	Labor	Wheels, Rims, Hubs & Bearings
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	317248	06/09/2021 11:00:00 AM	TOPPED UP FRONT HUB OIL	Labor	Wheels, Rims, Hubs & Bearings
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	317248	06/09/2021 11:00:00 AM	ROTATED ALL DRIVE TYRES	Labor	Tires, Tubes, Liners & Valves
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	317248	06/09/2021 11:00:00 AM	ROTATED ALL DRIVE TYRES	Labor	Tires, Tubes, Liners & Valves
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	317248	06/09/2021 11:00:00 AM	ROTATED ALL DRIVE TYRES	Labor	Tires, Tubes, Liners & Valves
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	317248	06/09/2021 11:00:00 AM	CHECKED FOR AIR LEAKS CANT FIND THEM	Labor	Suspension
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	317248	06/09/2021 11:00:00 AM	CHECKED FOR AIR LEAKS CANT FIND THEM	Labor	Suspension
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	317248	06/09/2021 11:00:00 AM	CHECKED FOR AIR LEAKS CANT FIND THEM	Labor	Suspension
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	317248	06/09/2021 11:00:00 AM	CHECKED FOR AIR LEAKS CANT FIND THEM	Services	1 X REDUCIONG BUSH
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	317248	06/09/2021 11:00:00 AM	ADJUSTED CLUTCH PRESSURE PLATE	Labor	Clutch System
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	317248	06/09/2021 11:00:00 AM	ADJUSTED CLUTCH PRESSURE PLATE	Labor	Clutch System
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	317248	06/09/2021 11:00:00 AM	ADJUSTED CLUTCH PRESSURE PLATE	Labor	Clutch System
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	318380	09/09/2021 11:54:00 AM	REPLACED ENGINE BELTS	Labor	Power Plant
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	318964	13/09/2021 01:35:00 PM	RE-CHECKED AND TIGHTENED ALL HOSE CLAMPS REPOSITION AIR INTAKE PIPING REPOSITION EXPAMNSION TANK REPLACED COOLNT LEVEL SENSOR INSULATED A/C HOSE FROM BONNET PRESSURE TESTED ALL OKAY	Labor	Cooling System
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	318964	13/09/2021 01:35:00 PM	RE-CHECKED AND TIGHTENED ALL HOSE CLAMPS REPOSITION AIR INTAKE PIPING REPOSITION EXPAMNSION TANK REPLACED COOLNT LEVEL SENSOR INSULATED A/C HOSE FROM BONNET PRESSURE TESTED ALL OKAY	Part	VALVOLINE COOLANT
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	318964	13/09/2021 01:35:00 PM	RE-CHECKED AND TIGHTENED ALL HOSE CLAMPS REPOSITION AIR INTAKE PIPING REPOSITION EXPAMNSION TANK REPLACED COOLNT LEVEL SENSOR INSULATED A/C HOSE FROM BONNET PRESSURE TESTED ALL OKAY	Services	1 X COOLANT LEVEL SENSOR
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	319836	15/09/2021 03:11:00 PM	CHANGED GEAR BOX FILTER	Labor	Transmission - Main, Manual
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	319836	15/09/2021 03:11:00 PM	CHANGED GEAR BOX FILTER	Services	1 X GEAR BOX FILTER

Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	319836	15/09/2021 03:11:00 PM	CHANGED AIR FILTER	Labor	Air Intake System
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	319836	15/09/2021 03:11:00 PM	CHANGED AIR FILTER	Services	2 X AIR FILTER
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	319836	15/09/2021 03:11:00 PM	CHANGED AIR FILTER	Services	LUBE FILTER X AIR PRIMARY
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	1	21/09/2021 10:21:00 AM	fitted york compressor clutch as reqd replaced clutch pulley and coil all okay	Services	SUBTOTAL
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	1	27/09/2021 10:30:00 AM	FITTED 2ND HAND SWITCH NO IGN KEY TO TEST	Labor	Ignition System
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	1	27/09/2021 10:30:00 AM	FITTED 2ND HAND SWITCH NO IGN KEY TO TEST	Services	1 X WINDOW SWITCH
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	322656	01/10/2021 09:53:00 AM	REMOVED FUSE COVER + FIDDED WITH WIRING + RELAY FAN STAR WORKING NO FAULT DETECTED MARK TO ADVISE STILL FAULTY	Labor	Air Conditioning, Heating & Ventilating System
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	325647	15/10/2021 05:00:00 PM	LOOSEN INTAKE PIPE AND MOVED BACK AN INCH AND TIGHTENED	Labor	Air Intake System
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	325647	15/10/2021 05:00:00 PM	ADJUSTED CLUTCH TO A POINT IT HAD ITS FINAL ADJUSTMENT PLEASE	Labor	Clutch System
Brisbane Workshop	124	FAULT	WSTST 4800	2005 PM	976SQY	326334	20/10/2021 01:15:00 PM	19/10/21 FR84851 - LIGHT ON SIDE FLASHING & GOING OUT DIAGNOSIS CHECKED FUSES AND RELAYS TRACED BREAK IN WIRING @ JUNCTION ( TPLUG / SIDE MARKERS )	Labor	Fault Reports
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	326365	20/10/2021 11:11:00 AM	ATTNEDED BRAKE DOWN AT ACACIA RIDGE FOUND BROKEN / SPLIT COOLANT HOSE AT REAR OF WATER PUMP TO FILTER HOUSING REMOVED HOSE CLAMP REMOVED HOSE FITTED NEW HOSE TO PIPE AND TIGHTENED CLAMPS REFILLED COOLANT	Labor	Cooling System
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	326365	20/10/2021 11:11:00 AM	ATTNEDED BRAKE DOWN AT ACACIA RIDGE FOUND BROKEN / SPLIT COOLANT HOSE AT REAR OF WATER PUMP TO FILTER HOUSING REMOVED HOSE CLAMP REMOVED HOSE FITTED NEW HOSE TO PIPE AND TIGHTENED CLAMPS REFILLED COOLANT	Labor	Cooling System
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	326365	20/10/2021 11:11:00 AM	ATTNEDED BRAKE DOWN AT ACACIA RIDGE FOUND BROKEN / SPLIT COOLANT HOSE AT REAR OF WATER PUMP TO FILTER HOUSING REMOVED HOSE CLAMP REMOVED HOSE FITTED NEW HOSE TO PIPE AND TIGHTENED CLAMPS REFILLED COOLANT	Part	VALVOLINE COOLANT

Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	326880	26/10/2021 09:27:00 AM	REMOVED GEARBOX AND COMPONENTS REMOVED FLYWHEEL AND CLUTCH REMOVED REAR MAIN SEAL STEAMCLEANED G BOX REPLACED INPUT SHAFT KIT CLEANED BELL HOUSING FITTED NEW CLUTCH AND GEARBOX - REPLACED UNI JOINT FITTED CLUTCH FORK LEVER FITTED RETURN SPRING INSULATED G BOX COOLER LINES @ CHASSIS GREASED UNIT + THROWOPUT BEARING CHECKED OVER TIGHTENED LH LOWER PANEL ON CAB CLEANED ALL CHROME AS REQ'D STARTED +	Labor	Clutch System
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	326880	26/10/2021 09:27:00 AM	REMOVED GEARBOX AND COMPONENTS REMOVED FLYWHEEL AND CLUTCH REMOVED REAR MAIN SEAL STEAMCLEANED G BOX REPLACED INPUT SHAFT KIT CLEANED BELL HOUSING FITTED NEW CLUTCH AND GEARBOX - REPLACED UNI JOINT FITTED CLUTCH FORK LEVER FITTED RETURN SPRING INSULATED G BOX COOLER LINES @ CHASSIS GREASED UNIT + THROWOPUT BEARING CHECKED OVER TIGHTENED LH LOWER PANEL ON CAB CLEANED ALL CHROME AS REQ'D STARTED +	Labor	Clutch System
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	326880	26/10/2021 09:27:00 AM	REMOVED GEARBOX AND COMPONENTS REMOVED FLYWHEEL AND CLUTCH REMOVED REAR MAIN SEAL STEAMCLEANED G BOX REPLACED INPUT SHAFT KIT CLEANED BELL HOUSING FITTED NEW CLUTCH AND GEARBOX - REPLACED UNI JOINT FITTED CLUTCH FORK LEVER FITTED RETURN SPRING INSULATED G BOX COOLER LINES @ CHASSIS GREASED UNIT + THROWOPUT BEARING CHECKED OVER TIGHTENED LH LOWER PANEL ON CAB CLEANED ALL CHROME AS REQ'D STARTED +	Labor	Clutch System
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	326880	26/10/2021 09:27:00 AM	REMOVED GEARBOX AND COMPONENTS REMOVED FLYWHEEL AND CLUTCH REMOVED REAR MAIN SEAL STEAMCLEANED G BOX REPLACED INPUT SHAFT KIT CLEANED BELL HOUSING FITTED NEW CLUTCH AND GEARBOX - REPLACED UNI JOINT FITTED CLUTCH FORK LEVER FITTED RETURN SPRING INSULATED G BOX COOLER LINES @ CHASSIS GREASED UNIT + THROWOPUT BEARING CHECKED OVER TIGHTENED LH LOWER PANEL ON CAB CLEANED ALL CHROME AS REQ'D STARTED +	Labor	Clutch System

Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	326880	26/10/2021 09:27:00 AM	REMOVED GEARBOX AND COMPONENTS REMOVED FLYWHEEL AND CLUTCH REMOVED REAR MAIN SEAL STEAMCLEANED G BOX REPLACED INPUT SHAFT KIT CLEANED BELL HOUSING FITTED NEW CLUTCH AND GEARBOX - REPLACED UNI JOINT FITTED CLUTCH FORK LEVER FITTED RETURN SPRING INSULATED G BOX COOLER LINES @ CHASSIS GREASED UNIT + THROWOPUT BEARING CHECKED OVER TIGHTENED LH LOWER PANEL ON CAB CLEANED ALL CHROME AS REQ'D STARTED +	Labor	Clutch System
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	326880	26/10/2021 09:27:00 AM	REMOVED GEARBOX AND COMPONENTS REMOVED FLYWHEEL AND CLUTCH REMOVED REAR MAIN SEAL STEAMCLEANED G BOX REPLACED INPUT SHAFT KIT CLEANED BELL HOUSING FITTED NEW CLUTCH AND GEARBOX - REPLACED UNI JOINT FITTED CLUTCH FORK LEVER FITTED RETURN SPRING INSULATED G BOX COOLER LINES @ CHASSIS GREASED UNIT + THROWOPUT BEARING CHECKED OVER TIGHTENED LH LOWER PANEL ON CAB CLEANED ALL CHROME AS REQ'D STARTED +	Services	1 X REAR MAIN SEAL - 636024
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	326880	26/10/2021 09:27:00 AM	REMOVED GEARBOX AND COMPONENTS REMOVED FLYWHEEL AND CLUTCH REMOVED REAR MAIN SEAL STEAMCLEANED G BOX REPLACED INPUT SHAFT KIT CLEANED BELL HOUSING FITTED NEW CLUTCH AND GEARBOX - REPLACED UNI JOINT FITTED CLUTCH FORK LEVER FITTED RETURN SPRING INSULATED G BOX COOLER LINES @ CHASSIS GREASED UNIT + THROWOPUT BEARING CHECKED OVER TIGHTENED LH LOWER PANEL ON CAB CLEANED ALL CHROME AS REQ'D STARTED +	Services	1 X UNI JOINT - AK09B
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	326880	26/10/2021 09:27:00 AM	REMOVED GEARBOX AND COMPONENTS REMOVED FLYWHEEL AND CLUTCH REMOVED REAR MAIN SEAL STEAMCLEANED G BOX REPLACED INPUT SHAFT KIT CLEANED BELL HOUSING FITTED NEW CLUTCH AND GEARBOX - REPLACED UNI JOINT FITTED CLUTCH FORK LEVER FITTED RETURN SPRING INSULATED G BOX COOLER LINES @ CHASSIS GREASED UNIT + THROWOPUT BEARING CHECKED OVER TIGHTENED LH LOWER PANEL ON CAB CLEANED ALL CHROME AS REQ'D STARTED +	Services	2 X REAR ENGINE MOUNTS - 144917156380

Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	326880	26/10/2021 09:27:00 AM	REMOVED GEARBOX AND COMPONENTS REMOVED FLYWHEEL AND CLUTCH REMOVED REAR MAIN SEAL STEAMCLEANED G BOX REPLACED INPUT SHAFT KIT CLEANED BELL HOUSING FITTED NEW CLUTCH AND GEARBOX - REPLACED UNI JOINT FITTED CLUTCH FORK LEVER FITTED RETURN SPRING INSULATED G BOX COOLER LINES @ CHASSIS GREASED UNIT + THROWOPUT BEARING CHECKED OVER TIGHTENED LH LOWER PANEL ON CAB CLEANED ALL CHROME AS REQ'D STARTED +	Services	1 X CLUTCH INSTALLATION KIT - K-2468
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	326880	26/10/2021 09:27:00 AM	REMOVED GEARBOX AND COMPONENTS REMOVED FLYWHEEL AND CLUTCH REMOVED REAR MAIN SEAL STEAMCLEANED G BOX REPLACED INPUT SHAFT KIT CLEANED BELL HOUSING FITTED NEW CLUTCH AND GEARBOX - REPLACED UNI JOINT FITTED CLUTCH FORK LEVER FITTED RETURN SPRING INSULATED G BOX COOLER LINES @ CHASSIS GREASED UNIT + THROWOPUT BEARING CHECKED OVER TIGHTENED LH LOWER PANEL ON CAB CLEANED ALL CHROME AS REQ'D STARTED +	Services	2 X ISOLATOR ENGINE - 1449852658930
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	326880	26/10/2021 09:27:00 AM	REMOVED GEARBOX AND COMPONENTS REMOVED FLYWHEEL AND CLUTCH REMOVED REAR MAIN SEAL STEAMCLEANED G BOX REPLACED INPUT SHAFT KIT CLEANED BELL HOUSING FITTED NEW CLUTCH AND GEARBOX - REPLACED UNI JOINT FITTED CLUTCH FORK LEVER FITTED RETURN SPRING INSULATED G BOX COOLER LINES @ CHASSIS GREASED UNIT + THROWOPUT BEARING CHECKED OVER TIGHTENED LH LOWER PANEL ON CAB CLEANED ALL CHROME AS REQ'D STARTED +	Services	1 X SPLINE EP ADVANTAGE - 308935-529
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	326880	26/10/2021 09:27:00 AM	REMOVED GEARBOX AND COMPONENTS REMOVED FLYWHEEL AND CLUTCH REMOVED REAR MAIN SEAL STEAMCLEANED G BOX REPLACED INPUT SHAFT KIT CLEANED BELL HOUSING FITTED NEW CLUTCH AND GEARBOX - REPLACED UNI JOINT FITTED CLUTCH FORK LEVER FITTED RETURN SPRING INSULATED G BOX COOLER LINES @ CHASSIS GREASED UNIT + THROWOPUT BEARING CHECKED OVER TIGHTENED LH LOWER PANEL ON CAB CLEANED ALL CHROME AS REQ'D STARTED +	Services	1 X BEARING - 6306-2Z
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	326880	26/10/2021 09:27:00 AM	REMOVED GEARBOX AND COMPONENTS REMOVED FLYWHEEL AND CLUTCH REMOVED REAR MAIN SEAL STEAMCLEANED G BOX REPLACED INPUT SHAFT KIT CLEANED BELL HOUSING FITTED NEW CLUTCH AND GEARBOX - REPLACED UNI JOINT FITTED CLUTCH FORK LEVER FITTED RETURN SPRING INSULATED G BOX COOLER LINES @ CHASSIS GREASED UNIT + THROWOPUT BEARING CHECKED OVER TIGHTENED LH LOWER PANEL ON CAB CLEANED ALL CHROME AS REQ'D STARTED +	Labor	PM Level 1, PM, PERFORMED

Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	329183	10/11/2021 06:18:00 PM	CARRIED OUT PM 1 SERVICE AS PER SCHEDULE	Services	ENVIRO LEVY
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	329183	10/11/2021 06:18:00 PM	TOPPED UP ENGINE OIL	Labor	Power Plant
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	329183	10/11/2021 06:18:00 PM	TOPPED UP ENGINE OIL	Part	Oil - Engine
Brisbane Workshop	124	BREAKDOWN	WSTST 4800	2005 PM	976SQY	330344	15/11/2021 10:30:00 AM	CHECKED AS REQD - BOTH RHS HLIGHTS N/W TEST WIRING - NO POWER LOW BEAM CIRCUIT RESET CIRCUIT BREAKER - TESTED OK INSULATED + SECURED RHS WIRING LOOM ALL 4 HEADLIGHTS - YELLOW + SCRATCHY RESTORED ALL 4 HLIGHTS + UV PROTECTANT	Labor	Lighting System
Brisbane Workshop	124	BREAKDOWN	WSTST 4800	2005 PM	976SQY	330344	15/11/2021 10:30:00 AM	CHECKED AS REQD - BOTH RHS HLIGHTS N/W TEST WIRING - NO POWER LOW BEAM CIRCUIT RESET CIRCUIT BREAKER - TESTED OK INSULATED + SECURED RHS WIRING LOOM ALL 4 HEADLIGHTS - YELLOW + SCRATCHY RESTORED ALL 4 HLIGHTS + UV PROTECTANT	Services	1 X H/LIGHT RESTORE KIT
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	331303	18/11/2021 03:56:00 PM	FOUND PLUG BURNT OUT FOR BLOWER FITTED DENTRY PLUG	Labor	Air Conditioning, Heating & Ventilating System
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	332489	22/11/2021 09:38:00 AM	REPAIRED CUT HORN WIRING - CHECKED PARK BRAKE - ALL OK RECONNECTED HORN BUTTON	Labor	Cab
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	332591	23/11/2021 03:25:00 PM	REMOVED REAR SECTION OF TAILSHAFT AND REMOVED UNI REMOVED INPUT YOKE ON 1ST DRIVE REPLACED DIFF SEAL AND REFITTED REPLACED NUT AND WASHES AND TIGHTENED YOKE REPLACED REAR TAILSHAFT UNI MISSING BOLT AND ALL THE OTHERS LOOSE REMOVED ALL BELTS LOCTITE BELTS AND TORQUE AS PER SPEC FRONT AND REAR UNIS BELTS GREASE TAILSHAFT AND JOCK	Labor	Drive Shafts
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	332591	23/11/2021 03:25:00 PM	REMOVED REAR SECTION OF TAILSHAFT AND REMOVED UNI REMOVED INPUT YOKE ON 1ST DRIVE REPLACED DIFF SEAL AND REFITTED REPLACED NUT AND WASHES AND TIGHTENED YOKE REPLACED REAR TAILSHAFT UNI MISSING BOLT AND ALL THE OTHERS LOOSE REMOVED ALL BELTS LOCTITE BELTS AND TORQUE AS PER SPEC FRONT AND REAR UNIS BELTS GREASE TAILSHAFT AND JOCK	Services	1 X TAILSHAFT - 5-281XB
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	332591	23/11/2021 03:25:00 PM	REMOVED REAR SECTION OF TAILSHAFT AND REMOVED UNI REMOVED INPUT YOKE ON 1ST DRIVE REPLACED DIFF SEAL AND REFITTED REPLACED NUT AND WASHES AND TIGHTENED YOKE REPLACED REAR TAILSHAFT UNI MISSING BOLT AND ALL THE OTHERS LOOSE REMOVED ALL BELTS LOCTITE BELTS AND TORQUE AS PER SPEC FRONT AND REAR UNIS BELTS GREASE TAILSHAFT AND JOCK	Services	1 X DIFF SEAL - 210736EA

Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	332591	23/11/2021 03:25:00 PM	REMOVED REAR SECTION OF TAILSHAFT AND REMOVED UNI REMOVED INPUT YOKE ON 1ST DRIVE REPLACED DIFF SEAL AND REFITTED REPLACED NUT AND WASHES AND TIGHTENED YOKE REPLACED REAR TAILSHAFT UNI MISSING BOLT AND ALL THE OTHERS LOOSE REMOVED ALL BELTS LOCTITE BELTS AND TORQUE AS PER SPEC FRONT AND REAR UNIS BELTS GREASE TAIL SHAFT AND LOCK	Services	1 X DIFF NUT - 126155EA
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	332591	23/11/2021 03:25:00 PM	REMOVED REAR SECTION OF TAILSHAFT AND REMOVED UNI REMOVED INPUT YOKE ON 1ST DRIVE REPLACED DIFF SEAL AND REFITTED REPLACED NUT AND WASHES AND TIGHTENED YOKE REPLACED REAR TAILSHAFT UNI MISSING BOLT AND ALL THE OTHERS LOOSE REMOVED ALL BELTS LOCTITE BELTS AND TORQUE AS PER SPEC FRONT AND REAR UNIS BELTS GREASE TAIL SHAFT AND LOCK	Services	1 X WASHER - 126247EA
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	338186	22/12/2021 10:53:00 AM	CARRIED OUT SERVICE 2 AS PER SCHEDULE.	Labor	PM Level 2, PM, PERFORMED
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	338186	22/12/2021 10:53:00 AM	CARRIED OUT SERVICE 2 AS PER SCHEDULE.	Part	Oil - Engine
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	338186	22/12/2021 10:53:00 AM	CARRIED OUT SERVICE 2 AS PER SCHEDULE.	Services	ENVIRO LEVY
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	338186	22/12/2021 10:53:00 AM	CARRIED OUT SERVICE 2 AS PER SCHEDULE.	Services	1 x P554685 COOLANT FILTER
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	338186	22/12/2021 10:53:00 AM	CARRIED OUT SERVICE 2 AS PER SCHEDULE.	Services	1 x P556916 FUEL FILTER
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	338186	22/12/2021 10:53:00 AM	CARRIED OUT SERVICE 2 AS PER SCHEDULE.	Services	1 x P556915 FUEL FILTER
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	338186	22/12/2021 10:53:00 AM	CARRIED OUT SERVICE 2 AS PER SCHEDULE.	Services	2 x P552100 LUBE FILTER
Brisbane Workshop	124	BREAKDOWN	WSTST 4800	2005 PM	976SQY	344662	03/02/2022 04:12:00 PM	ATTENDED BREAKDOWN AT MUARRIE FITTED A NEW BOOST HOSE CLAMP MARK SUPPLIED	Labor	Brakes
Brisbane Workshop	124	BREAKDOWN	WSTST 4800	2005 PM	976SQY	344662	03/02/2022 04:12:00 PM	ATTENDED BREAKDOWN AT MUARRIE FITTED A NEW BOOST HOSE CLAMP MARK SUPPLIED	Services	CALL OUT FEE
Brisbane Workshop	124	BREAKDOWN	WSTST 4800	2005 PM	976SQY	344662	03/02/2022 04:12:00 PM	ATTENDED BREAKDOWN AT MUARRIE FITTED A NEW BOOST HOSE CLAMP MARK SUPPLIED	Services	4 X T CLAMP BOLT
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	349494	28/02/2022 06:00:00 PM	CARRIED OUT PM 1 AS PER SCHEDULE	Labor	PM Level 1, PM, PERFORMED
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	349494	28/02/2022 06:00:00 PM	CARRIED OUT PM 1 AS PER SCHEDULE	Services	ENVIRO LEVY
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	357016	07/04/2022 02:45:00 PM	RESET CIRCUIT BREAKER DRIVER TO MONITOR	Labor	Lighting System
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	1	13/04/2022 10:28:00 AM	CUT AND POLISH CBA DIFFUSER AND TOUCH UPS	Services	SUBTOTAL

Brisbane Workshop	124	FAULT	WSTST 4800	2005 PM	976SQY	358066	14/04/2022 11:38:00 AM	FR84852 - 14/04/2022 THROTTLE SENSOR PLAYING UP PASSENEGER SIDE WINDOW WILL NOT GO UP CHECK ENGINGE LIGHT COMING ON WHEN HORTON FAN ENGAGES AND STAYS ON EARTH SWITCH ON LIGHTS NEED DOOING LOW BEAM NOT WORKING DRIVERS SIDE CUT + POLISH SEE DEAN HAS ORGANISED DIAGNOSIS RESET RH LOW BEAM CIRCUIT BREAKER CHECKED ELEC WINDOW CONNECTED TO ECM FOUND COOLANT LEVEL SENSOR AND ENGINE OIL TEMP SENSOR FAULTY REPLACED BOTH SENSORS FITTED NEW LEFT WINDOW REGUALTOR FITTED NEW LEFT WINDOW SORTED INTERIOR LIGHT STAYING ON WIRED UP BLING LIGHTS INDEPENEDANT	Labor	Fault Reports
Brisbane Workshop	124	FAULT	WSTST 4800	2005 PM	976SQY	358066	14/04/2022 11:38:00 AM	FR84852 - 14/04/2022 THROTTLE SENSOR PLAYING UP PASSENEGER SIDE WINDOW WILL NOT GO UP CHECK ENGINGE LIGHT COMING ON WHEN HORTON FAN ENGAGES AND STAYS ON EARTH SWITCH ON LIGHTS NEED DOOING LOW BEAM NOT WORKING DRIVERS SIDE CUT + POLISH SEE DEAN HAS ORGANISED DIAGNOSIS RESET RH LOW BEAM CIRCUIT BREAKER CHECKED ELEC WINDOW CONNECTED TO ECM FOUND COOLANT LEVEL SENSOR AND ENGINE OIL TEMP SENSOR FAULTY REPLACED BOTH SENSORS FITTED NEW LEFT WINDOW REGUALTOR FITTED NEW LEFT WINDOW SORTED INTERIOR LIGHT STAYING ON WIRED UP BLING LIGHTS INDEPENEDANT	Labor	Fault Reports
Brisbane Workshop	124	FAULT	WSTST 4800	2005 PM	976SQY	358066	14/04/2022 11:38:00 AM	FR84852 - 14/04/2022 THROTTLE SENSOR PLAYING UP PASSENEGER SIDE WINDOW WILL NOT GO UP CHECK ENGINGE LIGHT COMING ON WHEN HORTON FAN ENGAGES AND STAYS ON EARTH SWITCH ON LIGHTS NEED DOOING LOW BEAM NOT WORKING DRIVERS SIDE CUT + POLISH SEE DEAN HAS ORGANISED DIAGNOSIS RESET RH LOW BEAM CIRCUIT BREAKER CHECKED ELEC WINDOW CONNECTED TO ECM FOUND COOLANT LEVEL SENSOR AND ENGINE OIL TEMP SENSOR FAULTY REPLACED BOTH SENSORS FITTED NEW LEFT WINDOW REGUALTOR FITTED NEW LEFT WINDOW SORTED INTERIOR LIGHT STAYING ON WIRED UP BLING LIGHTS INDEPENEDANT	Services	INV7759008

Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	361669	20/05/2022 03:38:00 PM	FITTED DG BOOK	Labor	Frame Components
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	361669	20/05/2022 03:38:00 PM	FITTED DG BOOK	Services	1 X DG BOOK
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	362562	24/05/2022 03:00:00 PM	CARRIED OUT PM 2 AS PER SCHEUDLE	Labor	PM Level 2, PM, PERFORMED
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	362562	24/05/2022 03:00:00 PM	CARRIED OUT PM 2 AS PER SCHEUDLE	Part	Oil - Engine
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	362562	24/05/2022 03:00:00 PM	CARRIED OUT PM 2 AS PER SCHEUDLE	Part	VALVOLINE COOLANT
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	362562	24/05/2022 03:00:00 PM	CARRIED OUT PM 2 AS PER SCHEUDLE	Services	ENVIRO LEVY
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	362562	24/05/2022 03:00:00 PM	CARRIED OUT PM 2 AS PER SCHEUDLE	Services	INV 7802522
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	362562	24/05/2022 03:00:00 PM	CARRIED OUT PM 2 AS PER SCHEUDLE	Services	INV 7801042
Rockhampton Workshop	124	BREAKDOWN	WSTST 4800	2005 PM	976SQY	364252	31/05/2022 01:04:00 PM	ATTEND BREAKDOWN AT MARMOR FOR FAILED ALTERNATOR, REPLACED	Labor	Charging System
Rockhampton Workshop	124	BREAKDOWN	WSTST 4800	2005 PM	976SQY	364252	31/05/2022 01:04:00 PM	ATTEND BREAKDOWN AT MARMOR FOR FAILED ALTERNATOR, REPLACED	Services	ALTERNATOR
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	366431	08/06/2022 03:58:00 PM	FAULT IN T PLUG REPAIRED	Labor	Lighting System
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	1	27/06/2022 07:27:00 PM	COOLANT LEAK DS OF ENGINE TENTIONED HOSE CLAMPS IN AREA OF	Labor	Power Plant
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	376940	08/08/2022 07:08:00 AM	CARRIED OUT PM 1 AS PER SCHEDULE	Labor	PM Level 1, PM, PERFORMED
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	376940	08/08/2022 07:08:00 AM	CARRIED OUT PM 1 AS PER SCHEDULE	Services	ENVIRO LEVY
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	376940	08/08/2022 07:08:00 AM	REPLACED 1KG FIRE EXTING	Labor	Frame Components
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	376940	08/08/2022 07:08:00 AM	REPLACED 1KG FIRE EXTING	Services	1 X FIRE EXTING EXCH
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	385245	27/09/2022 04:35:00 PM	CARRIED OUT PM 2 AS PER SCHEDULE	Part	Oil - Engine
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	385245	27/09/2022 04:35:00 PM	CARRIED OUT PM 2 AS PER SCHEDULE	Services	ENVIRO LEVY
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	385245	27/09/2022 04:35:00 PM	CARRIED OUT PM 2 AS PER SCHEDULE	Services	GREASE
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	385245	27/09/2022 04:35:00 PM	CARRIED OUT PM 2 AS PER SCHEDULE	Services	INV 8032049
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	387666	05/10/2022 05:54:00 PM	REPLACED JAKE BRAKE REBUILD REPLACED ALL JAKE BRAKE SOLINOID	Labor	Brakes
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	387666	05/10/2022 05:54:00 PM	REPLACED JAKE BRAKE REBUILD REPLACED ALL JAKE BRAKE SOLINOID	Services	3 X 01-024612
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	388455	10/10/2022 11:13:00 AM	REPLACED FAN AND SOLENIOD	Labor	Power Plant
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	388455	10/10/2022 11:13:00 AM	REPLACED FAN AND SOLENIOD	Services	INV NDH1598N -
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	388455	10/10/2022 11:13:00 AM	REPLACED FAN AND SOLENIOD	Services	INV NDH1622N
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	391664	27/10/2022 04:22:00 PM	INSPECTED AND FOUND AIR LEAK COLLECTED PARTS FROM TRUCK LINE BRANCH REPLACED LEAKINH AIR FITTINGS INSPECTED NO LONGGER	Labor	Frame Components

Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	393860	11/11/2022 11:40:00 AM	TRIED TO TRACE BREAK IN SUPPLY TO MOTOR WORKING ALL THE TIME MARK TO MONITOR BLOWER STILL WORKING CHECKED HORTON STAYING ON CLEANED AND TENSIONED WATER LEVEL SWITCH CONTACTS FIDDLING WITH AC HP LP SWITCH FOUND CLEANED ADVISED DAVE ON AC	Labor	Cab
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	393860	11/11/2022 11:40:00 AM	TRIED TO TRACE BREAK IN SUPPLY TO MOTOR WORKING ALL THE TIME MARK TO MONITOR BLOWER STILL WORKING CHECKED HORTON STAYING ON CLEANED AND TENSIONED WATER LEVEL SWITCH CONTACTS FIDDLING WITH AC HP LP SWITCH FOUND CLEANED ADVISED DAVE ON AC	Labor	Cab
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	398603	07/12/2022 02:20:00 PM	FITTED 2ND CRADLE AND CHECKED CLEANED CONTACTS ON PDA REFITTED	Labor	Electrical Accessories
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	398635	07/12/2022 03:00:00 PM	CARRIED OUT PM 1 AS PER SCHEDULE	Labor	PM Level 1, PM, PERFORMED
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	398635	07/12/2022 03:00:00 PM	CARRIED OUT PM 1 AS PER SCHEDULE	Part	Oil - Engine
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	398635	07/12/2022 03:00:00 PM	REPLACED LEAKING FITTING IN TREADLE VALVE / FIREWALL TIGHTENED AND TENTIONED LHR DRIVE U BOLTS TIGHTEND PITMEN ARM BOLT PERFORMED DRIVE ROTATION	Labor	Frame Components
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	398635	07/12/2022 03:00:00 PM	REPLACED LEAKING FITTING IN TREADLE VALVE / FIREWALL TIGHTENED AND TENTIONED LHR DRIVE U BOLTS TIGHTEND PITMEN ARM BOLT PERFORMED DRIVE ROTATION	Services	1 X 1869X105 - 5/8 TUBE
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	400513	16/12/2022 02:21:00 PM	TRACED LOOSE CONNECTION AND RPAIRED ADJUSTED CLUTCH	Labor	Power Plant
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	400513	16/12/2022 02:21:00 PM	TRACED LOOSE CONNECTION AND RPAIRED ADJUSTED CLUTCH	Labor	Power Plant
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	403091	13/01/2023 05:02:00 PM	CONDUCTED VISUAL INSPECTION OF BRAKE SYSTEM ADJUSTED BRAKES BRAKE SYSTEM CHECKED LEAKS FOUND ABS PROPORTIING VALVE BETWWEN DIFFS EXHAUSTING AND FRONT DRIVE BOOSTERS FITTED WITH INCORRECT CLEVIS YOKE COUPLING PUSHED TO WEAR. PUSHED CROOKED ADVISED TO REPLACED REAR BOOSTER <sup>ABS VALVE</sup>	Labor	Brakes
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	403091	13/01/2023 05:02:00 PM	CONDUCTED VISUAL INSPECTION OF BRAKE SYSTEM ADJUSTED BRAKES BRAKE SYSTEM CHECKED LEAKS FOUND ABS PROPORTIING VALVE BETWWEN DIFFS EXHAUSTING AND FRONT DRIVE BOOSTERS FITTED WITH INCORRECT CLEVIS YOKE COUPLING PUSHED TO WEAR. PUSHED CROOKED ADVISED TO REPLACED REAR BOOSTER <sup>ABS VALVE</sup>	Services	2 X 30.30KSEALED

Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	403501	17/01/2023 02:28:00 PM	REPLACED FRONT AXLE MOUNTED SHOCKIES	Labor	Suspension
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	403501	17/01/2023 02:28:00 PM	REPLACED FRONT AXLE MOUNTED SHOCKIES	Services	2 X P1698 - SHOCKIES
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	403350	17/01/2023 04:22:00 PM	INSPECT UNEVEN TYRE WEAR AND FOUND RH STEER SHOCKY LEAKING ORDER SHOCKYS TO SUT	Labor	Tires, Tubes, Liners & Valves
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	407050	07/02/2023 06:38:00 PM	TIGHTENED ALL THE HOSES ONAIR INTAKE	Labor	Frame Components
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	407347	09/02/2023 12:18:00 PM	SHAKE N SAFETY CHECK CHECKED FRONT ALIGNEMENT SET TOE AND CENTRALIZE STEERING WHEEL CASTER ADJUSTEMENT CASTOR WEDGE 100MM X 2DG AXKE SET BACK ADJUSTMENT DRIVE ALIGNMENT RELOCATED AXLE TRACKING WHEEL BALANCE REMOVED LEFT HAND REAR SPRING PACK REPAIRED BROKEN CENTRE BOLT AND REFITTED	Services	SUBTOTAL
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	408963	20/02/2023 03:09:00 PM	CARRIED OUT PM 2 AS PER SCHEDUL E	Labor	PM Level 2, PM, PERFORMED
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	408963	20/02/2023 03:09:00 PM	CARRIED OUT PM 2 AS PER SCHEDUL E	Part	Oil - Engine
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	408963	20/02/2023 03:09:00 PM	CARRIED OUT PM 2 AS PER SCHEDUL E	Services	INV 8305187
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	408963	20/02/2023 03:09:00 PM	BULBS TWO TOP CAB PASS SIDE MARKER LIGHTS	Labor	Lighting System
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	410260	28/02/2023 02:46:00 PM	REPLACED MARKERS MARKERS ON RH MIRROR	REPLACED	Comment 2 X FMT STOCK MARKERS
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	410260	28/02/2023 02:46:00 PM	REPLACED MARKERS MARKERS ON RH MIRROR	REPLACED	Comment 4 X RED MARKERS FMT STOCK
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	410260	28/02/2023 02:46:00 PM	REPLACED MARKERS MARKERS ON RH MIRROR	REPLACED	Comment 1 X WHITE MARKER FMT STOCK
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	410260	28/02/2023 02:46:00 PM	REPLACED MARKERS MARKERS ON RH MIRROR	REPLACED	Labor
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	410260	28/02/2023 02:46:00 PM	REPLACED MARKERS MARKERS ON RH MIRROR	REPLACED	Frame Components
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	410260	28/02/2023 02:46:00 PM	REPLACED MARKERS MARKERS ON RH MIRROR	REPLACED	Frame Components
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	412011	09/03/2023 05:22:00 PM	ADJUSTED RONT RIGHT HUB BEARINGS	Labor	Wheels, Rims, Hubs & Bearings
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	1	23/03/2023 03:43:00 PM	REPLACED FAUTLY LMAPS	Comment	DRIVERS STOCK
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	1	23/03/2023 03:43:00 PM	REPLACED FAUTLY LMAPS	Labor	Lighting System
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	1	23/03/2023 03:43:00 PM	REPLACED FAUTLY LMAPS	Labor	Lighting System
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	416943	14/04/2023 07:41:00 PM	REMOVED DAMAGED TURNTABLE HANDLE FITTED NEW	Labor	Fifth Wheel - Lower Coupler Assembly
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	419107	02/05/2023 07:57:00 PM	REMOVED HOSE CLAMP CUT BACK HOSE AND REFITTED HOSE CLAMP FILLED WITH COOLATN	Labor	Power Plant
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	420719	09/05/2023 06:11:00 PM	CARRIED OUT PM 1 AS PER SCHEDULE	Labor	PM Level 1, PM, PERFORMED
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	420719	09/05/2023 06:11:00 PM	CARRIED OUT PM 1 AS PER SCHEDULE	Services	ENVIRO LEVY
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	421637	15/05/2023 09:47:00 AM	FITTED ANTENNA FITTED NEW DRIVERS SIDE WINDOW CHANNEL	Labor	Cab

Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	421637	15/05/2023 09:47:00 AM	FITTED ANTENNA DRIVERS SIDE WINDOW CHANNEL	Labor	Cab
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	421637	15/05/2023 09:47:00 AM	FITTED ANTENNA DRIVERS SIDE WINDOW CHANNEL	Services	INV 8513292
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	421637	15/05/2023 09:47:00 AM	FITTED ANTENNA DRIVERS SIDE WINDOW CHANNEL	Services	INV NDH3372N
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	1	18/05/2023 11:00:00 AM	REMOVED WINDOW GUIDE AND FIXED BROKEN SUPPORTS SO WINDPOW DOESNT FALL OUT DRIVERS	Labor	Frame Components
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	427970	16/06/2023 11:21:00 AM	GLUE RIGHT WINDOW IN REGULATOR KEEPER	Labor	Cab
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	430790	13/07/2023 06:40:00 PM	UPON INSPECTION FOUND GEARSTICK BOOT IU/S ALSO FOUND IN CAB ENGINE SEALED OFF/ GASKET U/S REPLACED GEAR STICK BOOT REPLACED ENGINE COVER GASKET AND SEAL REPLACED GEARSTICK BOOT REPLACED ENGINE SEAL AND GASKET	Labor	Cab
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	430790	13/07/2023 06:40:00 PM	UPON INSPECTION FOUND GEARSTICK BOOT IU/S ALSO FOUND IN CAB ENGINE SEALED OFF/ GASKET U/S REPLACED GEAR STICK BOOT REPLACED ENGINE COVER GASKET AND SEAL REPLACED GEARSTICK BOOT REPLACED ENGINE SEAL AND GASKET	Services	INV NDH3756N GASKET SEAL
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	433790	14/07/2023 03:00:00 PM	CARRIED OUT PM 3 AS PER SCHEDULE	Labor	PM Level 3
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	433790	14/07/2023 03:00:00 PM	CARRIED OUT PM 3 AS PER SCHEDULE	Part	Oil - Engine
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	433790	14/07/2023 03:00:00 PM	CARRIED OUT PM 3 AS PER SCHEDULE	Part	Oil - Manual Transmission
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	433790	14/07/2023 03:00:00 PM	CARRIED OUT PM 3 AS PER SCHEDULE	Services	ENVIRO LEVY
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	433790	14/07/2023 03:00:00 PM	CARRIED OUT PM 3 AS PER SCHEDULE	Services	ALL FILTERS FOR SERVICE
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	436090	09/08/2023 01:12:00 PM	REMOVED DOOR AND MIRROR EXPOSE CRACKS AND TREAT RUST INSTALLED NEW METAL AROUND WINDOW FILL AND SAND DAMAGED AREAS APPLIED 1 XOAT HIGH BUILD PRIMER APPLIED 2 COATS OF PAINT REFITTED DOOR REFITTED MIRROR WELDED CRACK IN BUMPER POLISHED BUMPER	Labor	Frame Components
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	436090	09/08/2023 01:12:00 PM	REMOVED DOOR ANTENNA AND LIGHT REPLACED WIRING AND CONNECTED ANTENNAS	Labor	Electrical Accessories

Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	436090	01/08/2023 01:49:00 PM	WORK COMPLETED Travel to Eagle Farm - Checked AC operation on truck. Tested pressures and operation, found there was refrigerant in the system but the compressor wasn't engaging. Confirmed compressor was receiving power from pressure switch. Diagnosed clutch coil was open circuit. Removed and replaced coil compressor coil with customer supplied part. Tested operation - OK. Removed panels and cleaned evaporator core to increase air flow. Topped up refrigerant for optimal performance. Tested OK. HOW TO PAY	Services	SUBTOTAL
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	436090	03/08/2023 02:35:00 PM	CHECKED COMP NOT PULLIN IN CHECKED VOLTAGE TO CARRYS 14 COMPR CLUTCH FAULTS	Labor	Air Conditioning, Heating & Ventilating System
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	436309	11/08/2023 05:24:00 PM	FIXED TOP LHS EXHASUT MOUNT STRAIGHTENED LKHS EXHASUT STACK	Labor	Frame Components
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	443007	11/09/2023 02:48:00 PM	ASSISTED MARK WITH TAIL LIGHTS	Labor	Lighting System
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	445756	25/09/2023 03:54:00 PM	CARRIED OUT PM 1	Labor	PM Level 1
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	445756	25/09/2023 03:54:00 PM	CARRIED OUT PM 1	Services	ENVIRO LEVY
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	445756	25/09/2023 03:54:00 PM	REPLACED FAN BELTS	Labor	Power Plant
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	445756	25/09/2023 03:54:00 PM	REPLACED FAN BELTS	Services	INV 8817889 - BELTS
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	452102	30/10/2023 02:34:00 PM	INSPECTED FOR ROOF LEAKS FOUND ALL ROOF LIGHT TO BE DAMAGED AND LEAKING REPLACED ALL NUT CERTS IN ROOF AND SILICONE ROOF HOLES REPLACED FAULTY CLEARANCE LIGHT	Labor	Frame Components
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	452102	30/10/2023 02:34:00 PM	INSPECTED FOR ROOF LEAKS FOUND ALL ROOF LIGHT TO BE DAMAGED AND LEAKING REPLACED ALL NUT CERTS IN ROOF AND SILICONE ROOF HOLES REPLACED FAULTY CLEARANCE LIGHT	Services	1 X 26260NCK - CLEARNCE LIGHT
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	452102	30/10/2023 02:34:00 PM	INSPECTED FOR ROOF LEAKS FOUND ALL ROOF LIGHT TO BE DAMAGED AND LEAKING REPLACED ALL NUT CERTS IN ROOF AND SILICONE ROOF HOLES REPLACED FAULTY CLEARANCE LIGHT	Services	5 X ORANAGE ROOF LIGHTS
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	454636	10/11/2023 11:27:00 AM	INSPECTED FOR WATER LEAK IN CAB FOUND LH WINDSCENE LEAKING WINDSCREEN AS RESEALED BY THE	Labor	Power Plant
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	454787	10/11/2023 03:04:00 PM	RESEAL WINDSCREEN TO SUIT WESTERN STAR	Services	SUBTOTAL
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	454787	15/11/2023 06:36:00 AM	CARRIED OUT PM 2 AS PER SCHEDULE	Labor	PM Level 2
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	454787	15/11/2023 06:36:00 AM	CARRIED OUT PM 2 AS PER SCHEDULE	Labor	PM Level 2
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	454787	15/11/2023 06:36:00 AM	CARRIED OUT PM 2 AS PER SCHEDULE	Services	ENVIRO LEVY
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	454787	15/11/2023 06:36:00 AM	CARRIED OUT PM 2 AS PER SCHEDULE	Services	INV 8920927

Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	454787	15/11/2023 06:36:00 AM	CARRIED OUT PM 2 AS PER SCHEDULE	Services	inv 8930547
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	454787	15/11/2023 06:36:00 AM	CARRIED OUT PM 2 AS PER SCHEDULE	Services	INV 8930333
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	454787	15/11/2023 06:36:00 AM	CARRIED OUT PM 2 AS PER SCHEDULE	Services	2 X 552100 - OIL FILTERS
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	454787	15/11/2023 06:36:00 AM	CARRIED OUT PM 2 AS PER SCHEDULE	Services	2 X BP4045 - LOCK WASHER
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	454787	15/11/2023 06:36:00 AM	CARRIED OUT PM 2 AS PER SCHEDULE	Services	1 X MF25ABE
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	454787	15/11/2023 06:36:00 AM	REPLACED STEER WHEEL BEARINGS	Labor	Wheels, Rims, Hubs & Bearings
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	454787	15/11/2023 06:36:00 AM	REPAIRED WIRING FOR ROOF LIGHT	Labor	Lighting System
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	454787	15/11/2023 06:36:00 AM	REPLACED VALVE RELAY UNDER DECK PLATE ON DRIVERS SIDE FRONT SIDE	Services	INV 8933276
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	459765	11/12/2023 11:16:00 AM	WELDED BROKEN RADIATOR SUPPORT	Labor	Power Plant
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	465091	11/01/2024 06:06:00 AM	CARRIED OUT PM 1 AS PER SCHEDULE	Labor	PM Level 1
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	465091	11/01/2024 06:06:00 AM	CARRIED OUT PM 1 AS PER SCHEDULE	Services	ENVIRO LEVY
Brisbane Workshop	124	SCHEDULED	WSTST 4800	2005 PM	976SQY			14/07/23 FRONT OF ENGINE LEAKING OIL AROUND FAN REAR MAIN LEAK AIR FILTER 24/05/2022 BOTH LH FUEL TANKS SLIGHT LEAK - RY 10/11/21 ABS LIGHT ON DASH 05/07/21 TIMING COVER GASKET LEAKING, MONITOR SUMP GASKET LEAKING, MONITOR DIP STICK IS LEAKING OUT OF THE CAP, PROBABLY FROM BLOW BY 05/10/2022 ENGINE FOR SPLIT HOPTON LEAN STUCK ON		
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	465100	16/01/2024 12:51:00 PM	REPLACE LEAKING FUEL FILTER	Labor	Fuel System
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	465100	16/01/2024 12:51:00 PM	REPLACE LEAKING FUEL FILTER	Services	FUEL FILTER
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	466114	21/02/2024 05:53:00 AM	REMOVED EXHAUST SYSTEM - CUT + FABRICATE NEW EXHAUST SYSTEM AND RE-ASSEMBLE REPLACED ONE STRETCH CLAMP TO L/H ELBOW JOIN - TESTED - ALL WORKING - NO LEAKS	Labor	Exhaust System
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	466114	21/02/2024 05:53:00 AM	REMOVED EXHAUST SYSTEM - CUT + FABRICATE NEW EXHAUST SYSTEM AND RE-ASSEMBLE REPLACED ONE STRETCH CLAMP TO L/H ELBOW JOIN - TESTED - ALL WORKING - NO LEAKS	Labor	
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	466114	21/02/2024 05:53:00 AM	REMOVED EXHAUST SYSTEM - CUT + FABRICATE NEW EXHAUST SYSTEM AND RE-ASSEMBLE REPLACED ONE STRETCH CLAMP TO L/H ELBOW JOIN - TESTED - ALL WORKING - NO LEAKS	Services	1X 0151127 5" EXHAUST PIPE
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	466114	21/02/2024 05:53:00 AM	REMOVED EXHAUST SYSTEM - CUT + FABRICATE NEW EXHAUST SYSTEM AND RE-ASSEMBLE REPLACED ONE STRETCH CLAMP TO L/H ELBOW JOIN - TESTED - ALL WORKING - NO LEAKS	Services	2X 90859A EXHAUST ELBOW EXPANDED END

Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	466114	21/02/2024 05:53:00 AM	REMOVED EXHAUST SYSTEM - CUT + FABRICATE NEW EXHAUST SYSTEM AND RE-ASSEMBLE REPLACED ONE STRETCH CLAMP TO L/H ELBOW JOIN - TESTED - ALL WORKING - NO LEAKS	Services	1X 90358A 127MM WIDE BAND LAP CLAMP
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	466114	21/02/2024 05:53:00 AM	REMOVED EXHAUST SYSTEM - CUT + FABRICATE NEW EXHAUST SYSTEM AND RE-ASSEMBLE REPLACED ONE STRETCH CLAMP TO L/H ELBOW JOIN - TESTED - ALL WORKING - NO LEAKS	Services	ENVIRO LEVY
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	466930	05/04/2024 08:16:00 AM	TRAILER LIGHTS - TRACED BREAK IN TRAILER HARNESS TO T/PLUG - REPAIRED T-PLUG WIRING	Labor	Lighting System
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	466930	05/04/2024 08:16:00 AM	TRAILER LIGHTS - TRACED BREAK IN TRAILER HARNESS TO T/PLUG - REPAIRED T-PLUG WIRING	Labor	Lighting System
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	467222	11/04/2024 05:37:00 AM	REMOVED P/S SEAT AND BLOCK OFF AIR LINE - REMOVE TRAIN HORN AND BLOCK OFF AIRLINE	Labor	Cab
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	467222	11/04/2024 05:37:00 AM	REMOVED P/S SEAT AND BLOCK OFF AIR LINE - REMOVE TRAIN HORN AND BLOCK OFF AIRLINE	Services	1X 186X4 CONNECTOR
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	467222	11/04/2024 05:37:00 AM	REMOVED P/S SEAT AND BLOCK OFF AIR LINE - REMOVE TRAIN HORN AND BLOCK OFF AIRLINE	Services	1X 3300X2 COUPLING
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	467222	11/04/2024 05:37:00 AM	REMOVED P/S SEAT AND BLOCK OFF AIR LINE - REMOVE TRAIN HORN AND BLOCK OFF AIRLINE	Services	1X 3152X2 HEX HEAD
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	467222	11/04/2024 05:37:00 AM	REMOVED P/S SEAT AND BLOCK OFF AIR LINE - REMOVE TRAIN HORN AND BLOCK OFF AIRLINE	Services	1X 1862X4 UNION TUBE
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	467222	11/04/2024 05:37:00 AM	REMOVED P/S SEAT AND BLOCK OFF AIR LINE - REMOVE TRAIN HORN AND BLOCK OFF AIRLINE	Services	1X 72517NA HORN DISC
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	467222	11/04/2024 05:37:00 AM	REMOVED P/S SEAT AND BLOCK OFF AIR LINE - REMOVE TRAIN HORN AND BLOCK OFF AIRLINE	Services	1X 90358A CLAMP
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	467842	07/05/2024 06:13:00 AM	JUMP START	Labor	Cranking System
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	467869	08/05/2024 10:07:00 AM	CHARGE AND CHECK BATTERIES - FAILED - FIT 1X 2ND HAND BATTERY TO REPLACE DEAD ONE	Labor	Cranking System
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	467869	20/05/2024 06:52:00 AM	JUMP START IN YARD - CONNECTED CHARGING - REMOVED 2WAY & ANTENNA & PDA CRADLE	Labor	Cranking System
Brisbane Workshop	124	R&M	WSTST 4800	2005 PM	976SQY	467869	20/05/2024 06:52:00 AM	DECOMMISSION TRUCK - REMOVED AND REPLACED SEAT - REMOVED ALL FOLLOWMONT ITEMS FROM TRUCK	Labor	Nameplates, Decals, Warning Signs