

**Poyser Motor Group** 

Authorised Mercedes-Benz Sales, Service & Parts

## SERVICE TAX INVOICE

Customer No. 112	Customer Name & Address: Scott Rouke	Build Year: 2012	Odometer: 74379	Document Number: 1125903
Customer ABN:	1 Quin Dr SWAN HILL VIC	Make: Mercedes-Benz	Model: ML63 AMG	Document Date: 13/05/2021
Rego Number: AXP456	Driver Name & Address:	Vehicle ID Number: WDC1660742A059048	Paint: GREY	Repair Order Number: 267311
Stock No:	Scott Rouke 1 Quin Dr	Chassis Number: WDC1660742A059048	Key Tag No:	Tax Exempt Number:
P/Order No:	SWAN HILL VIC	Engine Number: 15798260009169	Delivery Date: 25/02/2012	Advisor:
Mobile Phone: 0421678473	Home Phone: Business Phone	Email: scottystandt@gmail.com		Page: 1 of 2

When drive speed over 75km/hour, Alert message appear on dash "Dumping rear air suspension " Cust. Concern:

\$1,796.39

Confirmed concern, carried out short test found fault in airmatic and Roll control unit. Processed fault in Roll control unit. Followed guided test procedure. Checked hydraulic oil level, oil level is too low. Topped up oil and corrected level, okay. Performed visual inspection, no oil leak noted. Carried out bleeding of hydraulic system. Performed high pressure test as a second step, succesfully completed. Carried out initial road test, noted vehicle lowering message appearing on instrument cluster. Carried out quick test and performed actuation of airmatic compressor, compressor noted okay. Inspected uderneath, noted both air belows have been recently replaced. Carried out vehicle level calibration, success. Carriedout another road test, vehicle lowering message no longer appearing, but lane keep assist inoperative noted to be on instrument cluster. Carried out guided test and found memory faults. Calibrated first the reverse camera, okay. Performed software update of multifunction camera and electric steering, okay. Carried out road test, still message appears when no lines are detected not okay. Carried out short test, new fault found in steering column module and SGR radar. Recommend to first replacethe steering column module. then re asses radar after replacement.

Replaced steering column module as per WIS instructions. Carried out short test and erased fault memor. Carried out road test, noted all okay, no lane keep assist malfunction appearing on instrument cluster.

Let vehicle rest, noted vehicle lowering still on the rear once standing overnight. Airmatic compressor okay, air bellows will fill upon vehicle start up. Actuating valve block, not okay, not always actuating. Recommend to first replace the valve block.

Replaced airmatic valve block as per WIS instructions. Performed level calibration, okay. Park overnight, vehicle not holding height, but noted still a slight dip in rear air bags. Raised vehicle again and sprayed all air bellows and connections, noted bubbles appearing from air intake lines into air bellows. Disconnected lines and replaced o-rings.

Let vehicle again rest and monitored overnight. All okay.

Vehicle holding full height and no error message appearing on instrument cluster.

Faults retified.

Part Description Part Number VALVE BLOCK 212 320 03 58

Nett Value Total Cost Quantity 1.019.95 1.00 1.019.95

We only use and recommend Mercedes-Benz original parts and accessories. Where a customer specifically requests the purchase of a non-genuine part it will not be covered by Mercedes-Benz warranty.

Our goods come with guarantees that cannot be excluded under the Australian Consumer Law. You are entitled to a replacement or refund for a major failure and for compensation for any other reasonably foreseeable loss or damage. You are also entitled to have the goods repaired or replaced if the goods fail to be of acceptable quality and the failure does not amount to a major failure.

119-141 Midland Highway Epsom VIC 3551 Phone: (03) 5442 3999 Fax: (03) 5444 8990 info.epsom@poysermotorgroup.com.au ABN 44 005 959 197



## Poyser Motor Group

Authorised Mercedes-Benz Sales, Service & Parts

## SERVICE TAX INVOICE

Customer No. 112	Customer Name & Address: Scott Rouke	Build Year: 2012	Odometer: 74379	Document Number: 1125903
Customer ABN:	1 Quin Dr SWAN HILL VIC	Make: Mercedes-Benz	Model: ML63 AMG	Document Date: 13/05/2021
Rego Number: AXP456	Driver Name & Address:	Vehicle ID Number: WDC1660742A059048	Paint: GREY	Repair Order Number: 267311
Stock No:	Scott Rouke 1 Quin Dr	Chassis Number: WDC1660742A059048	Key Tag No:	Tax Exempt Number:
P/Order No:	SWAN HILL VIC	Engine Number: 15798260009169	Delivery Date: 25/02/2012	Advisor: Michelle Lau
Mobile Phone: 0421678473	Home Phone: Business F	Phone: Email: scottystandt@gmail.com		Page: 2 of 2

166 900 94 07 9051

**CONTROL UNIT** 

1.00

1,547.30

1,547.30

Item Total:

\$2,567.25

We only use and recommend Mercedes-Benz original parts and accessories.

Where a customer specifically requests the purchase of a non-genuine part it will not be covered by Mercedes-Benz warranty.

Sub Total for All:

\$4,363.64

Rounding:

\$0.00

GST:

\$436.36

Total:

\$4,800.00

Our goods come with guarantees that cannot be excluded under the Australian Consumer Law. You are entitled to a replacement or refund for a major failure and for compensation for any other reasonably foreseeable loss or damage. You are also entitled to have the goods repaired or replaced if the goods fail to be of acceptable quality and the failure does not amount to a major failure.

119-141 Midland Highway Epsom VIC 3551 Phone: (03) 5442 3999 Fac. (03) 5444 8990 info.epsom@poysermotorgroup.com.au ABN 44 005 959 197



BILL TO: Scottie Truck and Trailer 1 Quin Drive Swan Hill VIC 3585

16 Chapman Street Swan Hill Victoria 3585

ABN: 47 663 896 632

Tel: 0350322660 Email: Furyengines@bigpond.com

TAX INVOICE

Tax Invoice Number: 13815

Date: 12/01/2021 Due Date: 12/01/2021

FOR:

Model: Mercedes Benz ML 63 Amg AWD (A)

Reg No: AXP456

Next Service Date: 01/12/2021 VIN: WDC1660742A059048

Year: 05/2012

Description	Qty.	Unit Price	Amount
Genuine Mercedes Yaw Rate Sensor	1.0	\$1,143.54	\$1,143.54
Labour: To remove and replace airbags, suspension compressor, yaw rate sensor.	3.0	\$70.00	\$210.00

Subtotal	\$1,353.54
GST	\$135.35
Total	\$1,488.89
Paid	\$0.00
Balance Due	\$1,488.89

Thank you for your business. Please note our NEW BANK account details:

Bank: NAB Swan Hill

Account Name: Fury Engines & Automotive Pty Ltd

BSB: 083 874 Account: 89 145 4312

Please Reference: Invoice Number or Customer Name

All goods remain the property of Fury Engines and Automotive Pty Ltd until paid in full. Accounts not paid within our credit terms may be subject to Debt Collection Fees for the recovery of such debt.

Note: All 4 tyres scrubbed and on wear indicators. Battery State of Health 71% State of Charge 51%

-		
	Subtotal	\$910.97
	GST	\$91.10
	Total	\$1,002.07
	Paid	\$0.00
	Balance Due	\$1,002.07

Thank you for your business.

Please note our NEW BANK account details:

Bank: NAB Swan Hill

Account Name: Fury Engines & Automotive Pty Ltd BSB: 083 874 Account: 89 145 4312

Please Reference: Invoice Number or Customer Name

All goods remain the property of Fury Engines and Automotive Pty Ltd until paid in full. Accounts not paid within our credit terms may be subject to Debt Collection Fees for the recovery of such debt.



BILL TO: Scottie Truck and Trailer 1 Quin Drive

Swan Hill VIC 3585

16 Chapman Street Swan Hill Victoria 3585

ABN: 47 663 896 632 Tel: 0350322660

Email: Furyengines@bigpond.com

TAX INVOICE

Tax Invoice Number: 13460

Date: 01/12/2020 Due Date: 01/12/2020

FOR:

Odometer: 73,899 Kms

Model: Mercedes Benz ML 63 Amg AWD (A)

Reg No: AXP456

Next Service Date: 01/12/2021 VIN: WDC1660742A059048

Year: 05/2012

Description	Qty.	Unit Price	Amoun
HPR5 Petrol Full Synthetic 5W40 1It	8.5	<b>#0.50</b>	
Mercedes Oil Filter		\$8.50	\$72.25
Wurth Windscreen Washer Additive	1.0	\$59.82	\$59.82
Labour-Basic Service:	1.0	\$3.00	\$3.00
Replace oil filter and drain and replace oil. Check all lights are operational, check battery, check seat belts. Inspect front and rear brakes, check condition of tyres, inspect suspension components. Replace windscreen washer fluid, check diff/transfer, front diff and gearbox fluid, check coolant level and condition, check brake fluid level and condition. Check air filter and pollen A/C filter. Test battery health, test drive vehicle. Wash vehicle.	1.5	\$90.00	\$135.00
Consumables	1,0	\$15.00	\$15,00
Environment Waste Levy	1.0	\$10.00	\$10.00
Roadworthy (Subcontracted)	TOOL THEFT PROPERTY AND ADDRESS.		
	1.0	\$185,00	\$185.00
Mercedes Air Filter Element	The about management	Plant Below years are not represented to the state of the second second	
Mercedes TS Fine Particle Filter	2.0	\$74.27	\$148.54
AND STATE OF THE PROPERTY OF T	1.0	\$179.45	\$179.45
fercedes Cabin Filter	1.0	\$57.91	\$57.91
abour to fit filters	0.5	\$90.00	\$45.00