

## SERVICE TAX INVOICE

Invoice To: 666



\*\*\* CASH SALE \*\*\*

Document No.:	1911307
Document Date:	22/05/2020
Repair Order No.:	658341
RO Creation Date:	19/05/2020
Rego No.:	XQ97LF
Make/Model:	HINO RANGER
Vehicle ID No.:	JHDFG1JSLXXX10450
Fleet No.:	
Odometer:	569924
Engine Hours:	
Delivery Date:	
Invoice To:	666
Customer ABN:	
P/Order No.:	
Page:	1 of 2

K011-BTAS Brake test and record performance, attach printout to job card.

INCLUDED IN COI INSPECTION.

COI1 Complete Roadworthy Inspection as per inspection sheet for vehicles between 4.5T and 16T

Completed Roadworthy Inspection as per inspection sheet for vehicles between 4.5T and 16T \$285.00

CARRIED OUT COI INSPECTION.

PLEASE NOTE THE FOLLOWING REPAIRS WERE CARRIED OUT WITH YOUR INSPECTION.

- \* REPLACED LH FOG LIGHT GLOBE.
- \* REPLACED LHR INDICATOR AND CLEARANCE LIGHT.
- \* ADJUSTED BRAKES AND CARRIED OUT BRAKE TESTED AND PASSED.

PLEASE NOTE THE FOLLOWING ITEM OF NOTE WERE PICKED UP DURING YOUR INSPECTION AND WILL REQUIRE REPAIRING BEFORE VEHICLE CAN PASS COI.

- \* CENTRAL SEALT BELT DOES NOT LATCH.
- \* NO PARK BRAKE DASH WARNING LIGH.
- \* CHIPPED RH HEADLIGHT.
- \* OIL LEAK FROM STEERING BOX.
- \* LH STEER LOWER SHOCK BUSHES.
- \* ROCKER HOUSING OIL LEAK.

COI STANDARD INSPECTION CHARGE

**\$109.91**

Part Number	Part Description	Quantity	Total Cost
2053	RED/AMBER SIDE MARKER LAMP	1.00	21.98
2051	AMBER FRONT END-OUTLINE LAMP	1.00	21.98
48700BL	GLOBE-H3-24V-70W PK22S PK OF 1	1.00	8.20

## SERVICE TAX INVOICE

Invoice To: 666



\*\*\* CASH SALE \*\*\*

Document No.:	1911307
Document Date:	22/05/2020
Repair Order No.:	658341
RO Creation Date:	19/05/2020
Rego No.:	XQ97LF
Make/Model:	HINO RANGER
Vehicle ID No.:	JHDFG1JSLXXX10450
Fleet No:	
Odometer:	569924
Engine Hours:	
Delivery Date:	
Invoice To:	666
Customer ABN:	
P/Order No.:	
Page:	2 of 2

56350-1

TERMINAL-ADHESIVE LINED

	4.00	2.52
<b>Parts Totals:</b>	<b>7.00</b>	<b>\$54.68</b>

**Commonwealth Bank**  
 THE BROWN AND HURLEY  
 YATALA QLD

**CUSTOMER COPY**  
 CARD NO. 4645-1069 (m)  
 EXPIRY DATE  
 VISA CARD  
 CREDIT

PURCHASE \$507.46  
**TOTAL AUD \$507.46**

**MOTO APPROVED 00**  
**22 May 2020 11:38**

TERMINAL ID 97366100  
 REFERENCE 005276  
 AUTH NUMBER 425745

THANK YOU

Advisor: Angela Cook

Workshop Trading Hours: Mon-Fri 6:30am to 9.15pm, Sat 8am to 12pm  
 \*\*\* Refrigerant trading authority number: AU13435 \*\*\*

Bank Account Details for Direct Payments:

Bank: CBA Branch: Kyogle

BSB: 062563 Account No.: 10059314 Account Name: The Brown and Hurley Group Pty Ltd


Customer's Signature

<b>PARTS</b>	\$54.68
<b>LABOUR</b>	\$394.91
<b>MISC. CONSUMABLES</b>	\$6.74
<b>ENVIRONMENTAL LEVY</b>	\$5.00
<b>SUBLET</b>	\$0.00
<b>OTHER CHARGES</b>	\$0.00
<b>TOTAL GST CHARGED</b>	\$46.13
<b>TOTAL Incl. GST</b>	<b>\$507.46</b>


# VIS-CHECK SAFETY AND EFFICIENCY REPORT

**Vehicle** IDXQ97LF      **VIS S/N** 45472      **VIN** JHDFG1JSLXXX1045      **Odometer** 569924      **Reference**  
**Date** 2:27 pm 21-May-2020      **Test #** 3147      **Axes** 2      **Inspector** STEVE MORGAN      **Customer ID**  
**Cal Due** 31-Aug-2020      **Cal** Valid      **Validity** Valid Test      **Class** HV      **Overall Result** Failed

Total Max. Brake Force      Req.( )      51535 N      Total Max. Deceleration      Req.( )      5.9 m/s/s  
 Total Park Brake Force      Req.( )      12548 N      Total Dynamic Deceleration Req.( >=4.4 )      5.4 m/s/s      Passed  
 Total Dynamic Weight      Req.( )      9406 kg

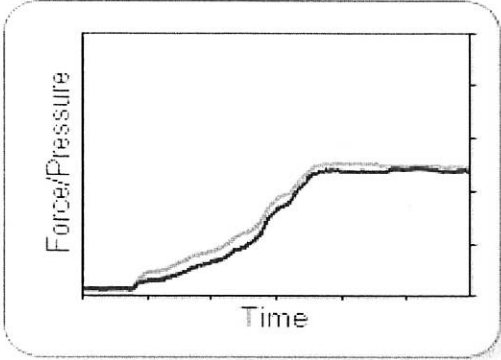

	Requirement	Left	Right	Total	P/F	Unit
Max. Brake Force		13267	12764	26031		N
Brake Balance	>=70			96	Passed	%
Max. Deceleration	>=3.0	6.7	6.4	6.5	Passed	m/s/s
Weight		1992	2010	4002		kg
Park Brake Force						N
Net Rolling Res.		239	247	486		N
Dynamic Deceleratio	>=4.4	5.5	6.2	5.8	Passed	m/s/s
Dynamic Weight		2410	2044	4454		kg
Dynamic Park Decel	>=1.5					m/s/s

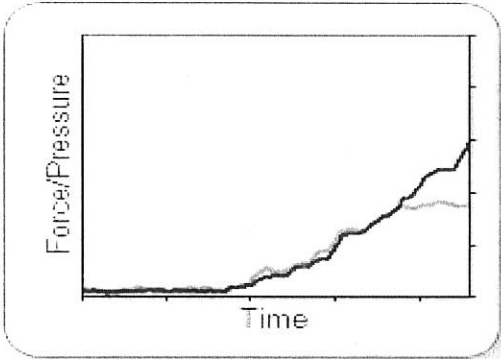


	Requirement	Left	Right	Total	P/F	Unit
Max. Brake Force		9555	15949	25504		N
Brake Balance	>=70			59	Failed	%
Max. Deceleration	>=3.0	4	7.1	5.5	Passed	m/s/s
Weight		2386	2242	4628		kg
Park Brake Force		4909	7639	12548		N
Net Rolling Res.		255	207	462		N
Dynamic Deceleratio	>=4.4	3.4	7.2	5.1	Passed	m/s/s
Dynamic Weight		2746	2206	4952		kg
Dynamic Park Decel	>=1.5	1.7	3.5	2.5	Passed	m/s/s


# VIS-CHECK SAFETY AND EFFICIENCY REPORT

**Vehicle** IDXQ97LF      **VIS S/N** 45472      **VIN** X10450      **Odometer** 569924      **Reference**  
**Date** 10:21 am 22-May-2020      **Test #** 3148      **Axes** 2      **Inspector** AARON      **Customer ID**  
**Cal Due** 31-Aug-2020      **Cal** Valid      **Validity** Valid Test      **Class** HV      **Overall Result** **Passed**

Total Max. Brake Force    Req.( )    64035 N      Total Max. Deceleration    Req.( )    7.4 m/s/s  
 Total Park Brake Force    Req.( )    13889 N      Total Dynamic Deceleration Req.( >=4.4 )    6.6 m/s/s    Passed  
 Total Dynamic Weight      Req.( )    9733 kg

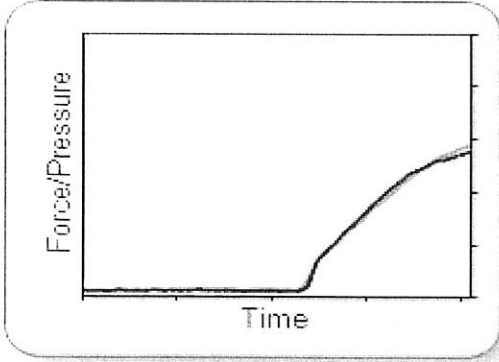

	Requirement	Left	Right	Total	P/F	Unit
Max. Brake Force		15087	14560	29647		N
Brake Balance	>=70			96	Passed	%
Max. Deceleration	>=3.0	8	6.9	7.4	Passed	m/s/s
Weight		1891	2090	3981		kg
Park Brake Force						N
Net Rolling Res.		263	231	494		N
Dynamic Deceleratio	>=4.4	6.3	6.7	6.5	Passed	m/s/s
Dynamic Weight		2392	2157	4549		kg
Dynamic Park Decel	>=1.5					m/s/s

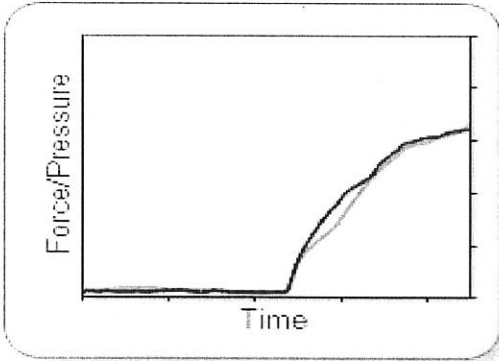

	Requirement	Left	Right	Total	P/F	Unit
Max. Brake Force		17553	16835	34388		N
Brake Balance	>=70			95	Passed	%
Max. Deceleration	>=3.0	8.1	6.9	7.5	Passed	m/s/s
Weight		2163	2429	4592		kg
Park Brake Force		5915	7974	13889		N
Net Rolling Res.		255	191	446		N
Dynamic Deceleratio	>=4.4	6.3	7	6.6	Passed	m/s/s
Dynamic Weight		2792	2392	5184		kg
Dynamic Park Decel	>=1.5	2.1	3.6	2.7	Passed	m/s/s